

USING THE HIGHWAY SAFETY RESEARCH CENTER CAR SEAT RECALL LIST

Last Revisions – Newer Model List: June 22, 2017
Older Model List: May 26, 2017

Download this list & sign up for email notification of updates: buckleupnc.org/car-seat-recall-list

About Car Seats and Recalls

It is very important to pay attention to recall notices and for parents to check if their seats are safe to use or if they need to be repaired or replaced. Recalls can be issued for any failure to meet Federal Motor Vehicle Safety Standard 213 established and enforced by the National Highway Traffic Safety Administration (NHTSA). Most recalls are issued due to reasons related to the crashworthiness of the car seat, but some recalls are for deviations from the standards related to labeling requirements, flammability of the upholstery or padding, or for parts that may come loose and pose a choking hazard.

Car seats are required to have a label indicating the manufacturer, model information, and date of manufacture. Car seats should not be used if the labels are missing such that the manufacturer, model name, model number, and date of manufacture cannot be determined.

Car seat manufacturers have supplied registration cards with each new seat since 1993. It is important for the user to complete the registration card and send it to the manufacturer for quick notification in the event of a recall or safety notification. If the card for a restraint has been lost, it can be registered by contacting the manufacturer through the phone numbers provided in the instructions and on the label on the seat.

Some recall notices are related to problems that do not make the seats unsafe in a crash, but all problems should be corrected. Phone numbers are provided on the recall list when a corrective action can be taken. The manufacturer should be able to advise the parent whether to continue using the current car seat or to obtain another one until the problem can be corrected. Parents and other caregivers are encouraged to contact the manufacturer for model specific recommendations.

In cases where the manufacturer has gone out of business or discontinued replacement programs, parents are advised to destroy the seat and use another one. Unsafe seats should NOT be thrown in the trash where they can be picked up and used by others. Discarded seats should be taken apart and stripped of upholstery, padding and straps and then destroyed by having them crushed to prevent others from using them.

To report any suspected car seat or vehicle safety defects, call the National Highway Traffic Safety Administration Auto Safety Hotline at 888-327-4236 / (TTY): 800-424-9153..

About Older Car Seats and Recalls

Car seats manufactured before 1981 were not required to be crash tested and must not be used. Most manufacturers stamp their car seats with an expiration date, typically six to eight years from the date of manufacture, on a label or in the shell of the seat. Most child passenger safety advocates recommend that if no expiration date can be found, car seats older than ten years should be replaced by a new one. Older models, those manufactured since 1981, are included as a part of this recall list because care givers will sometimes choose to use older car seats even though it goes against the recommendations of most car seat manufacturers, organizations, and advocates. Knowing that a particular model is under recall, and if the defect cannot be corrected, should help to encourage the care giver to destroy the older seat and obtain a new one.

About the HSRC Recall List

The UNC Highway Safety Research Center (HSRC) car seat recall list identifies recalls and safety notifications for car seats known by the HSRC at the time it is published. This list is updated by HSRC as soon as possible after recall notifications are announced and after the information can be verified for completeness and accuracy. To be notified via email whenever the HSRC Recall List is updated, send us an email at cps@hsrc.unc.edu

The HSRC recall list is formatted in a compact format without much detail, but does serve to indicate if a particular model has been recalled. Users of this (or any other) recall list should remind parents/caregivers to contact the manufacturer to be certain whether or not a particular car seat is affected by any recalls and how to proceed with repairs or replacement.

The HSRC recall list is formatted with older models being separated from newer models. Recalls for models of car seats where most or all of the affected units are 10 years old or older appear at the end of the list. A separate index for the older models precedes the list. The listing of older models with recalls will only be updated as "newer" models get to be old enough to be moved to the "older" models list.

The index listing numbers and page numbers for the older models section will stay the same until the older model section is updated or otherwise revised. Programs that make multiple copies of the list, e. g., for use at clinics or permanent checking/fitting stations, should only have to make copies of the older model section when it is revised regardless of how often the main (newer model) section is revised. Most clinics or permanent checking/fitting stations should only need to print/copy one or two older model lists for reference. The list title "Car Seat Recalls and Safety Notifications: MODELS 10 YEARS OLD AND OLDER" is included in the footer to make it easier to see at a glance that it is the older model list.

Instructions for Using the PDF Version of the HSRC Recall List

Find the manufacturer, model name, model number, and date of manufacture on the label of the car seat itself. Using this information:

1. Look to see if the manufacturer and model name and/or model number are listed in the index*. **Car seats under recall are listed in the index by both model name and model number.** Each entry on the list and in the index is assigned a listing number (List No.) based on its location in the list. The list is alphabetized by manufacturer and model name. List numbers for individual models will change in subsequent lists as models are added to or removed from the list.
2. If that model name or model number is listed in the index, make note of the "List No." and use the List No. to locate the recall information for that model. Once located, check to see if the date range for the recall includes the date of manufacture listed on the label of the car seat.
3. If the seat is included in the recall, the manufacturer should be contacted for verification of the recall and steps to take to correct the problem.
4. If the manufacturer has gone out of business or discontinued their repair or replacement program, the car seat should be destroyed after a replacement seat is obtained.
5. If the car seat is not included in the recall, inform the parent of this but still refer the parent to the manufacturer for verification of the seat's recall status and to make sure it is registered with the manufacturer in case there is a recall issued on it in the future.

*Notes:

- 1) Dorel Juvenile Group (DJG) products are indexed under each individual product line (Alpha Elite, Beatrix Potter, Cosco, Eddie Bauer, Maxi-Cosi, and Safety 1st) as well as under the broader "Dorel" label.
- 2) Graco announced a recall in February 2014 on the harness buckles used on most convertible car seats and harnessed booster seats manufactured from 2009 through July 2013. Since model numbers's are not available for the model names included in this recall, Graco seats with dates from 2009 through July 2013 should be looked up by model name rather than number.

For further information, contact:

Bill Hall or Bevan Kirley

The University of North Carolina Highway Safety Research Center

CB# 3430, Chapel Hill, NC 27599

800-672-4527 x2 or cps@hsrc.unc.edu

www.buckleupnc.org/car-seat-recall-list

The following lists identify recalls and safety notifications for car seats known by the UNC Highway Safety Research Center (HSRC) as of June 22, 2017. This list is updated by HSRC as soon as possible after recall notifications are announced. The most recent additions to the list are denoted by >>. Updated versions are available on-line at www.buckleupnc.org/car-seat-recall-list

Car seats are required to have labels indicating the manufacturer, model name and number, and date of manufacture. Model names and numbers are listed for most of the recalls. For the model numbers, "x" means that more numbers or letters follow. If the label is missing on a car seat, contact the manufacturer to see if it can be identified through other information. **A car seat should not be used if its recall status cannot be determined because the model name, model number, date of manufacture or manufacturer is not available.**

Car seats manufactured before 1981 were not required to be crash tested and must not be used. Car seats beyond their expiration dates should also not be used. Most car seats expire after 6 years from the date of manufacture, but expiration dates vary by manufacturer and model. Most manufacturers stamp their car seats, on a label or in the shell, with an expiration date, typically six to eight years from the date of manufacture. If needed, you can call the manufacturer. **Models older than ten years and under recall are included on a separate list with a separate index** for use as a reference. The index for older models can be found following the last page of the "Models Less Than 10 Years Old" list and the list of older models with recalls follows the second index. **The "Models At Least 10 Years Old" list was last revised May 26, 2017.**

Some of the recalls/notifications for car seats on this list may be more or less date- or lot-specific than what is listed. More detailed information should be obtained through the manufacturer and **it is the manufacturer who can and should make the final determination if a specific car seat is subject to recall.**

Some of the recall notices are related to problems that do not make the seats unsafe in a crash, but **all problems should be corrected.** Phone numbers are provided when a corrective action can be taken. The manufacturer should advise you whether to continue using your current car seat or to obtain another one until the problem can be corrected.

In cases where the manufacturer has gone out of business or discontinued replacement programs, you are advised to destroy the car seat and obtain and use another one as soon as possible. Do not throw unsafe models in the trash where they can be picked up and used by others. Discarded car seats should be destroyed by having them crushed. At the very least, they should be taken apart and stripped of upholstery, padding and straps to prevent others from using them.

To report any suspected car seat or vehicle safety defects, contact the National Highway Traffic Safety Administration Auto Safety Hotline: (888) 327-4236 / (TTY): 800-424-9153.

CAR SEATS LESS THAN 10 YEARS OLD

Download this list & sign up for email notification of updates: buckleupnc.org/car-seat-recall-list

Index of Recalls and Safety Notifications
For the model numbers "x" = more numbers or letters follow.

Model numbers and model names for car seats under recall are followed by their index number which corresponds to the "List No." for each listing. If the model number is not found, check the model name also. Model numbers are not available for all model names.

- Notes:**
- 1) Dorel Juvenile Group products are indexed under each individual product line (Alpha Elite, Alpha Sport, Beatrix Potter, Bertini, Cosco, Eddie Bauer, Maxi-Cosi, and Safety 1st) as well as under "Dorel."
 - 2) Graco issued recalls in February and July 2014 on the harness buckles used on many convertible, harnessed booster, and infant seats manufactured from 2009 through January 2014. Since model #'s are not available for the model names included in this recall, Graco seats with dates from 2009 through January 2014 should be looked up by model name rather than number.

<p>4moms # 1032 2 Infant Car Seat 2</p>	<p>Alcot ALL MODELS 2</p> <p>All Our Kids ALL MODELS 3</p>	<p>Alpha Elite (Dorel) # 22148x 5 # 22149x 5 # 22158x 5 # 22459x 5</p>
---	--	--

For the model numbers "x" = more numbers or letters follow

Index number refers to "List No." for each listing

Alpha Elite (Dorel) (continued)	# E1A016H	31	# E9LT85S	31
# 22462x	# E1A025Q	23	# E9LT86A	31
Alpha Luxe	# E1A116L	37	# E9LT86F	31
Alpha Omega All-N-1	# E1A135Q	31	# E9LT86G	31
Alpha Omega Elite	# E1A183F	26	# E9LT86H	31
	# E1A185x	26	# E9LT95N	23
Alpha Sport (Dorel)	# E1A186R	26	# E9LT95Q	23
# 22452x	# E1A203F	26	# E9LT95Z	23
# 22458x	# E1A205x	26	# E9LU63F	24
# 22546x	# E1A206x	26	# E9LU65P	24
# 22547x	# E1A207E	26	# E9LU65V	26
Enspira	# E1A215x	28	# E9LU66R	24
Vantage	# E1A216P	28	# E9LU66x	26
	# E1A221Q	28	# E9LU67x	26
American Motors	# E1A225x	28	# EXA116L	37
ALL MODELS	# E1A226L	28	# EXA185M	26
	# E9L14	34	# EXA216L	28
Baby Jogger	# E9L20	34	# EXLT34A	29
# BJ61500	# E9L5490	36	# EXLU65M	24
# BJ64510	# E9L54E7	35, 36	# S01298600	28
# BJ64529	# E9L54H6	35	# S01635200	25
# BJ70411	# E9L54H7	35	# S02063xxx	26, 28
# BJ70424	# E9L54M6	35	# S02064000	28
# BJ70431	# E9L692J	33	# S03803xxx	26
# BJ72510	# E9L692K	33	# S04144xxx	26
# BJ80400	# E9L692L	33	# S04145000	26
City GO Car Seat	# E9L692M	33	# S04281xxx	28
City GO Car Seat Base	# E9L69P2	32	# S04402800	26
City Mini Car Seat/Stroller	# E9L69P3	32	# S04628500	28
Vue Lite Car Seat/Stroller	# E9L69P5	32	# S04884xxx	26
	# E9L80	34	# S04975600	26
Baby Trend	# E9LG81A	22	# S04978900	26
# 6400	# E9LG83x	22	# S05260200	26
# 6439	# E9LJ91x	30	# S06018800	28
# 6448	# E9LJ92E	30	# S06020xxx	26, 28
# 6481	# E9LJ93P	30	# S06051300	28
# FB60070	# E9LJ93S	30	# S06147100	26
# FB60408	# E9LK31x	38	# S914900	25
Rigid Latch-Loc	# E9LK32x	38	# S915200	25
Rigid Latch-Loc Base	# E9LK33Q	38	# S915400	25
TrendZ Fastback	# E9LK91A	30	# S921800	26
	# E9LL11x	38	# S921900	25
Babyhood Industries	# E9LL12x	38	# S923700	28
ALL MODELS	# E9LL21A	22	Advocate 70-G3	22
	# E9LL23P	22	Advocate ClickTight	23
Basic Comfort	# E9LL23Y	22	B-Agile Travel System	25
ALL MODELS	# E9LS55T	27	B-Safe 35	24, 26
	# E9LS55U	27	B-Safe 35 Elite	27, 28
Beatrix Potter (Dorel)	# E9LS56P	27	B-Safe 35 Elite Travel Systems	28
ALL MODELS	# E9LS5xx	28	B-Safe 35 Elite XE	27
	# E9LS63F	24	B-Safe 35 Travel System	25
Bertini (Dorel)	# E9LS65U	27	B-Safe 35 Travel Systems	26
# 22346x	# E9LS66C	27	B-Safe 35 XE	24
SureFit	# E9LT34x	29	B-Safe BOB 35	29
	# E9LT35X	29	Boulevard 70-G3	30
Bolform	# E9LT71Q	37	Boulevard ClickTight	31
ALL MODELS	# E9LT75R	37	Chaperone	32, 33
	# E9LT76B	37	Companion	34
Britax	# E9LT76L	37	Frontier	35, 36
# E1A005R	# E9LT76N	37	Marathon ClickTight	37
# E1A006B	# E9LT76P	37	Pavilion 70-G3	38
# E1A015Q	# E9LT85Q	31		
# E1A016A		31		

For the model numbers "x" = more numbers or letters follow

Index number refers to "List No." for each listing

Century	Touriva	55	# 22-627 SNW (Eddie Bauer)	62
ALL MODELS		39	# 22-627 WAV (Safety 1st)	149
	Cybox (Regal Lager)		# 22-627 WPR (Eddie Bauer)	62
Chicco	# 0500200xx	56	# 22-655 BYTE (Eddie Bauer)	62
# All	# 0500760xx	56	# 22077x (Safety 1st)	150
Cortina Travel System	Solution X-fix	56	# 22078x (Safety 1st)	150
Key Fit			# 22100x (Cosco)	55
Key Fit 30			# 22111x (Cosco)	55
	Disney (Dorel)		# 22130x (Cosco)	55
Childcare	# 22-305 NAB	57	# 22139MON (Cosco)	54
ALL MODELS	# 22-305 PPH	57	# 22148x (Alpha Elite)	5
	# 22-355 LBF	57	# 22149x (Alpha Elite)	5
	# 22-355 PWK	57	# 22150x (Cosco)	50
Chrysler [Aftermarket]	# 22-627 AWF	57	# 22152x (Safety 1st)	144
ALL MODELS	Infant Car Seat	57	# 22154x (Cosco)	51
			# 22155x (Cosco)	51
Chrysler [Integrated]	Dodge [Integrated]		# 22158x (Alpha Elite)	5
Town and Country	Caravan	164, 165, 166, 167	# 22158x (Cosco)	51
	Grand Caravan	164, 165, 166, 167	# 22159x (Safety 1st)	144
			# 22172x (Safety 1st)	144
Collier-Keyworth	Dorel		# 22177x (Safety 1st)	144
ALL MODELS	(Beatrix Potter)	19	# 22178x (Safety 1st)	144
	# 22-057 CLN (Safety 1st)	149	# 22185x (Safety 1st)	144
Combi	# 22-057 DBY (Safety 1st)	149	# 22187xxx (Safety 1st)	145
# 8065	# 22-057 HRT (Safety 1st)	149	# 22188x (Safety 1st)	144
# 8074	# 22-057 LPH (Safety 1st)	149	# 22195x (Safety 1st)	144
# 8086	# 22-085 DWA (Safety 1st)	149	# 22346x (Bertini)	20
# 8087	# 22-085 LYN (Safety 1st)	149	# 22356x (Safety 1st)	150
# 8220	# 22-095 RBK (Safety 1st)	149	# 22371x (Maxi-Cosi)	124
# 8220x	# 22-300 CSF (Cosco)	53	# 22372x (Maxi-Cosi)	124
# 8520	# 22-300 FZN (Cosco)	53	# 22412x (Safety 1st)	144
# 8815	# 22-300 JJV (Cosco)	53	# 22439x (Safety 1st)	146
# 8836	# 22-300 OSF (Cosco)	53	# 22449x (Safety 1st)	146
Centre	# 22-300 THD (Cosco)	53	# 22452x (Alpha Sport)	6
Coccoro	# 22-300 TWD (Cosco)	53	# 22453x (Safety 1st)	148
Shuttle	# 22-305 NAB (Disney)	57	# 22456x (Safety 1st)	144
Zeus 360	# 22-305 PPH (Disney)	57	# 22458x (Alpha Sport)	6
Zeus Turn	# 22-322 HRR (Safety 1st)	149	# 22459x (Alpha Elite)	5
	# 22-322 KDL (Safety 1st)	149	# 22462x (Alpha Elite)	4
Compass Baby	# 22-322 LXI (Safety 1st)	149	# 22465x (Safety 1st)	144
ALL MODELS	# 22-322 MAI (Safety 1st)	149	# 22465xxx (Safety 1st)	145
	# 22-322 OLY (Safety 1st)	149	# 22469x (Safety 1st)	144
Cosco	# 22-322 PRS (Safety 1st)	149	# 22475x (Safety 1st)	153
# 22-300 CSF	# 22-322 PTK (Safety 1st)	149	# 22476x (Maxi-Cosi)	125
# 22-300 FZN	# 22-325 COB (Safety 1st)	149	# 22486x (Maxi-Cosi)	125
# 22-300 JJV	# 22-325 PAC (Safety 1st)	149	# 22546x (Alpha Sport)	7
# 22-300 OSF	# 22-355 LBF (Disney)	57	# 22547x (Alpha Sport)	7
# 22-300 THD	# 22-355 PWK (Disney)	57	# 22553x (Safety 1st)	154
# 22-300 TWD	# 22-371 (Eddie Bauer)	122	# 22554x (Safety 1st)	154
# 22100x	# 22-371 HFL (Maxi-Cosi)	123	# 22560x (Safety 1st)	154
# 22111x	# 22-371 JUC (Maxi-Cosi)	123	# 22561x (Safety 1st)	154
# 22130x	# 22-371 LMD (Maxi-Cosi)	123	# 22564x (Safety 1st)	154
# 22139MON	# 22-371 ORE (Maxi-Cosi)	123	# 22567x (Safety 1st)	154
# 22150x	# 22-371 PNG (Maxi-Cosi)	123	# 22574x (Safety 1st)	154
# 22154x	# 22-372 (Eddie Bauer)	122	# 22580x (Safety 1st)	152
# 22155x	# 22-372 TTH (Maxi-Cosi)	123	# 22657x (Eddie Bauer)	64
# 22158x	# 22-380 LGA (Safety 1st)	149	# 22740x (Eddie Bauer)	61
# 93100x	# 22-380 MSA (Safety 1st)	149	# 22741x (Eddie Bauer)	61
# 93111x	# 22-515 (Eddie Bauer)	122	# 22755x (Eddie Bauer)	59
# IC123 FSM	# 22-515 BLK (Maxi-Cosi)	123	# 22758x (Eddie Bauer)	59
Alpha Omega All-N-1	# 22-627 AWF (Disney)	57	# 22759x (Eddie Bauer)	59
Alpha Omega Elite	# 22-627 CGT (Eddie Bauer)	62	# 22790x (Eddie Bauer)	59
Comfy Carry	# 22-627 FRK (Eddie Bauer)	62		
Infant Car Seat	# 22-627 KGS (Eddie Bauer)	62		
Regal Ride				

For the model numbers "x" = more numbers or letters follow

Index number refers to "List No." for each listing

Dorel (continued)	# 22755x	59	Discovery	68, 69
# 22790xxx (Eddie Bauer)	# 22758x	59	Embrace 35	70
# 22799x (Eddie Bauer)	# 22759x	59	Evolve 3-in-1	71
# 22880x (Eddie Bauer)	# 22790x	59	Express Factory Select	72
# 93100x (Cosco)	# 22790xxx	60	First Choice	73
# 93111x (Cosco)	# 22799x	59	Maestro	74, 75
# CC033xxx (Safety 1st)	# 22880x	63	Maestro Factory Select	75
# CC046xxx	# CC046xxx	60	Momentum 65	76
# CC046xxx (Eddie Bauer)	# IC072x	64	Momentum 65 DLX	76
# CC046xxx (Safety 1st)	Deluxe 3-in-1	59, 60	Secure Kid 100	77
# CC050xxx (Safety 1st)	Enspira	61	Secure Kid 300	77
# CC051xxx (Safety 1st)	Infant Car Seat	62	Secure Kid 400	77
# IC072x (Eddie Bauer)	Prospect Adjustable Hiback Booster	63	Secure Kid LX	77
# IC123 FSM (Cosco)	SureFit	64	Secure Kid LX Factory Sel	77
# IC124 FSM (Safety 1st)			Snugli All-in-One	78
Alpha Luxe (Alpha Elite)	Evenflo		Snugli Booster	79
Alpha Omega All-N-1 (Alpha Elite)	# 3021769Z	69	Snugli Embrace 35	80
Alpha Omega All-N-1 (Cosco)	# 3021854Z	69	SureRide DLX	81
Alpha Omega All-N-1 (Safety 1st)	# 306xxx	66	Symphony	83
Alpha Omega Elite (Alpha Elite)	# 30711365	80	Symphony 65 DLX	82
Alpha Omega Elite (Cosco)	# 308xxx	77, 79	Symphony 65 E3	83
Alpha Omega Elite (Safety 1st)	# 30911118AD	65	Symphony DLX	82
Avenue (Safety 1st)	# 30911120D	65	Symphony LX	82
Comfy Carry (Cosco)	# 30911173AD	65	Titan 65	84
Complete Air LX	# 3091967AD	65	Titan 65 Factory Select	84
Deluxe 3-in-1 (Eddie Bauer)	# 31011048	74	Transitions	85
Enspira (Alpha Sport)	# 31011049	74		
Enspira (Eddie Bauer)	# 31011057C	74	Fisher Price	
Enspira (Safety 1st)	# 31011059	74	ALL MODELS	86
Infant Car Seat (Cosco)	# 3101198	74		
Infant Car Seat (Disney)	# 3101980	74	Ford [Aftermarket]	
Infant Car Seat (Eddie Bauer)	# 310xxx	75	ALL MODELS	87
Infant Car Seat (Safety 1st)	# 3151198	70		
Mico (Maxi-Cosi)	# 31511xxx	70	Ford [Integrated]	
OnBoard (Safety 1st)	# 3151953	70	Windstar	168
OnBoard 35 (Safety 1st)	# 31521138	70		
Priori (Maxi-Cosi)	# 329xxx	67, 72	General Motors [Aftermarket]	
Prospect (Safety 1st)	# 34411029	85	ALL MODELS	88
Prospect Adjustable Hiback Booster (Eddie Bauer)	# 34411686	85		
Regal Ride (Cosco)	# 34411695	85	Gerry	
SureFit (Bertini)	# 34411700	71	ALL MODELS	89
SureFit (Eddie Bauer)	# 34411741	71		
Touriva (Cosco)	# 345xxx	82	Graco	
Uptown (Safety 1st)	# 346xxx	78, 83	# 1794333	98
Vantage (Alpha Sport)	# 3604098	73	# 1794334	104
Vantage (Safety 1st)	# 371xxx	81, 84	# 1812930	93
Vantage Highback (Safety 1st)	# 385xxx	76	# 1813015	104
Vantage Point/Surveyor (Safety 1st)	# 390	68	# 1813040	98
	# 391	68	# 1813074	104
	# 46811xxx	70	# 1853478	104
	# 48111xxx	70	# 1871689	104
	# 48411xxx	70	# 1872691	104
	# 52911307A	70	# 1877535	104
	# 52921040	70	# 1908152	104
	# 534	68	# 1910130	102
	# 552	68	# 1923980	102
	# 55311xxx	70	# 1924519	109
	Big Kid Booster	65	# 1924520	109
	Chase DLX	67	# 1926538	102
	Chase Factory Select	66	# 1926539	102
	Chase LX	66, 67	# 1954477	100
	Chase Select	66	# 1963973	117
			# 1963974	117
Downunder				
ALL MODELS				
Eddie Bauer				
# 22-627 CGT		62		
# 22-627 FRK		62		
# 22-627 KGS		62		
# 22-627 SNW		62		
# 22-627 WPR		62		
# 22-655 BYTE		62		
# 22657x		64		
# 22740x		61		
# 22741x		61		

For the model numbers "x" = more numbers or letters follow

Index number refers to "List No." for each listing

Graco (continued)	Maxi-Cosi	Pride Trimble/Virco
# 1963975 117	# 22-371 122	ALL MODELS 132
# 1963976 117	# 22-371 HFL 123	
# 1967886 117	# 22-371 JUC 123	Questor
# 1975173 117	# 22-371 LMD 123	ALL MODELS 133
# 8487x 92	# 22-371 ORE 123	
# 8686x 92	# 22-371 PNG 123	Recaro
# 8689x 92	# 22-372 122	# 330.00.xxx 141
# 8C02MRC2 95	# 22-372 TTH 123	# 330.01.xxx 141
# 8C04FRR 96	# 22-515 122	# 331.00.xxx 134, 135, 136, 140
# 8C04FRR2 96	# 22-515 BLK 123	# 331.01.xxx 136
# 8D01x 92	# 22371x 124	# 332.01.xxx 138
# 8D02x 92	# 22372x 124	# 333.01.xxx 137
# 8D03x 92	# 22476x 125	# 385.01.xxx 139
# 8D04x 92	# 22486x 125	Como 134, 135, 136
# 8D05x 92	Mico 122, 123, 124	Performance RIDE 137
# 8D10x 92	Priori 125	ProRIDE 138
Aprica A30 90		ProSport 139
Argos 70 91	Mercedes-Benz USA	Signo 140, 141
Argos 70 Elite 91	ALL MODELS 126	
CarGo 92		Regal Lager (Cybex)
Classic Ride 93	Mia Moda	# 0500200xx 56
Classic Ride 50 94	# 5000 127	# 0500760xx 56
ComfortSport 95, 96, 97, 98	# 5001 127	Solution X-fix 56
Cozy Cline 99	# 5050 127	
Extend2Fit 100	# 5051 127	Renolux (FBS)
Head Wise 70 + SftySurnd 101	# 5070 127	ALL MODELS 142
Milestone 102	# 5071 127	
My Ride 65 103, 104	# 5080 127	Safeline Kids (see Triple Play also)
My Ride 65 + SftySurnd 103	# 5081 127	ALL MODELS 143
My Ride 70 105	Viva 127	
My Size 70 106	Viva Supreme 127	Safety 1st (Dorel)
Nautilus 3-in-1 107		# 22-057 CLN 149
Nautilus Elite 107	Orbit Baby	# 22-057 DBY 149
Nautilus Plus 107	# ORB822000 (Base) 128	# 22-057 HRT 149
Ready Ride 108, 109	Car Seat Base G2 128	# 22-057 LPH 149
SafeSeat - Step 2 110		# 22-085 DWA 149
Size4Me70 111	Peg Perego	# 22-085 LYN 149
Smart Seat 112	# 32MD41KN41 130	# 22-095 RBK 149
Smart Seat + SftySurnd 112	# 35CR13BU13 130	# 22-322 HRR 149
Snug Ride 113	# 35CR13PL46 130	# 22-322 KDL 149
Snug Ride 30 114	# 35CR24BU24 130	# 22-322 LXI 149
Snug Ride 35 115	# 35TL49KN53 130	# 22-322 MAI 149
Snug Ride Classic Conct 30 114	# 35TL53KN46 130	# 22-322 OLY 149
Snug Ride Classic Conct 35 115	# 61FG13ST53 130	# 22-322 PRS 149
Snug Ride Click Conct 40 116	# 61FG53ST49 130	# 22-322 PTK 149
SnugRide Classic Connect 113	# 61FG53ST64 130	# 22-325 COB 149
TurboBooster 117	# 61ST13IC53 130	# 22-325 PAC 149
	# 61ST34IC53 130	# 22-380 LGA 149
International	# 61ST48IC53 130	# 22-380 MSA 149
ALL MODELS 118	# CS00MU1 130	# 22-627 WAV 149
	# IMCB00JA57RJ31JU31 129	# 22077x 150
Kiddy USA	Jacadi 129	# 22078x 150
# 51 100 WP 119	Primo Viaggio SIP 30/30 130	# 22152x 144
World Plus 119		# 22159x 144
	Playskool	# 22172x 144
Kolcraft	ALL MODELS 131	# 22177x 144
ALL MODELS 120		# 22178x 144
	Plymouth [Integrated]	# 22185x 144
Lin Lih/MCP	Grand Voyager 169, 170, 171, 172	# 22187xxx 145
ALL MODELS 121	Voyager 169, 170, 171, 172	# 22188x 144
		# 22195x 144
		# 22356x 150

Safety 1st (Dorel) (continued)

22412x 144

22449 146

22453x 148

22456x 144

22465x 144

22465xxx 145

22469x 144

22475x 153

22553x 154

22554x 154

22560x 154

22561x 154

22564x 154

22567x 154

22574x 154

22580x 152

CC033xxx 145

CC046xxx 145

CC050xxx 147

CC051xxx 147

IC124 FSM 151

22439x 146

Alpha Omega All-N-1 144

Alpha Omega Elite 144, 145

Avenue 146

Complete Air LX 147

Enspira 148

Infant Car Seat 149

OnBoard 150

OnBoard 35 151

Prospect 152

Uptown 153

Vantage 154

Vantage Highback 154

Vantage Point/Surveyor 154

Snugli

See Evenflo 78, 79, 80

Strolee

ALL MODELS 154, 155

Team-Tex

374199 156

Babyride 156

Triple Play (see Safeline Kids also)

4002 157

Sit'n'Stroll 157

TRW

ALL MODELS 158

XSCi

ALL MODELS 159

Recent additions to the list are denoted by >>

<i>List No.</i>	<i>Manufacturer Model Name</i>	<i>Model No. (X = more numbers or letters follow)</i>	<i>Customer Assistance Mfg Date</i>	<i>Problem Type and Consumer Action</i>
4moms <i>4moms - 888-614-6667 / www.4moms.com</i>				
2)	Infant Car Seat	1032	07/01/16-10/31/16	The hooks that lock the carrier into the base can stick and fail to attach the carrier to the car seat base. Contact mfg. for free replacement seat.
2)	Alcot (Childcare) <i>REFER TO OLDER MODELS LIST - ALL MODELS ARE OLDER THAN 10 YEARS - REPLACEMENT PROGRAM DISCONTINUED - DESTROY & REPLACE</i>			
3)	All Our Kids <i>REFER TO OLDER MODELS LIST - ALL MODELS ARE OLDER THAN 10 YEARS - REPLACEMENT PROGRAM DISCONTINUED - DESTROY & REPLACE</i>			
Alpha Elite (Dorel) <i>Dorel Juvenile Group: 866-623-3139 / 800-219-0509 / 866-611-3022 / 812-372-0141 www.djgusa.com</i>				
4)	Alpha Luxe	22462x	05/01/08-04/30/09	Harness locking and release button does not always return to its locked position and could result in a loose harness, increasing the risk of being injured a crash. Contact mfg. for repair kit.
5)	Alpha Omega All-N-1 Alpha Omega Elite	22459x 22148x, 22149x, 22158x	05/01/08-04/30/09	Harness locking and release button does not always return to its locked position and could result in a loose harness, increasing the risk of being injured a crash. Contact mfg. for repair kit.
Alpha Sport (Dorel) <i>Dorel Juvenile Group: 866-623-3139 / 800-219-0509 / 866-611-3022 / 812-372-0141 www.djgusa.com</i>				
6)	Enspira	22452x, 22458x	05/01/08-04/30/09	Harness locking and release button does not always return to its locked position and could result in a loose harness, increasing the risk of being injured a crash. Contact mfg. for repair kit.
7)	Vantage	22546x, 22547x	05/01/08-04/30/09	Harness locking and release button does not always return to its locked position and could result in a loose harness, increasing the risk of being injured a crash. Contact mfg. for repair kit.
8)	American Motors <i>REFER TO OLDER MODELS LIST - ALL MODELS ARE OLDER THAN 10 YEARS - REPLACEMENT PROGRAM DISCONTINUED - DESTROY & REPLACE</i>			
Baby Jogger <i>800-241-1848 - www.babyjogger.com</i>				
9)	City GO Infant Car Seat	BJ64510, BJ64529	11/03/14-04/30/15	The labels, instruction manual, and registration card of affected models do not comply with FMVSS 213 requirements for content and formatting. Contact mfg. for free replacement car seat.
10)	City GO Infant Car Seat Base	BJ80400, BJ61500	11/03/14-04/30/15	The labels, instruction manual, and registration card of affected models do not comply with FMVSS 213 requirements for content and formatting. Contact mfg. for free replacement car seat.
11)	City Mini Infant Car Seat/ Stroller System	BJ72510	11/03/14-04/30/15	The labels, instruction manual, and registration card of affected models do not comply with FMVSS 213 requirements for content and formatting. Contact mfg. for free replacement car seat.
12)	Vue Lite Infant Car Seat/ Stroller System	BJ70411, BJ70424, BJ70431	11/03/14-04/30/15	The labels, instruction manual, and registration card of affected models do not comply with FMVSS 213 requirements for content and formatting. Contact mfg. for free replacement car seat.
Baby Trend <i>800-328-7363 - www.babytrend.com</i>				
13)	Hybrid 3-in-1 LX	FB48417, FB58181	07/14/16-07/23/16	The center adjuster may detach in a crash when used in the harnessed mode with a child weighing more than 40lbs. Contact mfg. for free replacement seat.

Recent additions to the list are denoted by >>

List No.	Manufacturer	Model No. (X = more numbers or letters follow)	Customer Assistance	
	Model Name		Mfg Date	Problem Type and Consumer Action
Baby Trend (continued)				
14)	Rigid Latch-Loc	6439, 6448, 6481	05/14/07- 04/01/08	Incorrect steel used on the latch connector can crack and allow the child seat base to detach from the vehicle's latch anchors during a severe crash. Contact mfg. for a replacement base. Install with vehicle seat belt until base is replaced.
15)	Rigid Latch-Loc Base	6400	05/14/07- 04/01/08	Incorrect steel used on the latch connector can crack and allow the child seat base to detach from the vehicle's latch anchors during a severe crash. Contact mfg. for a replacement base. Install with vehicle seat belt until base is replaced.
16)	TrendZ Fastback 3-in-1	FB60070, FB60408	10/01/11- 07/31/13	The harness buckle may become stuck in a latched condition so that it cannot be opened by pushing the release button, thus making it difficult to remove the child from the restraint in an emergency. Contact mfg. for replacement buckle.
17)	Babyhood Industries		REFER TO OLDER MODELS LIST - ALL MODELS ARE OLDER THAN 10 YEARS - REPLACEMENT PROGRAM DISCONTINUED - DESTROY & REPLACE	
18)	Basic Comfort		REFER TO OLDER MODELS LIST - ALL MODELS ARE OLDER THAN 10 YEARS - REPLACEMENT PROGRAM DISCONTINUED - DESTROY & REPLACE	
19)	Beatrix Potter (Dorel)		REFER TO OLDER MODELS LIST	
Bertini (Dorel)		Dorel Juvenile Group: 866-623-3139 / 800-219-0509 / 866-611-3022 / 812-372-0141 www.djgusa.com		
20)	SureFit (Travel system)	22346x	05/01/08- 04/30/09	Harness locking and release button does not always return to its locked position and could result in a loose harness, increasing the risk of being injured a crash. Contact mfg. for repair kit.
21)	Bolform Corp.		REFER TO OLDER MODELS LIST - ALL MODELS ARE OLDER THAN 10 YEARS - REPLACEMENT PROGRAM DISCONTINUED - DESTROY & REPLACE	
Britax		888-427-4829 / 704-409-1699 - Britax.Recall@britax.com / www.britaxusa.com		
22)	Advocate 70-G3	E9LG81A, E9LG83x, E9LL21A, E9LL23P, E9LL23Y	06/01/12- 08/31/12	Children who bite or chew on the shoulder strap HUGS pads could bite off small pieces, presenting a choking hazard. Contact mfg. for replacement HUGS pads and instructions.
23)	Advocate ClickTight	E1A025Q, E9LT95N, E9LT95Q, E9LT95Z	08/01/14- 07/29/15	The harness adjuster button (red) on affected models may remain down in the "release" position after the harness is tightened. This will enable the shoulder harnesses to loosen from a child's movements while secured in the seat. Contact mfg. for repair kit.

Recent additions to the list are denoted by >>

List No.	Manufacturer Model Name	Model No. (X = more numbers or letters follow)	Customer Assistance	
			Mfg Date	Problem Type and Consumer Action
Britax (continued)				
24)	B-Safe 35 B-Safe 35 XE	E9LU65M, E9LU65P, E9LU63F, E9LU66R, EXLU65M, E9LS63F	10/01/14- 07/01/15	Cracks may develop in the carry handle, potentially resulting in injury if the cracks cause the handle to break. Recall does not affect the safety performance of the seat when used in a motor vehicle. Customers may continue using the car seat when secured in a vehicle or stroller but should not lift or carry the seat by the carry handle until the remedy kit has been installed. Contact mfg. for repair kit. Visit www.bsaf35recall.com for more information.
25)	B-Safe 35 Travel System B-Agile Travel System	S914900, S915400, S915200, S01635200, S921900	10/01/14- 07/01/15	Cracks may develop in the carry handle, potentially resulting in injury if the cracks cause the handle to break. Recall does not affect the safety performance of the seat when used in a motor vehicle. Customers may continue using the car seat when secured in a vehicle or stroller but should not lift or carry the seat by the carry handle until the remedy kit has been installed. Contact mfg. for repair kit. Visit www.bsaf35recall.com for more information.
>> 26)	B-Safe 35 B-Safe 35 Travel Systems	E1A183F, E1A185x, E1A186R, E1A203F, E1A205x, E1A206x, E1A207E, E9LU65V, E9LU66x, E9LU67x, EXA185M, S02063xxx, S03803xxx, S04144xxx, S04145000, S04402800, S04884xxx, S04975600, S04978900, S05260200, S06020xxx, S06147100, S921800	11/01/15- 05/31/17	The center tab on the chest clips of the affected seats can break, presenting a choking hazard. Contact mfg. for repair kit. Affected seats can be safely used as long as consumers remove the chest clip or monitor it for signs of breakage.
27)	B-Safe 35 Elite B-Safe 35 Elite XE	E9LS55T, E9LS56P, E9LS55U, E9LS66C, E9LS65U	10/01/14- 07/01/15	Cracks may develop in the carry handle, potentially resulting in injury if the cracks cause the handle to break. Recall does not affect the safety performance of the seat when used in a motor vehicle. Customers may continue using the car seat when secured in a vehicle or stroller but should not lift or carry the seat by the carry handle until the remedy kit has been installed. Contact mfg. for repair kit. Visit www.bsaf35recall.com for more information.
>> 28)	B-Safe 35 Elite B-Safe 35 Elite Travel Systems	E1A215x, E1A216P, E1A221Q, E1A225x, E1A226L, E9LS5xx, EXA216L, S01298600, S02063xxx, S02064000, S04281xxx, S04628500, S06018800, S06020xxx, S06051300, S923700	11/01/15- 05/31/17	The center tab on the chest clips of the affected seats can break, presenting a choking hazard. Contact mfg. for repair kit. Affected seats can be safely used as long as consumers remove the chest clip or monitor it for signs of breakage.
>> 29)	B-Safe BOB 35	E9LT34x, E9LT35X, EXLT34A	11/01/15- 05/31/17	The center tab on the chest clips of the affected seats can break, presenting a choking hazard. Contact mfg. for repair kit. Affected seats can be safely used as long as consumers remove the chest clip or monitor it for signs of breakage.
30)	Boulevard 70- G3	E9LJ91x, E9LJ92E, E9LJ93P, E9LJ93S, E9LK91A	06/01/12- 08/31/12	Children who bite or chew on the shoulder strap HUGS pads could bite off small pieces, presenting a choking hazard. Contact mfg. for replacement HUGS pads and instructions.
31)	Boulevard ClickTight	E1A015Q, E1A016A, E1A016H, E1A135Q, E9LT85Q, E9LT85S, E9LT86A, E9LT86F, E9LT86G, E9LT86H	08/01/14- 07/29/15	The harness adjuster button (red) on affected models may remain down in the "release" position after the harness is tightened. This will enable the shoulder harnesses to loosen from a child's movements while secured in the seat. Contact mfg. for repair kit.
32)	Chaperone	E9L69N9, E9L69P2, E9L69P3, E9L69P5	04/01/09- 05/31/10	The chest clip may break when it is engaged as the infant is secured into the infant car seat creating a safety hazard. Contact mfg. for repair kit.
33)	Chaperone	E9L692J, E9L692K, E9L692L, E9L692M	09/01/10- 04/30/11	Voluntary Recall - The harness adjuster may detach from the shell due to an improperly installed rivet. Contact mfg. for repair kit.

Recent additions to the list are denoted by >>

List No.	Manufacturer Model Name	Model No. (X = more numbers or letters follow)	Customer Assistance	
			Mfg Date	Problem Type and Consumer Action
Britax (continued)				
34)	Companion	E9L14, E9L20, E9L80	All	Consumer Advisory - NOT A RECALL: Britax advises that the user should adjust the carrier handle so that it is completely down and behind the carrier after installation in the vehicle with or without the base assembly. Contact mfg. for additional info.
35)	Frontier	E9L54E7, E9L54H6, E9L54H7, E9L54M6	04/01/08-09/14/08	Harness straps may become detached from the metal yoke on the back of the seat if they are loosened one strap at a time with excessive force. Contact mfg. for repair kit.
36)	Frontier	E9L5490	04/01/08-09/17/08	Harness straps may become detached from the metal yoke on the back of the seat if they are loosened one strap at a time with excessive force. Contact mfg. for repair kit.
37)	Marathon ClickTight	E1A005R, E1A006B, E1A116L, E9LT71Q, E9LT75R, E9LT76B, E9LT76L, E9LT76N, E9LT76P, EXA116L	08/01/14-07/29/15	The harness adjuster button (red) on affected models may remain down in the "release" position after the harness is tightened. This will enable the shoulder harnesses to loosen from a child's movements while secured in the seat. Contact mfg. for repair kit.
38)	Pavilion 70-G3	E9LK31x, E9LK32x, E9LK33Q, E9LL11x, E9LL12x	06/01/12-08/31/12	Children who bite or chew on the shoulder strap HUGS pads could bite off small pieces, presenting a choking hazard. Contact mfg. for replacement HUGS pads and instructions.
39)	Century Products	REFER TO OLDER MODELS LIST - ALL MODELS ARE OLDER THAN 10 YEARS - REPLACEMENT PROGRAM DISCONTINUED - DESTROY & REPLACE		
Chicco				
			800-807-8817 / 877-424-4226 - www.chiccousa.com	
40)	Key Fit Key Fit 30 Cortina Travel Systems BASES ONLY	All	02/26/08-03/17/08	Recall applies only to <u>bases</u> manufactured between 2/26/2008 and 3/17/2008. When installed with LATCH, the webbing used to tighten the base can slip through the adjustment lock. Bases with serial number is between 08 02 26 (February 26, 2008) and 08 03 17 (March 17, 2008) are covered by this recall. Contact mfg. for replacement base. Install the base with the vehicle seat belts until replacement base is obtained.
41)	Chrysler	REFER TO OLDER MODELS LIST - ALL MODELS ARE OLDER THAN 10 YEARS - REPLACEMENT PROGRAM DISCONTINUED - DESTROY & REPLACE		
42)	Collier-Keyworth	REFER TO OLDER MODELS LIST - ALL MODELS ARE OLDER THAN 10 YEARS - REPLACEMENT PROGRAM DISCONTINUED - DESTROY & REPLACE		
Combi USA				
			800-992-6624 / 803-548-6633 - www.combi-intl.com	
43)	Centre ST Centre DX Centre EX Centre ARB	8065 8074 8086 8520	10/19/05-12/15/07	The car seat could potentially become separated from its base in a crash. Mfg. recommends that the car seat be used without the base until it has been fixed. Contact mfg for free retrofit kit. Also affected are travel systems (# 4400, 4515, and 4520) that contain the Centre and Shuttle car seats.
44)	Coccoro	8220	01/06/09 - 12/05/12	Harness webbing fails to meet FMVSS 213 minimum breaking strength requirements. Contact mfg. for free harness replacement kit and instructions. The seats can continue to be used until the kits are made available and repairs are made.
45)	Coccoro	8220x	01/01/09-06/29/16	Too much force can be placed on the child when the car seat is installed forward-facing with only the vehicle's lap belt. All other installation methods are not affected. Contact mfg. for a cover to add to the bottom of the seat.
46)	Shuttle	8087	10/19/05-12/15/07	The car seat could potentially become separated from its base in a crash. Mfg. recommends that the car seat be used without the base until it has been fixed. Contact mfg for free retrofit kit. Also affected are travel systems (# 4400, 4515, and 4520) that contain the Centre and Shuttle car seats.

Recent additions to the list are denoted by >>

<i>List No.</i>	<i>Manufacturer Model Name</i>	<i>Model No. (X = more numbers or letters follow)</i>	<i>Customer Assistance</i>
			<i>Mfg Date Problem Type and Consumer Action</i>

Combi USA (continued)

- | | | | |
|-----|-----------|------|--|
| 47) | Zeus 360 | 8836 | 02/25/09 - Harness webbing fails to meet FMVSS 213 minimum breaking strength requirements. Contact mfg. for free harness replacement kit and instructions. The seats can continue to be used until the kits are made available and repairs are made.
05/24/12 |
| 48) | Zeus Turn | 8815 | 07/15/07 - Harness webbing fails to meet FMVSS 213 minimum breaking strength requirements. Contact mfg. for free harness replacement kit and instructions. The seats can continue to be used until the kits are made available and repairs are made.
03/25/09 |

49) **Compass Baby**

REFER TO OLDER MODELS LIST - ALL MODELS ARE OLDER THAN 10 YEARS - REPLACEMENT PROGRAM DISCONTINUED - DESTROY & REPLACE

Cosco (Dorel)

*Dorel Juvenile Group: 866-623-3139 / 800-219-0509 / 866-611-3022 / 812-372-0141
www.djgusa.com*

- | | | | |
|-----|---------------------|--|---|
| 50) | Alpha Omega All-N-1 | 22150x | 05/01/08-04/30/09 - Harness locking and release button does not always return to its locked position and could result in a loose harness, increasing the risk of being injured a crash. Contact mfg. for repair kit. |
| 51) | Alpha Omega Elite | 22154x, 22155x, 22158x | 05/01/08-04/30/09 - Harness locking and release button does not always return to its locked position and could result in a loose harness, increasing the risk of being injured a crash. Contact mfg. for repair kit. |
| 52) | Comfy Carry | IC123 FSM | 05/01/11-04/25/12 - Some models were sold without a base and therefore did not provide lower LATCH attachments as required by FMVSS 213. Carriers can safely be installed without the base using the seat belt. Contact mfg. to obtain a base. |
| 53) | Infant Car Seat | 22-300 CSF, 22-300 FZN, 22-300 JJV, 22-300 OSF, 22-300 THD, 22-300 TWD | 01/06/08-04/06/09 - The child restraint carry handle can loosen and come off posing a fall hazard to infants. The safety as a child restraint is not affected. Do not use handle until repaired. Contact mfg. for free repair kit. NOTE: Only those models sold as a part of the Spirit and Sprint Travel Systems are affected. |
| 54) | Regal Ride | 22139MON | 09/28/04-09/20/07 - Elastic straps on padding can come loose and become accessible to the child allowing the child to loop the elastic strap around portions of his/her body. Contact mfg. for repair kit. |
| 55) | Touriva | 22100x, 22111x, 22130x, 93100x, 93111x | 09/28/04-09/20/07 - Elastic straps on padding can come loose and become accessible to the child allowing the child to loop the elastic strap around portions of his/her body. Contact mfg. for repair kit. |

Cyber

Distributed by Regal Lager: 800-593-5522 - www.regallager.com

- | | | | |
|-----|----------------|----------------------|--|
| 56) | Solution X-fix | 0500200xx, 0500760xx | 02/01/10-02/28/10 - Booster seats have an incorrect warning statement about restraining unoccupied seats. Contact mfg. for replacement sticker and owner's manual. |
|-----|----------------|----------------------|--|

Disney (Dorel)

*Dorel Juvenile Group: 866-623-3139 / 800-219-0509 / 866-611-3022 / 812-372-0141
www.djgusa.com*

- | | | | |
|-----|-----------------|--|--|
| 57) | Infant Car Seat | 22-305 NAB, 22-305 PPH, 22-355 LBF, 22-355 PWK, 22-627 AWF | 01/06/08-04/06/09 - The child restraint carry handle can loosen and come off posing a fall hazard to infants. The safety as a child restraint is not affected. Do not use handle until repaired. Contact mfg. for free repair kit. NOTE: Only those models sold as a part of the Propack Travel System are affected. |
|-----|-----------------|--|--|

58) **Downunder**

REFER TO OLDER MODELS LIST - ALL MODELS ARE OLDER THAN 10 YEARS - REPLACEMENT PROGRAM DISCONTINUED - DESTROY & REPLACE

Recent additions to the list are denoted by >>

List No.	Manufacturer Model Name	Model No. (X = more numbers or letters follow)	Customer Assistance	
			Mfg Date	Problem Type and Consumer Action
Eddie Bauer (Dorel)			Dorel Juvenile Group: 866-623-3139 / 800-219-0509 / 866-611-3022 / 812-372-0141 www.djgusa.com	
59)	Deluxe 3-in-1	22755x, 22758x, 22759x, 22790x, 22799x	05/01/08-04/30/09	Harness locking and release button does not always return to its locked position and could result in a loose harness, increasing the risk of being injured a crash. Contact mfg. for repair kit.
60)	Deluxe 3-in-1	22790xxx, CC046xxx	07/20/10-05/18/11	The rear-facing belt path installation arrows are incorrect, possibly appearing to point toward the forward-facing vehicle belt path location. Contact mfg. for replacement label kit.
61)	Enspira	22740x, 22741x	05/01/08-04/30/09	Harness locking and release button does not always return to its locked position and could result in a loose harness, increasing the risk of being injured a crash. Contact mfg. for repair kit.
62)	Infant Car Seat	22-627 CGT, 22-627 FRK, 22-627 KGS, 22-627 SNW, 22-627 WPR, 22-655 BYTE	01/06/08-04/06/09	The child restraint carry handle can loosen and come off posing a fall hazard to infants. The safety as a child restraint is not affected. Do not use handle until repaired. Contact mfg. for free repair kit. NOTE: Only those models sold as a part of the Adventurer and Endeavor Travel Systems are affected.
63)	Prospect Adjustable Hiback Booster	22880x	05/01/08-04/30/09	Harness locking and release button does not always return to its locked position and could result in a loose harness, increasing the risk of being injured a crash. Contact mfg. for repair kit.
64)	SureFit	22657x, IC072x	05/01/08-04/30/09	Harness locking and release button does not always return to its locked position and could result in a loose harness, increasing the risk of being injured a crash. Contact mfg. for repair kit.
Evenflo			800-525-2472 / 800-233-5921 / 800-490-7497 - www.evenflo.com	
65)	Big Kid Booster	30911173AD, 3091967AD, 30911118AD, 30911120D	ALL	The affected seats - originally intended for display models - were packaged without the instruction manual or the required registration card. Otherwise, including crashworthiness, they were fully compliant with FMVSS 213. However, some seats were inadvertently shipped to institutional customers to be given to families. None of the affected units were sold at retail stores. Affected seats end with the letter "D" and have a label stating: "DISPLAY ONLY – NOT INTENDED FOR SALE," located on the back of the booster seat headrest. Contact mfg. for remedy kit.
66)	Chase Factory Select Chase LX Chase Select	306xxx	06/12/12-10/03/13	The harness buckle may become resistant to unlatching over time so that it cannot be opened by pushing the release button, thus making it difficult to remove the child from the restraint in an emergency. NOTE: Date ranges for specific model numbers of affected models may differ from date range listed here. Contact mfg. for specific dates and replacement buckle if needed.
67)	Chase DLX Chase LX	329xxx	08/23/11-03/03/14	The harness buckle may become resistant to unlatching over time so that it cannot be opened by pushing the release button, thus making it difficult to remove the child from the restraint in an emergency. NOTE: Date ranges for specific model numbers of affected models may differ from date range listed here. Contact mfg. for specific dates and replacement buckle if needed.
68)	Discovery	390, 391, 534, 552	Pre-02/01/08	Voluntary Safety Recall - Testing showed that the car seat could potentially become separated from its base in high impact side collisions. Contact mfg. for free supplemental dual-hook fastener for enhanced safety performance.
69)	Discovery	3021769Z, 3021854Z	02/04/08	A small number of Discovery car seats may have shipped without complete assembly of the red release handle located on the back of the seat making it possible for the seat to separate from its base. Contact mfg. for replacement seat and base. Affected models can be used without the base while waiting for replacement.

Recent additions to the list are denoted by >>

List No.	Manufacturer Model Name	Model No. (X = more numbers or letters follow)	Customer Assistance	
			Mfg Date	Problem Type and Consumer Action
<i>Evenflo (continued)</i>				
70)	Embrace 35	3151198, 3151953, 31511xxx, 31521138, 46811xxx, 48111xxx, 48411xxx, 52911307A, 55311xxx, 52921040	12/01/11-05/31/13*	The harness buckle may become resistant to unlatching over time so that it cannot be opened by pushing the release button, thus making it difficult to remove the child from the restraint in an emergency. *NOTE: Not all Embrace 35 models in the 12/01/11-05/31/13 date range are impacted. Contact mfg. for specific dates and replacement buckle if needed.
71)	Evolve 3-in-1	34411700, 34411741	02/26/15-02/09/16	The central front harness adjuster button may be within the child's reach which could allow the child to loosen the harness and be at an increased risk of injury in the event of a crash. Contact mfg. for a free repair kit.
72)	Express Factory Select	329xxx	08/23/11-03/03/14	The harness buckle may become resistant to unlatching over time so that it cannot be opened by pushing the release button, thus making it difficult to remove the child from the restraint in an emergency. NOTE: Date ranges for specific model numbers of affected models may differ from date range listed here. Contact mfg. for specific dates and replacement buckle if needed.
73)	First Choice	3604098	01/16/09-09/29/09	A label containing certain contact and certification information was inadvertently left off these car seats. Contact mfg. for a set of replacement labels.
74)	Maestro	3101198, 3101980, 31011048, 31011049, 31011059, 31011057C*	11/24/09-04/09/10*	A crack may form at the front of the seat adjacent to the harness adjuster in a crash. Evenflo recommends that the seat not be used with children < 40 pounds until repaired. Use as a booster for children > 40 pounds is OK. Call mfg. for free reinforcement kit. *Canadian seat 31011057C mfg dates: 12/17/09-04/26/10
75)	Maestro Maestro Factory Select	310xxx	08/22/11-10/17/13	The harness buckle may become resistant to unlatching over time so that it cannot be opened by pushing the release button, thus making it difficult to remove the child from the restraint in an emergency. NOTE: Date ranges for specific model numbers of affected models may differ from date range listed here. Contact mfg. for specific dates and replacement buckle if needed.
76)	Momentum 65 Momentum 65 DLX	385xxx	03/04/13-08/26/13	The harness buckle may become resistant to unlatching over time so that it cannot be opened by pushing the release button, thus making it difficult to remove the child from the restraint in an emergency. NOTE: Date ranges for specific model numbers of affected models may differ from date range listed here. Contact mfg. for specific dates and replacement buckle if needed.
77)	Secure Kid 100 Secure Kid 300 Secure Kid 400 Secure Kid LX Secure Kid LX Factory Select	308xxx	12/13/11-03/03/14	The harness buckle may become resistant to unlatching over time so that it cannot be opened by pushing the release button, thus making it difficult to remove the child from the restraint in an emergency. NOTE: Date ranges for specific model numbers of affected models may differ from date range listed here. Contact mfg. for specific dates and replacement buckle if needed.
78)	Snugli All-in-One	346xxx	10/02/12-08/26/13	The harness buckle may become resistant to unlatching over time so that it cannot be opened by pushing the release button, thus making it difficult to remove the child from the restraint in an emergency. NOTE: Date ranges for specific model numbers of affected models may differ from date range listed here. Contact mfg. for specific dates and replacement buckle if needed.
79)	Snugli Booster	308xxx	12/13/11-03/03/14	The harness buckle may become resistant to unlatching over time so that it cannot be opened by pushing the release button, thus making it difficult to remove the child from the restraint in an emergency. NOTE: Date ranges for specific model numbers of affected models may differ from date range listed here. Contact mfg. for specific dates and replacement buckle if needed.
80)	Snugli Embrace 35	30711365	06/01/12-11/30/12	The harness buckle may become resistant to unlatching over time so that it cannot be opened by pushing the release button, thus making it difficult to remove the child from the restraint in an emergency. Contact mfg. for a free repair kit.
81)	SureRide DLX	371xxx	06/20/12-10/17/13	The harness buckle may become resistant to unlatching over time so that it cannot be opened by pushing the release button, thus making it difficult to remove the child from the restraint in an emergency. NOTE: Date ranges for specific model numbers of affected models may differ from date range listed here. Contact mfg. for specific dates and replacement buckle if needed.

Recent additions to the list are denoted by >>

List No.	Manufacturer	Model No. (X = more numbers or letters follow)	Customer Assistance	
	Model Name		Mfg Date	Problem Type and Consumer Action

Evenflo (continued)

82)	Symphony 65 DLX Symphony DLX Symphony LX	345xxx	10/02/12-08/26/13	The harness buckle may become resistant to unlatching over time so that it cannot be opened by pushing the release button, thus making it difficult to remove the child from the restraint in an emergency. NOTE: Date ranges for specific model numbers of affected models may differ from date range listed here. Contact mfg. for specific dates and replacement buckle if needed.
83)	Symphony Symphony 65 E3	346xxx	10/02/12-08/26/13	The harness buckle may become resistant to unlatching over time so that it cannot be opened by pushing the release button, thus making it difficult to remove the child from the restraint in an emergency. NOTE: Date ranges for specific model numbers of affected models may differ from date range listed here. Contact mfg. for specific dates and replacement buckle if needed.
84)	Titan 65 Titan 65 Factory Select	371xxx	06/20/12-10/17/13	The harness buckle may become resistant to unlatching over time so that it cannot be opened by pushing the release button, thus making it difficult to remove the child from the restraint in an emergency. NOTE: Date ranges for specific model numbers of affected models may differ from date range listed here. Contact mfg. for specific dates and replacement buckle if needed.
85)	Transitions 3-in-1	34411029, 34411686, 34411695	12/18/14-01/29/16	The central front harness adjuster button may be within the child's reach which could allow the child to loosen the harness and be at an increased risk of injury in the event of a crash. Contact mfg. for a free repair kit.

86) **Fisher Price** *REFER TO OLDER MODELS LIST - ALL MODELS WITH RECALLS ARE OLDER THAN 10 YEARS*

87) **Ford** *REFER TO OLDER MODELS LIST - ALL MODELS ARE OLDER THAN 10 YEARS - REPLACEMENT PROGRAM DISCONTINUED - DESTROY & REPLACE*

88) **General Motors** *REFER TO OLDER MODELS LIST - ALL MODELS ARE OLDER THAN 10 YEARS - REPLACEMENT PROGRAM DISCONTINUED - DESTROY & REPLACE*

89) **Gerry** *REFER TO OLDER MODELS LIST - ALL MODELS WITH RECALLS ARE OLDER THAN 10 YEARS*

Graco**800-345-4109 - www.gracobaby.com**

90)	Aprica A30	All Models	07/01/11-04/30/12	The harness buckle may become stuck so that it cannot be opened by pushing the release button, thus making it difficult to remove the child from the restraint in an emergency. Contact mfg. for replacement buckle.
91)	Argos 70 / Argos 70 Elite	All Models	05/01/11-07/31/13	The harness buckle may become stuck so that it cannot be opened by pushing the release button, thus making it difficult to remove the child from the restraint in an emergency. Contact mfg. for replacement buckle.
92)	CarGo	8487x, 8686x, 8689x, 8D01x, 8D02x, 8D03x, 8D04x, 8D05x, 8D10x	01/09/07-03/03/08	An incorrect NHTSA Hotline telephone number appears on an information label affixed to the back of the seat. Contact mfg. for a replacement label.
93)	Classic Ride	1812930	03/01/14-02/28/15	The labels of affected models did not include information about the location and use of the instruction manual as required by FMVSS 213. Recall does not affect the safety performance of the seat. Contact mfg. for replacement labels.
94)	Classic Ride 50	All Models	10/01/11-09/30/13	The harness buckle may become stuck so that it cannot be opened by pushing the release button, thus making it difficult to remove the child from the restraint in an emergency. Contact mfg. for replacement buckle.

Recent additions to the list are denoted by >>

List No.	Manufacturer Model Name	Model No. (X = more numbers or letters follow)	Customer Assistance	
			Mfg Date	Problem Type and Consumer Action
<i>Graco (continued)</i>				
95)	ComfortSport	8C02MRC2	10/22/07	Seats were produced with foam thicker than specified and tested 1" thick foam. It is unclear as to what impact thicker foam will have on child seat safety. Call mfg. for seat replacement information.
96)	ComfortSport	8C04FRR, 8C04FRR2	11/01/06-10/08/07	Seats were equipped with a large supplemental "body pillow" that partially obscures the child airbag warning label on the seat pad. Graco will instruct users to discard the supplemental pillows since they are provided for comfort only. Contact mfg. for additional information.
97)	ComfortSport	All Models	10/01/10-09/30/13	The harness buckle may become stuck so that it cannot be opened by pushing the release button, thus making it difficult to remove the child from the restraint in an emergency. Contact mfg. for replacement buckle.
98)	ComfortSport	1794333, 1813040	03/01/14-02/28/15	The labels of affected models did not include information about the location and use of the instruction manual as required by FMVSS 213. Recall does not affect the safety performance of the seat. Contact mfg. for replacement labels.
99)	Cozy Cline	All Models	01/01/06-04/30/10	The harness buckle may become stuck so that it cannot be opened by pushing the release button, thus making it difficult to remove the child from the restraint in an emergency. Contact mfg. for replacement buckle.
100)	Extend2Fit	1954477	11/27/15-01/20/16	The recline labels on affected models do not meet FMVSS 213. Labels on the side of affected car seats, including the recline label, may not be in the same language (i.e. all English on one side of the car seat and all Spanish on the other side). Recall does not affect the safety performance of the seat. Contact mfg for replacement labels.
101)	Head Wise 70 with Safety Surround	All Models	01/01/12-07/31/13 & 08/03/13	The harness buckle may become stuck so that it cannot be opened by pushing the release button, thus making it difficult to remove the child from the restraint in an emergency. Contact mfg. for replacement buckle.
102)	Milestone	1910130, 1923980, 1926538, 1926539	07/09/15-10/09/15	The labels on affected seats do not include specific phrasing about how to install the car seat, as required by FMVSS 213. Recall does not affect the safety performance of the seat. Contact mfg. for free replacement labels.
103)	My Ride 65 / My Ride 65 with Safety Surround	All Models	04/01/09-07/31/13 & 09/30/13	The harness buckle may become stuck so that it cannot be opened by pushing the release button, thus making it difficult to remove the child from the restraint in an emergency. Contact mfg. for replacement buckle.
104)	My Ride 65	1794334, 1813015, 1813074, 1853478, 1871689, 1872691, 1877535, 1908152	05/16/14 - 08/01/14	The harness webbing used on certain My Ride 65 convertible car seats do not meet FMVSS 213 requirements for breaking strength. Harnesses with the webbing tag code "2014/06" are the only models affected by this recall. Contact mfg. for replacement harness. Consumers may continue to use the My Ride 65 convertible car seats while waiting for a replacement kit.
105)	My Ride 70	All Models	05/01/12-07/31/13	The harness buckle may become stuck so that it cannot be opened by pushing the release button, thus making it difficult to remove the child from the restraint in an emergency. Contact mfg. for replacement buckle.
106)	My Size 70	All Models	01/01/12-07/31/13 & 08/03/13	The harness buckle may become stuck so that it cannot be opened by pushing the release button, thus making it difficult to remove the child from the restraint in an emergency. Contact mfg. for replacement buckle.
107)	Nautilus 3-in-1 / Nautilus Elite / Nautilus Plus	All Models	10/01/07-07/31/13 & 08/19/13	The harness buckle may become stuck so that it cannot be opened by pushing the release button, thus making it difficult to remove the child from the restraint in an emergency. Contact mfg. for replacement buckle.

Recent additions to the list are denoted by >>

List No.	Manufacturer Model Name	Model No. (X = more numbers or letters follow)	Customer Assistance	
			Mfg Date	Problem Type and Consumer Action

Graco (continued)

108)	Ready Ride	All Models	10/01/10-09/30/13	The harness buckle may become stuck so that it cannot be opened by pushing the release button, thus making it difficult to remove the child from the restraint in an emergency. Contact mfg. for replacement buckle.
109)	Ready Ride	1924519, 1924520	03/01/14-02/28/15	The labels of affected models did not include information about the location and use of the instruction manual as required by FMVSS 213. Recall does not affect the safety performance of the seat. Contact mfg. for replacement labels.
110)	SafeSeat - Step 2	All Models	01/01/06-04/30/10	The harness buckle may become stuck so that it cannot be opened by pushing the release button, thus making it difficult to remove the child from the restraint in an emergency. Contact mfg. for replacement buckle.
111)	Size4Me70	All Models	01/01/12-07/31/13 & 08/03/13	The harness buckle may become stuck so that it cannot be opened by pushing the release button, thus making it difficult to remove the child from the restraint in an emergency. Contact mfg. for replacement buckle.
112)	Smart Seat / Smart Seat with Safety Surround	All Models	12/01/10-09/30/13 & 10/09/13; 12/25/13; 1/10/14	The harness buckle may become stuck so that it cannot be opened by pushing the release button, thus making it difficult to remove the child from the restraint in an emergency. Contact mfg. for replacement buckle.
113)	SnugRide, SnugRide Classic Connect	All Models	03/01/11-05/31/13	The harness buckle may become stuck so that it cannot be opened by pushing the release button, thus making it difficult to remove the child from the restraint in an emergency. Contact mfg. for replacement buckle.
114)	SnugRide 30 SnugRide Classic Connect 30	All Models	07/01/10-01/31/13	The harness buckle may become stuck so that it cannot be opened by pushing the release button, thus making it difficult to remove the child from the restraint in an emergency. Contact mfg. for replacement buckle.
115)	SnugRide 35 SnugRide Classic Connect 35	All Models	05/01/11-01/31/13	The harness buckle may become stuck so that it cannot be opened by pushing the release button, thus making it difficult to remove the child from the restraint in an emergency. Contact mfg. for replacement buckle.
116)	SnugRide Click Connect 40	All Models	06/01/12-12/31/12	The harness buckle may become stuck so that it cannot be opened by pushing the release button, thus making it difficult to remove the child from the restraint in an emergency. Contact mfg. for replacement buckle.
117)	TurboBooster	1963973, 1963974, 1963975, 1963976, 1967886, 1975173	12/22/15-04/05/16	Instructions are missing the information required by FMVSS 213 that the seats should be securely belted to the vehicle at all times, even if the seat is unoccupied. Recall does not affect the safety performance of the seat. Contact mfg. to obtain missing instructions.

118) **International**

REFER TO OLDER MODELS LIST - ALL MODELS ARE OLDER THAN 10 YEARS - REPLACEMENT PROGRAM DISCONTINUED - DESTROY & REPLACE

Kiddy USA

855-925-4339 / info@kiddyusa.com / www.kiddyusa.com

119)	World Plus	51 100 WP	02/01/12-10/05/13	Recall affects all World Plus seats ever made. The buckle/tongue on the impact shield of affected seats may only partially engage, appearing to be fully latched when it is not. Kiddy will reimburse owners the full purchase price of the car seat. Contact mfg. (855-925-4339) for more information.
------	------------	-----------	-------------------	---

120) **Kolcraft**

REFER TO OLDER MODELS LIST - ALL MODELS ARE OLDER THAN 10 YEARS - REPLACEMENT PROGRAM DISCONTINUED - DESTROY & REPLACE

Recent additions to the list are denoted by >>

<i>List No.</i>	<i>Manufacturer Model Name</i>	<i>Model No. (X = more numbers or letters follow)</i>	<i>Customer Assistance Mfg Date</i>	<i>Problem Type and Consumer Action</i>
-----------------	--------------------------------	---	-------------------------------------	---

121) *Lin Lih/MCP Ent.*

REFER TO OLDER MODELS LIST - ALL MODELS ARE OLDER THAN 10 YEARS - REPLACEMENT PROGRAM DISCONTINUED - DESTROY & REPLACE

Maxi-Cosi (Dorel)

*Dorel Juvenile Group: 866-623-3139 / 800-219-0509 / 866-611-3022 / 812-372-0141
www.djgusa.com*

122)	Mico Mico (base)	22-371, 22-372 22-515	07/01/07- 02/17/08	Attachment difficulties between the infant carrier and the base may lead to the carrier being improperly mounted to the base. Contact mfg. for replacement base.
123)	Mico Mico (base)	22-371 HFL, 22-371 JUC, 22-371 LMD, 22-371 ORE, 22-371 PNG, 22-372 TTH 22-515 BLK	02/18/08- 06/28/08	Attachment difficulties between the infant carrier and the base may lead to the carrier being improperly mounted to the base. Contact mfg. for repair kit. NOTE: This is an extension of an earlier recall.
124)	Mico	22371x, 22372x	05/01/08- 04/30/09	Harness locking and release button does not always return to its locked position and could result in a loose harness, increasing the risk of being injured a crash. Contact mfg. for repair kit.
125)	Priori	22476x, 22486x	05/01/08- 04/30/09	Harness locking and release button does not always return to its locked position and could result in a loose harness, increasing the risk of being injured a crash. Contact mfg. for repair kit.

126) *Mercedes-Benz USA*

REFER TO OLDER MODELS LIST - ALL MODELS WITH RECALLS ARE OLDER THAN 10 YEARS

Mia Moda

866-642-6632 - www.miamodainc.com

127)	Viva Viva Supreme	5000 (seat), 5001 (base), 5050 (seat), 5051 (base), 5070 (seat), 5071 (base), 5080 (seat), 5081 (base)	12/01/06- 05/31/09	Sharp edges on the harness splitter plate can cut the harness. Also, the base could crack in a crash. Contact mfg. at 877-546-8437 for a full refund. <u>Mia Moda is urging parents/caregivers to discontinue use of the seat until it can be replaced.</u> According to Lerado/Mia Moda, there have been no injuries reported due to these problems and this is a voluntary precaution they are taking.
------	----------------------	---	-----------------------	--

Orbit Baby

877-672-2229 / 510-793-5007 - www.orbitbaby.com

128)	Car Seat Base G2	ORB822000	03/20/13- 07/20/13	Voluntary recall of the Orbit Baby Car Seat Base G2 with listed manufacturer dates AND with a Batch Number of A0840, A0860, or A0880. The knob on the base used to tighten the base into the vehicle may detach or spin without tightening the base. <u>The Infant Car Seat G2 is not affected by this recall and can continue to be used without the base.</u> Contact mfg. for a free repair kit.
------	---------------------	-----------	-----------------------	---

Peg Perego USA

877-737-3468 / 219-482-8191 - www.perego.com

129)	Jacadi	IMCB00JA57RJ31JU31	07/01/07- 03/14/08	The plastic adjustment cover of affected models could have exposed sharp edges that could cause cuts, scratches, or abrasions on the feet or legs of bare-footed infants. Does not affect safety as car seat. Contact mfg. for a free repair kit.
130)	Primo Viaggio SIP 30/30	32MD41KN41, 35CR13BU13, 35CR13PL46, 35CR24BU24, 35TL49KN53, 35TL53KN46, 61FG13ST53, 61FG53ST49, 61FG53ST64, 61ST13IC53, 61ST34IC53, 61ST48IC53	07/01/07- 03/14/08	The plastic adjustment cover of affected models could have exposed sharp edges that could cause cuts, scratches, or abrasions on the feet or legs of bare-footed infants. Does not affect safety as car seat. Contact mfg. For a free repair kit. Note: Affected model numbers begin with IMUN00US.

131) *Playskool*

REFER TO OLDER MODELS LIST - ALL MODELS ARE OLDER THAN 10 YEARS - REPLACEMENT PROGRAM DISCONTINUED - DESTROY & REPLACE

132) *Pride Trimble/Virco*

REFER TO OLDER MODELS LIST - ALL MODELS ARE OLDER THAN 10 YEARS - REPLACEMENT PROGRAM DISCONTINUED - DESTROY & REPLACE

Recent additions to the list are denoted by >>

<i>List No.</i>	<i>Manufacturer Model Name</i>	<i>Model No. (X = more numbers or letters follow)</i>	<i>Customer Assistance Mfg Date</i>	<i>Problem Type and Consumer Action</i>
133)	Questor			REFER TO OLDER MODELS LIST - ALL MODELS ARE OLDER THAN 10 YEARS - REPLACEMENT PROGRAM DISCONTINUED - DESTROY & REPLACE
	Recaro			888-973-2276 / 800-873-2276 / 248-364-3818/ - www.recaropromotion.com
134)	Como	331.00.xxx	Pre-09/17/07	Consumer Advisory - Not a Recall: Lap and shoulder belt guide (previously referred to as "lock-off") may not hold belt webbing snugly enough to prevent belt from loosening. Contact mfg. for locking clip and instructions included as a part of the consumer advisory.
135)	Como	331.00.xxx	Pre-12/18/07	The harness may become disconnected from the harness connector when a child is placed in or removed from the child seat. Contact mfg. for repair kit.
136)	Como	331.00.xxx, 331.01.xxx	11/01/07-02/16/09	The front harness adjuster strap may slip within the adjuster/lock that controls tightness of the harness and may prevent the harness from staying properly tight. Contact mfg. for free replacement seat. NOTE: Models with a green dot above the bar code on the model # sticker are OK to use.
137)	Performance RIDE	333.01.xxx	01/15/13 - 06/09/15	The top tether anchorage on the seat may detach from the plastic shell in a crash. Contact mfg. for repair kit.
138)	ProRIDE	332.01.xxx	04/09/10 - 06/09/15	The top tether anchorage on the seat may detach from the plastic shell in a crash. Contact mfg. for repair kit.
139)	ProSport	385.01.xxxx	06/16/10-01/31/13	When the affected child seats are installed with the LATCH lower anchors only (without the top tether), the child's head can move too much, increasing the risk of injury in a crash. Contact mfg. for replacement labels and complete set of new instructions informing owners to discontinue use of the LATCH system when the weight of the child reaches 40 pounds.
140)	Signo	331.00.xxx	Pre-12/18/07	The harness may become disconnected from the harness connector when a child is placed in or removed from the child seat. Contact mfg. for repair kit.
141)	Signo	330.00.xxx, 330.01.xxx	11/01/07-02/16/09	The front harness adjuster strap may slip within the adjuster/lock that controls tightness of the harness and may prevent the harness from staying properly tight. Contact mfg. for free replacement seat. NOTES: This date range is an expansion of the initial date range (02/01/08-09/30/08) for this recall. Models with a green dot above the bar code on the model # sticker are OK to use.
142)	Renolux (FBS)			REFER TO OLDER MODELS LIST - ALL MODELS ARE OLDER THAN 10 YEARS - REPLACEMENT PROGRAM DISCONTINUED - DESTROY & REPLACE
143)	Safeline Kids (See Triple Play Products also)			REFER TO OLDER MODELS LIST - ALL MODELS WITH RECALLS ARE OLDER THAN 10 YEARS
	Safety 1st (Dorel)			Dorel Juvenile Group: 866-623-3139 / 800-219-0509 / 866-611-3022 / 812-372-0141 - www.djgusa.com
144)	Alpha Omega All-N-1 Alpha Omega Elite	22152x, 22159x, 22172x, 22177x, 22178x, 22185x, 22188x, 22195x, 22412x, 22456x, 22465x, 22469x	05/01/08-04/30/09	Harness locking and release button does not always return to its locked position and could result in a loose harness, increasing the risk of being injured a crash. Contact mfg. for repair kit.
145)	Alpha Omega Elite	22187xxx, 22465xxx, CC033xxx, CC046xxx	07/20/10-05/18/11	The rear-facing belt path installation arrows are incorrect, possibly appearing to point toward the forward-facing vehicle belt path location. Contact mfg. for replacement label kit.
146)	Avenue	22439x, 22449x	05/01/08-04/30/09	Harness locking and release button does not always return to its locked position and could result in a loose harness, increasing the risk of being injured a crash. Contact mfg. for repair kit.

Recent additions to the list are denoted by >>

List No.	Manufacturer	Model No. (X = more numbers or letters follow)	Customer Assistance	
	Model Name		Mfg Date	Problem Type and Consumer Action

Safety 1st (Dorel) (continued)

147)	Complete Air LX Complete Air SE	CC050xxx CC051xxx	07/20/10-05/18/11	The rear-facing belt path installation arrows are incorrect, possibly appearing to point toward the forward-facing vehicle belt path location. Contact mfg. for replacement label kit.
148)	Enspira	22453x	05/01/08-04/30/09	Harness locking and release button does not always return to its locked position and could result in a loose harness, increasing the risk of being injured a crash. Contact mfg. for repair kit.
149)	Infant Car Seat	22-057 CLN, 22-057 DBY, 22-057 HRT, 22-057 LPH, 22-085 DWA, 22-085 LYN, 22-095 RBK, 22-322 HRR, 22-322 KDL, 22-322 LXI, 22-322 MAI, 22-322 OLY, 22-322 PRS, 22-322 PTK, 22-325 COB, 22-325 PAC, 22-380 LGA, 22-380 MSA, 22-627 WAV	01/06/08-04/06/09	The child restraint carry handle can loosen and come off posing a fall hazard to infants. The safety as a child restraint is not affected. Do not use handle until repaired. Contact mfg. for free repair kit. NOTE: Only those models sold as a part of the Eurostar, Explorer, Lite Wave, Sojourn, and Vector Travel Systems are affected.
150)	OnBoard	22077x, 22078x, 22356x	05/01/08-04/30/09	Harness locking and release button does not always return to its locked position and could result in a loose harness, increasing the risk of being injured a crash. Contact mfg. for repair kit.
151)	OnBoard 35	IC124 FSM	05/01/11-04/25/12	Some models were sold without a base and therefore did not provide lower LATCH attachments as required by FMVSS 213. Carriers can safely be installed without the base using the seat belt. Contact mfg. to obtain a base.
152)	Prospect	22580x	05/01/08-04/30/09	Harness locking and release button does not always return to its locked position and could result in a loose harness, increasing the risk of being injured a crash. Contact mfg. for repair kit.
153)	Uptown	22475x	05/01/08-04/30/09	Harness locking and release button does not always return to its locked position and could result in a loose harness, increasing the risk of being injured a crash. Contact mfg. for repair kit.
154)	Vantage Vantage Point/ Surveyor Vantage Hiback	22553x, 22554x, 22560x, 22561x, 22564x, 22567x, 22574x	05/01/08-04/30/09	Harness locking and release button does not always return to its locked position and could result in a loose harness, increasing the risk of being injured a crash. Contact mfg. for repair kit.

Snugli*See Evenflo*155) **Strolee****REFER TO OLDER MODELS LIST - ALL MODELS ARE OLDER THAN 10 YEARS - REPLACEMENT PROGRAM DISCONTINUED - DESTROY & REPLACE****Team-Tex America****877-912-1313**

156)	Babyride	374199	12/18/08	The belt routing label with the "horizontal reference line" for determining the correct recline angle is incorrectly placed on the child restraint. Contact mfg. for replacement label and instructions.
------	----------	--------	----------	--

Recent additions to the list are denoted by >>

<i>List No.</i>	<i>Manufacturer Model Name</i>	<i>Model No. (X = more numbers or letters follow)</i>	<i>Customer Assistance</i>
			<i>Mfg Date Problem Type and Consumer Action</i>
	<i>TriplePlay Products (See Safeline Kids also)</i>		<i>800-829-1625 - www.tripleplayproducts.com</i>
157)	Sit'n'Stroll	4002	05/05/08 The webbing used in the center adjuster for the harness fails to comply with the initial breaking strength requirements of FMVSS 213. Contact mfg. for repair kit and instructions. NOTE: According to TriplePlay, the only units affected were a small number of seats manufactured on May 5, 2008 and sold through their website. All purchasers are being contacted and notified of this recall.
158)	<i>TRW</i>		<i>REFER TO OLDER MODELS LIST - ALL MODELS ARE OLDER THAN 10 YEARS - REPLACEMENT PROGRAM DISCONTINUED - DESTROY & REPLACE</i>
159)	<i>XSCi</i>		<i>REFER TO OLDER MODELS LIST - ALL MODELS ARE OLDER THAN 10 YEARS - REPLACEMENT PROGRAM DISCONTINUED - DESTROY & REPLACE</i>

Recent additions to the list are denoted by >>

Integrated (built-into the vehicle) seats

	<i>Manufacturer</i>	<i>Model Year</i>	<i>Customer Assistance</i>
Chrysler			800-853-1403 / 800-992-1997
160)	Town and Country	1996	Bolts securing seat to frame can break. Contact Chrysler Corp. or dealer for repair
161)	Town and Country	1988	Harness restraint webbing incorrectly routed around the metal reinforcement bar on these seats. Child may not be properly restrained in the event of a crash. Dealers will inspect and correct improperly routed webbing.
162)	Town and Country	1996, 1997	Safety improvement campaign: The latch plate can remain in the locked position due to food or other items. Owners are being provided with decals/instructions describing the operation of the buckle and the latch plate
163)	Town and Country	1996, 1997	The harness on the integrated child seat can become difficult to release when the safety belt latch plate gets dirty. Dealers will clean the latch, modify the emergency release anchor, and provide additional instructions.
Dodge			800-853-1403 / 800-992-1997
164)	Caravan Grand Caravan	1996	Bolts securing seat to frame can break. Contact Chrysler Corp. or dealer for repair
165)	Caravan Grand Caravan	1988	Harness restraint webbing incorrectly routed around the metal reinforcement bar on these seats. Child may not be properly restrained in the event of a crash. Dealers will inspect and correct improperly routed webbing.
166)	Caravan Grand Caravan	1996, 1997	Safety improvement campaign: The latch plate can remain in the locked position due to food or other items. Owners are being provided with decals/instructions describing the operation of the buckle and the latch plate
167)	Caravan Grand Caravan	1996, 1997	The harness on the integrated child seat can become difficult to release when the safety belt latch plate gets dirty. Dealers will clean the latch, modify the emergency release anchor, and provide additional instructions.
Ford			800-392-3673
168)	Windstar	1998	The headrest lockout mechanism on the integrated child seats may not engage and lock the headrest in the "down" position, as intended. Replace bench seats with integrated child seats with seats built with revised headrest lockout mechanisms.
Plymouth			800-853-1403 / 800-992-1997
169)	Voyager Grand Voyager	1996	Bolts securing seat to frame can break. Contact Chrysler Corp. or dealer for repair
170)	Voyager Grand Voyager	1988	Harness restraint webbing incorrectly routed around the metal reinforcement bar on these seats. Child may not be properly restrained in the event of a crash. Dealers will inspect and correct improperly routed webbing.
171)	Voyager Grand Voyager	1996, 1997	Safety improvement campaign: The latch plate can remain in the locked position due to food or other items. Owners are being provided with decals/instructions describing the operation of the buckle and the latch plate
172)	Voyager Grand Voyager	1996, 1997	The harness on the integrated child seat can become difficult to release when the safety belt latch plate gets dirty. Dealers will clean the latch, modify the emergency release anchor, and provide additional instructions.

This page intentionally left blank for 2-sided printing

Car seats manufactured before 1981 were not required to be crash tested and must not be used. Most manufacturers stamp their car seats with an expiration date, typically six to eight years from the date of manufacture, on a label or in the shell of the seat. Many child passenger safety advocates recommend that if no expiration date can be found, car seats older than ten years should be replaced by a new one. Older models are included as a part of this recall list because care givers will sometimes choose to use older car seats even though it goes against the recommendations of most organizations and advocates. Knowing that a particular model is under recall, and if the defect cannot be corrected, should help to encourage the care giver to destroy the older seat and obtain a new one.

Following are recalls and safety notifications that were issued for models where all or most models sold are at least 10 years old as of May 26, 2017. The listing of older models with recalls will only be updated as "newer" models get to be old enough to be moved to the "older" models list.

Programs that make multiple copies of the HSRC recall list, e. g., for use at clinics or permanent checking/fitting stations, should only have to make copies of this older model section when it is revised, regardless of how often the main (newer model) section is revised. Most clinics or permanent checking/fitting stations should only need to print/copy one or two older model lists for reference. Updated versions of this list, as well as the list of models less than 10 years old, are posted on-line at www.buckleupnc.org/car-seat-recall-list.

CAR SEATS 10 YEARS OLD AND OLDER

Download this list & sign up for email notification of updates: buckleupnc.org/car-seat-recall-list

**Index of Recalls and Safety Notifications
For the model numbers "x" = more numbers or letters follow.**

Model numbers and model names for car seats under recall are followed by their index number which corresponds to the "List No." for each listing. If the model number is not found, check the model name also. Model numbers are not available for all model names.

Note: Dorel Juvenile Group products are indexed under each individual product line (e.g., Cosco) as well as under "Dorel."

Alcot (Childcare)	Basic Comfort	# E9L20	217
Child Love Seat	# 960	# E9L30	220, 221, 222
	# 961	# E9L32	229
All Our Kids	Galaxy 2000	# E9L3998	225
# 600		# E9L39x	224
# 602	Beatrix Potter (Dorel)	# E9L47	218
Little Cargo Vest	# 02-620-xxx	# E9L57	215
	# 02-621-SAL	# E9L80	217
Alpha Elite (Dorel)	Designer 22	# E9W06	223
# 22331 BLA		Advantage	214
# 22332 RLA	Bolform Corp.	Boulevard	215
Comfort Infant Seat	# 84E-019	Companion	216, 217
	Buckle-Up Harness	Decathlon	218
American Motors	Britax	Freeway	219
Child Love Seat	# 101	Husky	220, 221
Infant Love Seat	# 161	Marathon	222, 223
	# E902228	Regent	224, 225
Babyhood Industries	# E9031	Roundabout	226
# 810	# E906	Super Elite	227, 228
# 8200	# E9L06	Traveller Plus	229
Baby-Sitter	# E9L07	Wizard	230
Wonda Chair	# E9L14		216, 217

Car Seat Recalls and Safety Notifications: MODELS 10 YEARS OLD AND OLDER

For the model numbers "x" = more numbers or letters follow

Index number refers to "List No." for each listing

Century	# 4480	254, 257	Breverra Contour	263
# 11-564	# 4490	254, 257	Breverra Premiere	264
# 11-565	# 4500	269	Child Love Seat	265
# 11-570	# 4510	269	Encore	266
# 11-575	# 45100	260	Infant Car Seat	267, 268
# 11-576	# 4513	268	Infant Love seat	269
# 11-578	# 4515	268	Smart Fit	270
# 11-595	# 4516	268	Smart Move	271, 272
# 11-597	# 4518	268	Chrysler	
# 11-598	# 4520	269	Child Love Seat	273
# 11-599	# 45200	260	Collier-Keyworth	
# 11-600	# 4525	270	Co-Pilot	274
# 11-650	# 4535	267	Commuter	276
# 12-565	# 4551	268	Safe and Sound II	275
# 4100	# 4557	268	Combi	
# 4153	# 4558	268	# 8100	277
# 4163	# 4559	268	Avatar	277
# 4180	# 4560	267	Compass Baby	
# 4200	# 45600	260	# 1420 ARD	278
# 4210	# 4564	268	# 1420 FUO	278
# 4214	# 4565	267, 268	# 1420 MAR	278
# 4223	# 4566	268	Infant Car Seat	278
# 4235	# 4568	268	Cosco	
# 4253	# 4569	268	# 02-014-EMF	302
# 4261	# 45700	260	# 02-014-GDM	302
# 4263	# 4575	261, 268	# 02-015-PDL	302
# 4265	# 4576	268	# 02-084	301, 304
# 4266	# 4580	259	# 02-086	285
# 4300	# 4581	258, 259	# 02-090	298
# 4302	# 4583	258, 259	# 02-094	304
# 4303	# 4585	258, 259	# 02-096	304
# 4310	# 4589	268	# 02-190	300
# 4323	# 4590	267	# 02-290	299
# 4334	# 4591	268	# 02-331	279
# 4335	# 4593	268	# 02-332	279
# 4353	# 4594	268	# 02-404	304
# 4365	# 4595	268	# 02-514-BWE	303
# 4365DT	# 4597	268	# 02-518-NDF	303
# 4366	# 4600	265	# 02-531	279
# 4367	# 4662	266	# 02-533	279
# 4368	# 4750	271	# 02-537	279
# 4369	# 4875	263	# 02-584-OXF	303
# 4380	# 4885	264	# 02-665	284
# 4381	100	231, 232	# 02-667	308
# 4400	1000 STE	233	# 02-719 ARQ	287
# 4434	200	234, 235, 236, 237	# 02-727	284
# 4436	2000 STE	238, 239, 240	# 02-728	284
# 4446	300	241	# 02-729	284
# 4450	3000 STE	242, 243, 244, 245, 246	# 02-729 TED	283
# 4460	3500 STE	247	# 02-731	284
# 44612	4-in-1	248, 249	# 02-732	284
# 44622	400XL	250, 251	# 02-733	284
# 44630	5000 STE	252, 253, 254, 255, 256	# 02-750	284
# 44631	5500 STE	257	# 02-751	282, 284
# 44662	580	258, 259		
# 4470	Accel	260		
# 44709	Affinity	261		
# 4475	Bravo	262		
# 4476				

Car Seat Recalls and Safety Notifications: MODELS 10 YEARS OLD AND OLDER

For the model numbers "x" = more numbers or letters follow

Index number refers to "List No." for each listing

Cosco (continued)	# 22150	281	# 02-555 (Cosco)	279
# 02-753	# 22155	281	# 02-555 (Eddie Bauer)	311
# 02-755	# 22180	281	# 02-584-OXF (Cosco)	303
# 02-756	# 22269	281	# 02-620-xxx (Beatrix Potter)	212
# 02-757	# 313	295	# 02-620-xxx (Safety 1st)	454
# 02-758	# 323	296	# 02-621-SAL (Beatrix Potter)	212
# 02-759	# 423	296	# 02-621-SAL (Safety 1st)	454
# 02-760	# 81A	293	# 02-665 (Cosco)	284
# 02-761	# 81B	293	# 02-667 (Cosco)	308
# 02-762	# 93084	305	# 02-719 ARQ (Cosco)	287
# 02-763	# 93094	305	# 02-727 (Cosco)	284
# 02-764	# 93443	290	# 02-728 (Cosco)	284
# 02-765	# 93446	306	# 02-729 (Cosco)	284
# 02-770	# 93504	306	# 02-729 TED (Cosco)	283
# 02-771	# 93514	290, 305	# 02-731 (Cosco)	284
# 02-772	Alpha Omega	279, 280, 281	# 02-732 (Cosco)	284
# 02-774	Alpha Omega Elite	281	# 02-733 (Cosco)	284
# 02-790	Arriva	282, 283, 284	# 02-750 (Cosco)	284
# 02-821	Commuter	285	# 02-751 (Cosco)	282, 284
# 02-890	Designer 22	286	# 02-753 (Cosco)	308
# 02014	Dream Ride	287	# 02-755 (Cosco)	284
# 02015	DreamRide	288	# 02-756 (Cosco)	284, 308
# 02019	Hi Back Booster	289	# 02-757 (Cosco)	284
# 02084	High Rise Booster	291	# 02-758 (Cosco)	308
# 02094	Lxry Sft Shld Auto Trac	292	# 02-759 (Cosco)	308
# 02114	Safe and Easy	295	# 02-760 (Cosco)	308
# 02332	Safe and Snug	296	# 02-761 (Cosco)	308
# 02409	Safe-T Mate	294	# 02-762 (Cosco)	308
# 02442	Safe-T-Shield	293	# 02-763 (Cosco)	308
# 02443	Sft Shld Auto Trac	299	# 02-764 (Cosco)	308
# 02445	Soft Shield	298	# 02-765 (Cosco)	308
# 02448	Soft Shield Deluxe	300	# 02-770 (Cosco)	308
# 02449	Touriva	301, 302, 303, 304, 305, 306	# 02-771 (Cosco)	308
# 02450	Turnabout	308	# 02-772 (Cosco)	308
# 02480	Voyager Inf/Stroller	309	# 02-774 (Cosco)	284
# 02495			# 02-790 (Cosco)	292
# 02504			# 02-821 (Cosco)	304
# 02514	Dorel		# 02-890 (Cosco)	292
# 02518	# 02-014-EMF (Cosco)	302	# 02014 (Cosco)	305
# 02519	# 02-014-GDM (Cosco)	302	# 02015 (Cosco)	305
# 02524	# 02-015-PDL (Cosco)	302	# 02019 (Cosco)	305
# 02531	# 02-084 (Cosco)	301, 304	# 02084 (Cosco)	305
# 02533	# 02-086 (Cosco)	285	# 02094 (Cosco)	305
# 02537	# 02-090 (Cosco)	298, 299	# 02114 (Cosco)	305
# 02555	# 02-094 (Cosco)	304	# 02332 (Cosco)	280
# 02584	# 02-096 (Cosco)	304	# 02409 (Cosco)	289
# 02803	# 02-190 (Cosco)	300	# 02409 (Eddie Bauer)	318
# 02806	# 02-331 (Cosco)	279	# 02442 (Cosco)	289, 290
# 02821	# 02-331 (Eddie Bauer)	311	# 02442 (Eddie Bauer)	318
# 02825	# 02-332 (Cosco)	279	# 02443 (Cosco)	289, 290
# 02935	# 02-332 (Eddie Bauer)	311	# 02443 (Eddie Bauer)	318
# 181A	# 02-404 (Cosco)	304	# 02445 (Cosco)	289
# 181B	# 02-514-BWE (Cosco)	303	# 02445 (Eddie Bauer)	318
# 22-001FSM	# 02-518-NDF (Cosco)	303	# 02448 (Cosco)	289, 290
# 22-297	# 02-531 (Cosco)	279	# 02448 (Eddie Bauer)	318
# 22-298	# 02-531 (Eddie Bauer)	311	# 02449 (Cosco)	289
# 22-299	# 02-533 (Cosco)	279	# 02449 (Eddie Bauer)	318
# 22-300-JOS GB1B	# 02-533 (Eddie Bauer)	311	# 02450 (Cosco)	289
# 22100	# 02-537 (Cosco)	279		
	# 02-537 (Eddie Bauer)	311		

Car Seat Recalls and Safety Notifications: MODELS 10 YEARS OLD AND OLDER

For the model numbers "x" = more numbers or letters follow

Index number refers to "List No." for each listing

Dorel (continued)	# 22770 (Eddie Bauer) 312, 313	Downunder	Kangaroo Booster 310
# 02450 (Eddie Bauer) 318	# 229x (Cosco) 307	Eddie Bauer	# 02-331 311
# 02480 (Cosco) 289	# 244x (Cosco) 297	# 02-332 311	# 02-531 311
# 02480 (Eddie Bauer) 318	# 313 (Cosco) 295	# 02-533 311	# 02-537 311
# 02495 (Cosco) 289	# 323 (Cosco) 296	# 02-555 311	# 02409 318
# 02495 (Eddie Bauer) 318	# 423 (Cosco) 296	# 02442 318	# 02443 318
# 02504 (Cosco) 305	# 81A (Cosco) 293	# 02445 318	# 02448 318
# 02514 (Cosco) 305, 306	# 81B (Cosco) 293	# 02448 318	# 02449 318
# 02518 (Cosco) 305	# 93084 (Cosco) 305	# 02450 318	# 02480 318
# 02519 (Cosco) 305, 306	# 93094 (Cosco) 305	# 02495 318	# 02870 319
# 02524 (Cosco) 305, 306	# 93443 (Cosco) 290	# 02871 319	# 02875 319
# 02531 (Cosco) 280	# 93446 (Cosco) 306	# 22-625 xxx GB1B 316	# 22630xxx 314, 315
# 02533 (Cosco) 280	# 93504 (Cosco) 306	# 22631xxx 314, 315	# 22740 312, 317
# 02537 (Cosco) 280	# 93514 (Cosco) 290, 305	# 22750 312, 313	# 22755 312, 313
# 02555 (Cosco) 280	3-in-1 (Eddie Bauer) 311, 312	# 22756 312, 313	# 22757 312, 313
# 02584 (Cosco) 305	Alpha Elite (Safety 1st) 451	# 22770 312, 313	3-in-1 311, 312
# 02803 (Cosco) 305	Alpha Omega (Cosco) 279, 280, 281	Alpha Omega 313	Alpha Omega 313
# 02806 (Cosco) 305	Alpha Omega (Eddie Bauer) 313	Alpha Omega Elite 313	Comfort Infant Seat 314, 315
# 02821 (Cosco) 305	Alpha Omega (Safety 1st) 452	Deluxe 3-in-1 312	Deluxe Convertible 312
# 02825 (Cosco) 305	Alpha Omega Elite (Cosco) 281	Designer 22 316	Designer 22 316
# 02870 (Eddie Bauer) 319	Alpha Omega Elite (Eddie Bauer) 313	Designer 22 (Beatrix Potter) 212	Enspira 317
# 02871 (Eddie Bauer) 319	Alpha Omega Elite (Safety 1st) 452	Designer 22 (Cosco) 286	Hi Back Booster 318
# 02875 (Eddie Bauer) 319	Alpha Sport (Safety 1st) 453	Designer 22 (Eddie Bauer) 316	Hi Back Booster (Eddie Bauer) 318
# 02935 (Cosco) 305	Arriva (Cosco) 282, 283, 284	Designer 22 (Safety 1st) 454, 455	High Rise Booster (Cosco) 291
# 181A (Cosco) 293	Comfort Infant Seat (Alpha Elite) 204, 205	Dream Ride (Cosco) 287	Intera (Safety 1st) 457
# 181B (Cosco) 293	Comfort Infant Seat (Eddie Bauer) 314, 315	DreamRide (Cosco) 288	Lxry Sft Shld Auto Trac (Cosco) 292
# 219x (Cosco) 307	Commuter (Cosco) 285	Enspira (Eddie Bauer) 317	Safe and Easy (Cosco) 295
# 22-001FSM (Cosco) 288	Deluxe 3-in-1 (Eddie Bauer) 312	Enspira (Safety 1st) 456	Safe and Snug (Cosco) 296
# 22-297 (Cosco) 291	Deluxe Convertible (Eddie Bauer) 312	Hi Back Booster (Cosco) 289	Safe-T-Mate (Cosco) 294
# 22-298 (Cosco) 291	Designer 22 (Cosco) 286	Hi Back Booster (Eddie Bauer) 318	Safe-T-Shield (Cosco) 293
# 22-299 (Cosco) 291	Designer 22 (Eddie Bauer) 316	High Rise Booster (Cosco) 291	Sft Shld Auto Trac (Cosco) 299
# 22-300-JOS GB1B (Cosco) 286	Designer 22 (Safety 1st) 454, 455	Intera (Safety 1st) 457	Sidekick Booster (Cosco) 297
# 22-325 xxx GB1B (Safety 1st) 455	Dream Ride (Cosco) 287	Lxry Sft Shld Auto Trac (Cosco) 292	Soft Shield (Cosco) 298
# 22-625 xxx GB1B (Eddie Bauer) 316	DreamRide (Cosco) 288	Safe and Easy (Cosco) 295	Soft Shield Deluxe (Cosco) 300
# 22100 (Cosco) 306	Enspira (Eddie Bauer) 317	Safe and Snug (Cosco) 296	Touriva (Cosco) 301, 305, 306
# 22150 (Cosco) 281	Enspira (Safety 1st) 456	Safe-T-Mate (Cosco) 294	Touriva (Eddie Bauer) 319
# 22151 (Safety 1st) 452	Hi Back Booster (Cosco) 289	Safe-T-Shield (Cosco) 293	Touriva 5-point (Cosco) 303
# 22155 (Cosco) 281	Hi Back Booster (Eddie Bauer) 318	Sft Shld Auto Trac (Cosco) 299	Touriva Shield (Cosco) 302
# 22180 (Cosco) 281	High Rise Booster (Cosco) 291	Sidekick Booster (Cosco) 297	Touriva T-Shield (Cosco) 304
# 22269 (Cosco) 281	Intera (Safety 1st) 457	Soft Shield (Cosco) 298	Trooper (Cosco) 307
# 22331 BLA (Alpha Elite) 204, 205	Lxry Sft Shld Auto Trac (Cosco) 292	Soft Shield Deluxe (Cosco) 300	Turnabout (Cosco) 308
# 22332 RLA (Alpha Elite) 204, 205	Safe and Easy (Cosco) 295	Touriva (Cosco) 301, 305, 306	Voyager Inf/Stroller (Cosco) 309
# 22450 (Safety 1st) 456	Safe and Snug (Cosco) 296	Touriva (Eddie Bauer) 319	
# 22451 (Safety 1st) 456	Safe-T-Mate (Cosco) 294	Touriva 5-point (Cosco) 303	
# 22452 (Safety 1st) 456	Safe-T-Shield (Cosco) 293	Touriva Shield (Cosco) 302	
# 22453 (Safety 1st) 456	Sft Shld Auto Trac (Cosco) 299	Touriva T-Shield (Cosco) 304	
# 22455 (Safety 1st) 452	Sidekick Booster (Cosco) 297	Trooper (Cosco) 307	
# 22460 (Safety 1st) 457	Soft Shield (Cosco) 298	Turnabout (Cosco) 308	
# 22480 (Safety 1st) 456	Soft Shield Deluxe (Cosco) 300	Voyager Inf/Stroller (Cosco) 309	
# 22481 (Safety 1st) 456	Touriva (Cosco) 301, 305, 306		
# 224x (Cosco) 307	Touriva (Eddie Bauer) 319		
# 225x (Cosco) 307	Touriva 5-point (Cosco) 303		
# 22630xxx (Eddie Bauer) 314, 315	Touriva Shield (Cosco) 302		
# 22631xxx (Eddie Bauer) 314, 315	Touriva T-Shield (Cosco) 304		
# 22740 (Eddie Bauer) 312, 317	Trooper (Cosco) 307		
# 22750 (Eddie Bauer) 312, 313	Turnabout (Cosco) 308		
# 22755 (Eddie Bauer) 312, 313	Voyager Inf/Stroller (Cosco) 309		
# 22756 (Eddie Bauer) 312, 313			
# 22757 (Eddie Bauer) 312, 313			
		Evenflo	# 200x 337
		# 201 333	# 202 330, 333
		# 203x 334	# 205x 334, 345, 346
		# 206 335	# 207x 336
		# 207x 336	# 210x 334, 346
		# 211x 337	# 211x 337
		# 219164 350	# 219164 350
		# 219180 350	# 219180 350
		# 219186 350	# 219186 350
		# 219188 350	# 219188 350
		# 21940 350	# 21940 350
		# 219x 307, 327, 342	# 219x 307, 327, 342
		# 221 339	# 221 339

Car Seat Recalls and Safety Notifications: MODELS 10 YEARS OLD AND OLDER

For the model numbers "x" = more numbers or letters follow

Index number refers to "List No." for each listing

Evenflo (continued)			Ford
# 222	340	# 477x	328
# 223	340	# 478x	328
# 224x	307, 325, 326, 327, 342	# 480x	328
# 225x	307, 327, 342	# 481x	328
# 227	354	# 492x	336
# 228	344	# 493x	334
# 229x	307, 327, 341, 342	# 499x	337
# 231	353	# 540xx	331
# 232	355	# 548xx	331
# 242	324	# 549xx	331
# 244x	297	# 550xx	331
# 264x	348, 349	# 556xx	331
# 272x	328	# 597xx	331
# 273x	328	# 598xx	331
# 317xx	331	# 599xx	331
# 320xx	331	# 636x	351
# 359x	349	# 637x	351
# 378x	347	# 639001	338
# 379x	347	# 639002	338
# 389x	349	410	320
# 397xx	331	Bobby Mac Champion	321
# 398xx	331	Bobby Mac Deluxe	322
# 401	339	Booster Seat	323, 324
# 402	339	Champion	325, 326, 327
# 403	339	Cozy Carry	328
# 404	339	Dyn-O-Mite	329, 330
# 405	339	Embrace	331
# 406	339	Infant Car Seat	332, 333
# 407	339	Joyride	334
# 408	339	On My Way	335, 336, 337
# 409	339	On My Way base	338
# 410	320	One-Step	339
# 411	321	One-Step Deluxe	340
# 412	322	Scout	341, 342
# 414	322	Seven Year Seat	343, 344
# 415	322	Sidekick	297
# 416	322	Travel Tandem	345, 346
# 4176	340	Tribute	347
# 420	352	Triumph	348, 349
# 435x	334	Trooper	307, 350
# 441	329, 330, 333	Two-in-One	351
# 442	329, 330, 333	Ultara 1	352, 353
# 443	329, 330, 333	Ultara II	354, 355
# 444	329, 330, 333	Fisher Price	
# 445	329, 330, 333	# 79700	370
# 446	329, 330, 333	# 9100	356, 357, 358, 359, 360, 361, 362, 363, 364
# 447	329, 330	# 9101	357, 358, 360, 361, 362, 363, 364
# 447x	337	# 9104	365, 368, 369
# 448	329, 330, 333	# 9149	366
# 453	343, 344	# 9173	367
# 454	343, 344	Booster	368, 369
# 456	332, 333	Car Seat	356, 357, 358, 359, 360, 361, 362, 363, 364
# 458	332, 333	Delux Car Seat	365
# 468x	328	Infant Seat	366, 367
# 469x	328	Safe Embrace	370
# 470	323, 324		
# 471	323, 324		
# 476x	328		
			General Motors
			Child Love Seat
			373
			Infant Love Seat
			372
			Gerry
			# 626
			375
			Guardian
			374
			Secure Ride
			375
			Graco
			# 7493
			378
			# 7497
			378
			# 7499
			378
			# 8402
			379
			# 8402L
			379
			# 8403x
			379
			# 841101
			378
			# 841102
			378
			# 841103
			378
			# 8412
			379
			# 841203
			378
			# 8412T02
			378
			# 8433x
			376
			# 8442x
			379
			# 8443
			379
			# 8443L
			379
			# 8444
			379
			# 8444L
			379
			# 8446
			379
			# 8446L
			379
			# 8447
			379
			# 8447L
			379
			# 8448
			379
			# 8448L
			379
			# 8457
			378, 379
			# 8458
			378, 379
			# 8459
			378, 379
			# 8460
			378
			# 8462
			378
			# 8463x
			379
			# 8464
			379
			# 8470
			379
			# 8471
			378, 379
			# 8472
			378
			# 8473
			378
			# 8474
			378
			# 8476
			378
			# 8477
			378
			# 8478
			378, 379
			# 8601
			379
			# 8602x
			379
			# 8603M
			379
			# 8605x
			379
			# 8607x
			379
			# 8608D
			379
			# 8609x
			380

Car Seat Recalls and Safety Notifications: MODELS 10 YEARS OLD AND OLDER

For the model numbers "x" = more numbers or letters follow

Index number refers to "List No." for each listing

Graco (continued)	Flip 'N' Go	391	# 180-400	424
# 8616x	Flip 'N' Go II	392	# 77001	425
# 8629x	Infant Car Seat	387	# 77002	425
# 8630x	Infant Restraint	388	# 77005	426
# 8631x	Infant Rider	389, 390	# 77007	426
# 8632x	Perfect Fitt	393, 394, 395	Car Seat	424, 425
# 8635x	Performa	396, 397	Infant Car Seat	426
# 8639x	Playskool	398, 399	Pride Trimble/Virco	
# 8643x	Playskool Infant	400	# 832	429
# 8645x	Plus 4	401, 402	# 890	427, 428
# 8646x	Plus 5	403, 404, 405	# 891	427, 428
# 8C00x	Rock 'N' Ride	406, 407	# 892	427, 428
# 8C01x	Secura	408	Click-n-Go	427, 428
# 8C02x	Secure Fit	409	Pride Ride	429
# 8C03x	Travel About	410, 411	Questor	
# 8C04x	Travel-About	412	Kantwet Car Seat	430
# C844342	Traveler 700	413, 414, 415	Renolux (FBS)	
ComfortSport	Lin Lih/MCP		GT 1000	431
GT 1000	# 180-200	417	GT 2000	432, 433, 434
SnugRide	# 180-300	417	GT 4000	435, 436
	Lin Lih	416, 417	GT 5000	437, 438
International	Mercedes-Benz		GT 5000 Turn A Tot	439, 440, 441
Astroseat	# B66868203	421	GT 5500	442, 443
	# B66868204	421	GT 7000	444, 445, 446
Kolcraft	# B66868209	421	Safeline Kids	
# 131-101	# BQ6910155	420	# 3240	447
# 13123	# BQ6910157	419	Sit'n'Stroll	447
# 1312x	# BQ691063	419	Safeline Kids (see Triple Play also)	
# 1382x	Booster Seat	419	# 2003	450
# 13833	Infant Restraint	420	# 2240	449
# 1383x	Kiddy TopSafe	421	# 3240	448
# 13842	Mia Moda		Sit'n'Stroll	448, 449, 450
# 1384x	# 5000	418	Safety 1st (Dorel)	
# 13852	# 5001	418	# 02-620-xxx	454
# 1385x	Viva	418	# 02-621-SAL	454
# 138xx	Peg Perego		# 22-325xxxGB1B	455
# 140-155	# AL33USL	423	# 22151	452
# 150-100	# AL33USN	423	# 22450	456
# 180-100	# AL34USL	423	# 22451	456
# 180-150	# AL34USN	423	# 22452	456
# 180-200	# CS00MU1	422, 423	# 22453	456
# 180-300	# CS00US1	422, 423	# 22455	452
# 180-400	# CS00US8	422, 423	# 22460	456
# 180-600	# LN34S09	423	# 22481	456
# 180-601	# LN34S10	423	Alpha Elite	451
# 19127	# LV34USL	423	Alpha Omega	452
# 19128	# LV34USN	423	Alpha Omega Elite	452
# 19129	# ST33USL	423	Alpha Sport	453
# 19130	# ST33USN	423	Designer 22	454, 455
# 368xx	# ST38USL	423	Enspira	456
# 43xxx	# ST38USN	423	Intera	457
# 77001	Primo Viaggio	422, 423		
# 77002	Playskool			
# 77005	# 140-155	424		
# 77007				
Automate				
Carter Travel 5				
Dial-A-Fit				
Dial-A-Fit II				

Car Seat Recalls and Safety Notifications: MODELS 10 YEARS OLD AND OLDER

Snug Seat	
# 200-1000	458
# 600-1000	459
# E9L32	460
Gorilla	458
Spelcast	459
Traveller Plus	460

Strolee	
# 599	462
# 605	464
# 609	463
# 610	463
GT 3000	465
Quick Click	464
Wee Care	461, 462, 463

Team-Tex	
# 374099	466
Babyride	466

TRW	
Child Love Seat	468
Infant Love Seat	467

Volvo	
All	469

XSCi	
Pioneered ACIS	470

OLDER MODEL LIST

OLDER MODEL LIST

OLDER MODEL LIST

OLDER MODEL LIST

OLDER MODEL LIST

This page left blank for two-sided copying.

OLDER MODEL LIST

OLDER MODEL LIST

OLDER MODEL LIST

OLDER MODEL LIST

OLDER MODEL LIST

OLDER MODEL LIST

OLDER MODEL LIST

<i>List No.</i>	<i>Manufacturer Model Name</i>	<i>Model # ("X" = more numbers or letters follow)</i>	<i>Mfg Date</i>	<i>Customer assistance Problem Type and Consumer Action</i>
Alcot (Childcare)				
ALL MODELS OLDER THAN 10 YEARS - REPLACEMENT PROGRAM DISCONTINUED - DESTROY & REPLACE				
201)	Child Love Seat		3/84-11/84	Plastic shell may develop cracks. Destroy & replace seat.
All Our Kids				
ALL MODELS OLDER THAN 10 YEARS - REPLACEMENT PROGRAM DISCONTINUED - DESTROY & REPLACE				
202)	Little Cargo Vest	600	4/93-3/94	Flammability of upholstery. Call mfg. for repair info.
203)	Little Cargo Vest	602	3/94-9/94	Flammability of upholstery. Call mfg. for repair info.
Alpha Elite (Dorel)				
Dorel Juvenile Group: 866-623-3139 / 800-219-0509 / 866-611-3022 / 812-372-0141 www.djgusa.com				
204)	Comfort Infant Seat	22331 BLA, 22332 RLA	07/26/05-02/28/06	Trim screws on handle can loosen resulting in a potential choking hazard. Contact mfg. at 877-229-1374 for free repair kit. Make sure the handle trim screws are tight and continue to use the existing seat while waiting to receive and install the repair kit.
205)	Comfort Infant Seat	22331 BLA, 22332 RLA	07/26/05-02/28/06	Some consumers have experienced difficulty installing the base in certain vehicles. Dorel will replace the original version of the base at no charge to the customer. Contact mfg. at 877-229-1374 to determine eligibility for a replacement base.
American Motors				
ALL MODELS OLDER THAN 10 YEARS - REPLACEMENT PROGRAM DISCONTINUED - DESTROY & REPLACE				
206)	Infant Love Seat	All	1/81-12/82	Plastic shell may develop cracks. Destroy & replace seat.
207)	Child Love Seat	All	3/84-11/84	Plastic shell may develop cracks. Destroy & replace seat.
Babyhood Industries				
ALL MODELS OLDER THAN 10 YEARS - REPLACEMENT PROGRAM DISCONTINUED - DESTROY & REPLACE				
208)	Wonda Chair	810	Pre 12/82	Harness may be misrouted. Call mfg. for instructions.
209)	Baby-Sitter	8200	1/92-6/93	Buckle. Call mfg. for repair info.
Basic Comfort				
ALL MODELS OLDER THAN 10 YEARS - REPLACEMENT PROGRAM DISCONTINUED - DESTROY & REPLACE				
210)	Galaxy 2000	960, 961	ALL	Crash test failure. Call mfg. for repair info.
211)	Galaxy 2000	960, 961	11/98-1/99	Faulty molding of foam backs and cushions may allow separation of part of the booster seat. Call mfg. for repair info.
Beatrix Potter (Dorel)				
Dorel Juvenile Group: 800-219-0509 / 866-611-3022 / 812-372-0141 www.djgusa.com				
212)	Designer 22	02-621-SAL, 02-620-xxx	01/03/02-02/13/02	Plastic handle can unexpectedly release from the carrying position when used as a carrier. Does not affect safety as a child restraint. Contact mfg. for repair kit.

OLDER MODEL LIST

Car Seat Recalls and Safety Notifications: MODELS 10 YEARS OLD AND OLDER

<i>List No.</i>	<i>Manufacturer Model Name</i>	<i>Model # ("X" = more numbers or letters follow)</i>	<i>Mfg Date</i>	<i>Customer assistance Problem Type and Consumer Action</i>
Bolform Corp.				
ALL MODELS OLDER THAN 10 YEARS - NO LONGER IN BUSINESS - DESTROY & REPLACE				
213)	Buckle-Up Harness	84E-019	ALL	Crash test failure. Destroy & replace.
Britax				
888-427-4829 / 704-409-1700				
www.britaxusa.com				
214)	Advantage	E902228	03/05/01-07/26/01	One of the tether brackets of affected seats may separate from the tether attachment point. Contact mfg. for repair kit.
215)	Boulevard	E9L57	03/01/06-08/01/06	Top tether hook can open during a crash allowing the restraint to change from an upright to a reclined position. Owners are being advised to discontinue use of the top tether when the child reaches 50 lbs. Contact mfg. for replacement labels.
216)	Companion	E9L14	10/31/03-06/06/04	One or both of two tabs on the bottom of the carrier may not be properly seated and may allow the carrier to rotate in the base too far in a crash. Correct/incorrect assembly can be determined by visual examination. Call mfg. for replacement info. Affected units may be installed without the base until receiving a replacement.
217)	Companion	E9L14, E9L20, E9L80	Pre-11/01/07	User Guide Update - NOT A RECALL: Britax has updated instructions regarding adjustment of the buckle strap position and maximum height for infant carrier use. The inner buckle strap position should be used for infants weighing less than 11 pounds. A child has exceeded the height limit for the Companion when the top of the head is less than one inch from the top of the child restraint or the child's height exceeds 30 inches (76 cm). Contact mfg for updated user guide and labels
218)	Decathlon	E9L47	02/12/05-07/31/07	Under certain circumstances the harness adjuster housing may separate from the child restraint shell and allow the adjuster to move out of position. If this happens caregivers may experience difficulty adjusting the harness. Call mfg. for repair info.
219)	Freeway	101	6/96-4/97	Buckle. Call mfg. for repair info.
220)	Husky	E9L30	08/01/02-12/31/03	Head excursions higher than allowed by FMVSS 213 could result when installed as instructed with a long/serpentine belt path. Contact mfg. for replacement labels advising the use of an alternative short belt path.
221)	Husky	E9L30	Pre-07/24/04	The adjuster strap may slip within the metal buckle that controls the tightness of the shoulder harness and may allow the harness to loosen. Contact mfg. for repair kit.
222)	Marathon	E9L06	Pre-07/24/04	The adjuster strap may slip within the metal buckle that controls the tightness of the shoulder harness and may allow the harness to loosen. Contact mfg. for repair kit.
223)	Marathon	E9L06, E9W06, E906 with top tether lot # KGR 01 A	05/23/06- 07/28/06	The top tether hook may open and have the potential to release from the tether anchor if the child exceeds 50 pounds. Contact mfg. for repair kit.
224)	Regent	E9L39x	11/10/05-06/18/07	Consumer Advisory/Product Update - NOT A RECALL: Britax has modified the Regent and revised the installation instructions. Contact mfg. to receive a free product update kit that includes a revised user guide, replacement belt-routing label, a longer LATCH connector strap, and adhesive slip resistant strips.

Car Seat Recalls and Safety Notifications: MODELS 10 YEARS OLD AND OLDER

<i>List No.</i>	<i>Manufacturer Model Name</i>	<i>Model # ("X" = more numbers or letters follow)</i>	<i>Mfg Date</i>	<i>Customer assistance Problem Type and Consumer Action</i>
<i>Britax (continued)</i>				
225)	Regent Classic	E9L3998	12/18/06-01/18/07	Affected seats were produced with an incorrect airbag warning label attached to the cover. Contact mfg. to receive a free replacement cover.
226)	Roundabout	161	1/99-3/99	Possible faulty molding of shell can allow excessive head excursion. Call mfg. for repair info.
227)	Super Elite	E9031	04/25/01-02/15/02	Harness may allow too much forward head movement. Contact mfg. to receive a free replacement harness system.
228)	Super Elite	E9031	04/01/01-08/31/02	Harness adjuster tab may begin to stick after prolonged use. Harness may loosen if it sticks in the open position. Contact mfg. for repair kit and installation instructions.
229)	Traveller Plus	E9L32 (Mfg. by Britax for Snug Seat)	Pre-07/24/04	The adjuster strap may slip within the metal buckle that controls the tightness of the shoulder harness and may allow the harness to loosen. Contact mfg. for repair kit.
230)	Wizard	E9L07	Pre-07/24/04	The adjuster strap may slip within the metal buckle that controls the tightness of the shoulder harness and may allow the harness to loosen. Contact mfg. for repair kit.

<i>Century Products</i>		<i>800-837-4044 / 216-468-2000</i>		
231)	100	4100	1/81-4/81	Upholstery buttons. Call mfg. for repair info.
232)	100	4100	4/85-2/86	Plastic shell may crack in crash. Call mfg. for repair info.
233)	1000 STE	4153, 4163, 4180	12/90-10/91	Incorrect labels on seat. Call mfg. for corrections
234)	200	4200, 4210, 4235, 4214, 4223	1/81-4/81	Upholstery buttons. Call mfg. for repair info.
235)	200	4200, 4210, 4235, 4214, 4223	June 81	Washers on frame. Call mfg. for repair info.
236)	200	4200, 4210, 4235, 4214, 4223	1/81-1/83	Buckle. Call mfg. for repair info.
237)	200	4200, 4210, 4235, 4214, 4223	4/85-2/86	Plastic shell may crack in crash. Call mfg. for repair info.
238)	2000 STE	4253, 4263, 4265	4/84-6/89	Harness. Call mfg. for repair info.
239)	2000 STE	4253, 4261, 4263, 4265, 4266	12/90-10/91	Incorrect labels on seat. Call mfg. for corrections
240)	2000 STE	4253, 4261, 4263, 4265, 4266	12/91-4/92	Buckle. Call mfg. for repair info.
241)	300	4300, 4302, 4303, 4323, 4310, 4334, 4335	4/85-2/86	Plastic shell may crack in crash. Call mfg. for repair info.
242)	3000 STE	4365DT, 4366	3/89-10/89	Upholstery. Call mfg. for repair info.
243)	3000 STE	4353, 4365, 4366, 4368	5/90-6/90	Crash test failure of buckle. Call mfg. for repair info.
244)	3000 STE	4353, 4365, 4366, 4368	Pre 91	Buckle instructions. Call mfg. for corrections
245)	3000 STE	4365, 4366, 4367, 4368, 4369, 4380, 4381	12/90-10/91	Incorrect labels on seat. Call mfg. for corrections
246)	3000 STE	4353, 4365, 4366, 4367, 4368, 4369	10/89-4/92	Buckle. Call mfg. for repair info.

Car Seat Recalls and Safety Notifications: MODELS 10 YEARS OLD AND OLDER

<i>List No.</i>	<i>Manufacturer Model Name</i>	<i>Model # ("X" = more numbers or letters follow)</i>	<i>Mfg Date</i>	<i>Customer assistance Problem Type and Consumer Action</i>
<i>Century Products (continued)</i>				
247)	3500 STE	4380	12/90-4/92	Buckle. Call mfg. for repair info.
248)	4-In-1 Travel System	11-570, 11-597, 11-600, 11-650	9/95-5/96	Buckle. Call mfg. for repair info.
249)	4-In-1 Travel System	11-564, 11-565, 11-570, 11-575, 11-576, 11-578, 11-595, 11-597, 11-598, 11-599, 11-600	01/01/91-07/31/97	Handle can break when the seat is used as an infant carrier causing the infant to fall to the ground be injured. Does not affect safety as car seat. Call 800-865-1419 for replacement handle.
250)	400XL	4400, 4434, 4436, 4446	4/85-2/86	Plastic shell may crack in crash. Call mfg. for repair info.
251)	400XL	4400, 4434, 4436, 4446	11/84-4/86	Shield. Call mfg. for repair info.
252)	5000 STE	4450, 4460, 4475	12/88-11/89	Buckle. Call mfg. for repair info.
253)	5000 STE	4450, 4460, 4470, 4475	5/90-6/90	Crash test failure of buckle. Call mfg. for repair info.
254)	5000 STE	4460, 4470, 4475, 4476, 4480, 4490	12/90-10/91	Incorrect labels on seat. Call mfg. for corrections
255)	5000 STE	4450, 4460, 4470, 4475, 4476	09/89-4/92	Buckle. Call mfg. for repair info.
256)	5000 STE	4450, 4460, 4470, 4475,	Pre 91	Buckle instructions. Call mfg. for corrections.
257)	5500 STE	4480, 4490	01/91-4/92	Buckle. Call mfg. for repair info.
258)	580	4581, 4583, 4585	6/86-10/89	Screws for carry handle. Call mfg. for repair info.
259)	580	4580, 4581, 4583, 4585	7/86-12/89	Incorrect instructions. Call mfg. for corrections.
260)	Accel	45100, 45200, 45600, 45700	04/09/01- 05/10/01	Harness adjustment lock may allow webbing to slip during a serious crash when used in the forward facing mode for some models and lot codes. Call Century at 1-800-575-6097 for replacement info.
261)	Affinity Infant Seat	4575	9/95-5/96	Buckle. Call mfg. for repair info.
262)	Bravo	44622, 44630, 44631, 44662	04/09/01- 05/10/01	Harness adjustment lock may allow webbing to slip during a serious crash when used in the forward facing mode for some models and lot codes. Call Century at 1-800-575-6097 for replacement info.
263)	Brevera Contour	4875	2/95-7/98	Product improvement campaign: Buckle for the harness can crack or break. Call mfg. for replacement information.
264)	Brevera Premiere	4885	2/95-7/98	Product improvement campaign: Buckle for the harness can crack or break. Call mfg. for replacement information.
265)	Child Love Seat	4600	3/84-11/84	Plastic shell may develop cracks. Destroy & replace seat.
266)	Encore	44612, 4662	04/09/01-05/10/01	Harness adjustment lock may allow webbing to slip during a serious crash when used in the forward facing mode for some models and lot codes. Call Century at 1-800-575-6097 for replacement info.
267)	Infant Car Seat	4535, 4560, 4565, 4590	9/95-5/96	Buckle. Call mfg. for repair info.
268)	Infant Car Seat	12-565, 4513, 4515, 4516, 4518, 4551, 4557, 4558, 4559, 4564, 4565, 4566, 4568, 4569, 4575, 4576, 4589, 4591, 4593, 4594, 4595, 4597	01/01/91-07/31/97	Handle can break when the seat is used as an infant carrier causing the infant to fall to the ground be injured. Does not affect safety as car seat. Call 800-865-1419 for replacement handle.
269)	Infant Love seat	4500, 4510, 4520	1/81-12/82	Plastic shell may develop cracks. Destroy & replace seat.
270)	Smart Fit	4525	9/95-5/96	Buckle. Call mfg. for repair info.

Car Seat Recalls and Safety Notifications: MODELS 10 YEARS OLD AND OLDER

<i>List No.</i>	<i>Manufacturer Model Name</i>	<i>Model # ("X" = more numbers or letters follow)</i>	<i>Mfg Date</i>	<i>Customer assistance Problem Type and Consumer Action</i>
-----------------	--------------------------------	---	-----------------	---

Century Products (continued)

271)	Smart Move	4750	11/95-2/96	Buckle. Call mfg. for repair info.
272)	Smart Move	44709	04/09/01- 05/10/01	Harness adjustment lock may allow webbing to slip during a serious crash when used in the forward facing mode for some models and lot codes. Call Century at 1-800-575-6097 for replacement info.

Chrysler

ALL MODELS OLDER THAN 10 YEARS - REPLACEMENT PROGRAM DISCONTINUED - DESTROY & REPLACE

273)	Child Love Seat	All	3/84-11/84	Plastic shell may develop cracks. Destroy & replace seat.
------	-----------------	-----	------------	---

Collier-Keyworth

800-544-1108

274)	Co-Pilot	All	82-83	Shield. Call mfg. for repair info.
275)	Safe & Sound II	All	12/84-4/85	Buckle. Call mfg. for repair info.
276)	Commuter	All	10/87-02/88	Padding. Call mfg. for repair info.

Combi USA

800-992-6624 / 803-548-6633 - www.combi-intl.com

277)	Avatar	8100	11/12/03-05/07/04	Lower latch anchorage does not meet dynamic test requirements of FMVSS 213. Contact mfg. for free in-home repair kit and instructions. Affected models should be installed with the vehicle seat belt. Do not use the seat with the latch until repairs are made.
------	--------	------	-------------------	---

Compass Baby

888-899-2229 - www.compassbaby.com

278)	Infant Car Seat	1420 ARD 1420 FUO 1420 MAR	05/07/06, 05/13/06, and 05/15/06	The metal slide crotch anchor can become dislodged allowing excessive movement of the child and cracking of the plastic shell. This problem was discovered during testing by the manufacturer. There have been no reports of injuries and no calls from consumers regarding problems. Contact mfg. for free repair kit.
------	-----------------	----------------------------------	--	---

Cosco (Dorel)

Dorel Juvenile Group: 800-219-0509 / 866-611-3022 / 812-372-0141

279)	Alpha Omega	02-331, 02-332, 02-531, 02-533, 02-537, 02-555.	11/17/00- 01/10/01	Tether webbing could be cut and separate in a crash allowing excessive movement of the child. Contact mfg. for free repair kit.
280)	Alpha Omega	02332, 02531, 02533, 02537, 02555	01/01/00-09/30/01	Tether webbing does not conform to abrasion requirements of FMVSS 213. Contact mfg. for free repair kit.
281)	Alpha Omega Alpha Omega Elite	22150, 22180, 22269 22155	11/01/03-12/31/05	There is a potential for the harness adjustment strap to loosen during use. Contact mfg. for free repair kit.
282)	Arriva	02-751	03/95-05/95	Buckle. Call mfg. for repair info.
283)	Arriva	02-729 TED	03/31/99- 04/07/99	Airbag warning label is missing on seat pad. Fabric color noted by "TED" is only one affected. Call mfg. for replacement pad.
284)	Arriva	02-665, 02-727, 02-728, 02-729, 02-731, 02-732, 02-733, 02-750, 02-751, 02-755, 02-756, 02-757, 02-774	03/01/95-01/31/00	Handle locks can unexpectedly release when used as a carrier, causing the seat to flip forward. Does not affect safety as car seat. Call mfg. for repair info. [Note: a recall campaign initiated 06/25/03 added models made through 01/31/00 to a previous recall of those made through 09/97.]
285)	Commuter	02-086	11/87-2/88	Upholstery/padding. Call mfg. for repair info.

Car Seat Recalls and Safety Notifications: MODELS 10 YEARS OLD AND OLDER

<i>List No.</i>	<i>Manufacturer Model Name</i>	<i>Model # ("X" = more numbers or letters follow)</i>	<i>Customer assistance Mfg Date</i>	<i>Problem Type and Consumer Action</i>
<i>Cosco (Dorel) (continued)</i>				
286)	Designer 22	22-300-JOS GB1B	08/19/03-10/20/04	Harness can loosen if not properly tightened. Contact mfg. for free repair kit. Parents should continue to use the seat while waiting to receive/install the repair kit but are advised to make sure that the seat is properly adjusted while in use. NOTE: Models involved were sold only as travel systems (with a stroller) and any line code other than GB1B in the model # is not included in the recall.
287)	Dream Ride	02-719 ARQ	01/89-01/94	Upholstery flammability. Call mfg. for repair info.
288)	DreamRide	22-001FSM	12/01/03-04/28/04	Failed to meet back support angle requirements of FMVSS 213. Discontinue rear-facing use and use only as a car bed or request free replacement rear-facing child restraint from DJG. Contact mfg. for warning label and information.
289)	Hi Back Booster	02409, 02442, 02443, 02445, 02448, 02449, 02450, 02480, 02495	01/01/00-09/30/01	Tether webbing does not conform to abrasion requirements of FMVSS 213. Contact mfg. for free repair kit.
290)	Hi Back Booster	02442, 02443, 02448, 93443, 93514	03/15/02-08/01/02	UV stabilizer in harness webbing does not conform to requirements of FMVSS 213. Contact mfg. for free repair kit.
291)	High Rise Booster	22-297, 22-298, 22-299	10/01/03-10/31/03	Incorrect warning label stating it is for use forward facing for children under one year of age rather than OVER one year of age. Contact mfg. for free replacement label and instructions.
292)	Luxury Soft Shield Auto Trac	02-790, 02-890	10/89-6/90	Crash test failure. Call mfg. for repair info.
293)	Safe-T-Shield	81A or B, 181A or B	10/80-6/83	Shield. Call mfg. to replace seat.
294)	Safe-T-Mate		1984	Wrong instructions. Call mfg. for repair info.
295)	Safe and Easy	313	1/84-6/85	Plastic shell. Call mfg. for repair info.
296)	Safe and Snug	323, 423	1/84-6/85	Plastic shell. Call mfg. for repair info.
297)	Sidekick Booster	244x	04/96-5/97	Crash test failure of shield. Use only as belt-positioning booster. Call mfg. for refund info.
298)	Soft Shield	02-090	10/89-6/90	Crash test failure. Call mfg. for repair info.
299)	Soft Shield Auto Trac	02-290	10/89-6/90	Crash test failure. Call mfg. for repair info.
300)	Soft Shield Deluxe	02-190	10/89-6/90	Crash test failure. Call mfg. for repair info.
301)	Touriva	02-084	5/94-8/94	Buckle. Call mfg. for repair info.
302)	Touriva Shield	02-014-EMF, 02-014-GDM, 02-015-PDL	8/97 (Mold #3)	Crash test failure of shell in front-facing recline position. Call mfg. for repair info.
303)	Touriva 5-point	02-514-BWE, 02-584-OXF, 02-518-NDF	8/97 (Mold #3)	Crash test failure of shell in front-facing recline position. Call mfg. for repair info.
304)	Touriva T-Shield	02-084, 02-094, 02-096, 02-404, 02-821	5/96-11/97	Crash test failure of post-test release pressure standard for the buckle. Call mfg. for repair info.

Car Seat Recalls and Safety Notifications: MODELS 10 YEARS OLD AND OLDER

<i>List No.</i>	<i>Manufacturer Model Name</i>	<i>Model # ("X" = more numbers or letters follow)</i>	<i>Customer assistance Mfg Date</i>	<i>Problem Type and Consumer Action</i>
Cosco (Dorel) (continued)				
305)	Touriva	02014, 02015, 02019, 02084, 02094, 02114, 02504, 02514, 02518, 02519, 02524, 02584, 02803, 02806, 02821, 02825, 02935, 93084, 93094, 93514	01/01/00-09/30/01	Tether webbing does not conform to abrasion requirements of FMVSS 213. Contact mfg. for free repair kit.
306)	Touriva	02514, 02519, 02524, 22100, 93446, 93504	03/15/02-08/01/02	UV stabilizer in harness webbing does not conform to requirements of FMVSS 213. Contact mfg. for free repair kit.
307)	Trooper	219x, 224x, 225x, 229x	10/96-2/97	Crash test failure. Call mfg. for repair info.
308)	Turnabout	02-667, 02-753, 02-756, 02-758, 02-759, 02-760, 02-761, 02-762, 02-763, 02-764, 02-765, 02-770, 02-771, 02-772	03/01/95-01/31/00	Handle locks can unexpectedly release when used as a carrier, causing the seat to flip forward. Does not affect safety as car seat. Call mfg. for repair info. [Note: a recall campaign initiated 06/25/03 added models made through 01/31/00 to a previous recall of those made through 09/97.]
309)	Voyager Infant Seat/Stroller	All	9/97-10/97	Potential dislodgement from stroller. Does not affect safety as car seat. Call mfg. for repair info.

Downunder**ALL MODELS OLDER THAN 10 YEARS - NO LONGER IN BUSINESS - DESTROY & REPLACE**

310)	Kangaroo Booster Seat	All (Pre- 1/98)		Safety improvement campaign: The shoulder belts may not be properly located when the child is placed in the restraint. The shoulder belt guides may not help achieve correct seat belt placement. Do not use this booster if the shoulder belt does not touch the child's chest.
------	-----------------------	-----------------	--	--

Eddie Bauer (Dorel)**Dorel Juvenile Group: 800-219-0509 / 866-611-3022 / 812-372-0141
www.djgusa.com**

311)	3-in-1	02-331, 02-332, 02-531, 02-533, 02-537, 02-555	11/17/00-01/10/01	Tether webbing could be cut and separate in a crash allowing excessive movement of the child. Contact mfg. for free repair kit.
312)	3-in-1 Deluxe 3-in-1 Deluxe Convrt.	22740, 22750, 22755, 22756, 22757, 22770	11/01/03-12/31/05	There is a potential for the harness adjustment strap to loosen during use. Contact mfg. for free repair kit.
313)	Alpha Omega Alpha Omega Elite	22750, 22755, 22756, 22757, 22770	11/01/03-12/31/05	There is a potential for the harness adjustment strap to loosen during use. Contact mfg. for free repair kit.
314)	Comfort Infant Seat	22630xxx, 22631xxx	07/26/05-02/28/06	Trim screws on handle can loosen resulting in a potential choking hazard. Contact mfg. at 877-229-1374 for free repair kit. Make sure the handle trim screws are tight and continue to use the existing seat while waiting to receive and install the repair kit. (The 22630 models are part of the 01726 Eddie Bauer Integrated Travel System.)
315)	Comfort Infant Seat	22630xxx, 22631xxx	07/26/05-02/28/06	Some consumers have experienced difficulty installing the base in certain vehicles. Dorel will replace the original version of the base at no charge to the customer. Contact mfg. at 877-229-1374 to determine eligibility for a replacement base.

Car Seat Recalls and Safety Notifications: MODELS 10 YEARS OLD AND OLDER

<i>List No.</i>	<i>Manufacturer Model Name</i>	<i>Model # ("X" = more numbers or letters follow)</i>	<i>Mfg Date</i>	<i>Customer assistance Problem Type and Consumer Action</i>
Eddie Bauer (continued)				
316)	Designer 22	22-625 xxx GB1B	08/19/03-10/20/04	Harness can loosen if not properly tightened. Contact mfg. for free repair kit. Parents should continue to use the seat while waiting to receive/install the repair kit but are advised to make sure that the seat is properly adjusted while in use. NOTE: Models involved were sold only as travel systems (with a stroller) and any line code other than GB1B in the model # is not included in the recall.
317)	Enspira	22740	11/01/03-12/31/05	There is a potential for the harness adjustment strap to loosen during use. Contact mfg. for free repair kit.
318)	Hi Back Booster	02409, 02442, 02443, 02445, 02448, 02449, 02450, 02480, 02495	01/01/00-09/30/01	Tether webbing does not conform to abrasion requirements of FMVSS 213. Contact mfg. for free repair kit.
319)	Touriva	02870, 02871, 02875	01/01/00-09/30/01	Tether webbing does not conform to abrasion requirements of FMVSS 213. Contact mfg. for free repair kit.

Evenflo		800-525-2472 / 800-233-5921		
320)	410	410	6/88-4/89	Harness/shield. Call mfg. for repair info.
321)	Bobby Mac Champion	411	4/85-4/90	Buckle. Call mfg. for repair info.
322)	Bobby Mac Deluxe	412, 414, 415, 416	4/85-4/90	Buckle. Call mfg. for repair info.
323)	Booster Seat	470, 471	2/87-8/88	Upholstery buttons. Call mfg. for repair info.
324)	Booster Seat	242, 470, 471	4/85-4/90	Buckle. Call mfg. for repair info.
325)	Champion	224x	06/93-11/96	Crash test failure. Call mfg. for repair info.
326)	Champion	224x	06/93-11/96	Crash test failure. Call mfg. for repair info.
327)	Champion	219x, 224x, 225x, 229x	10/96-2/97	Crash test failure. Call mfg. for repair info.
328)	Cozy Carry	272x, 273x, 468x, 469x, 476x, 477x, 478x, 480x, 481x	ALL (11/01/01-08/31/02)	Upgrade Kit - Not a Recall: For owners of Cozy Carry infant car seats to improve the performance of the detachable base in certain types of collisions. The kit is only for detachable bases with the words "Cozy Carry" on them. Visit www.cozycarry.com or call 800-582-6698 for free kit.
329)	Dyn-O-Mite	441 thru 448	1/85-1/89	Crash test failure. Call mfg. for repair info.
330)	Dyn-O-Mite	202, 441 thru 448	4/85-4/90	Buckle. Call mfg. for repair info.
331)	Embrace	Begins with 317, 320, 397, 398, 540, 548, 549, 550, 556, 597, 598, 599	Pre-04/08/06	When used as an infant carrier, the handle can unexpectedly release, causing the seat to rotate forward. Handle should not be used until the repair kit has been installed. Affected restraints can continue to be used as a car seat properly installed in a vehicle. Contact mfg. for a free repair kit.
332)	Infant Car Seat	456, 458	Pre 4/89	Crash test failure. Call mfg. for repair info.
333)	Infant Car Seat	201, 202, 441 thru 446, 448, 456, 458	4/85-4/90	Buckle. Call mfg. for repair info.
334)	Joyride	Begins with 203, 205, 210, 435, 493	01/88-12/98	When used as an infant carrier, the carry handle can unexpectedly release, cause the seat to flip forward, and cause infant to fall to the ground. Call mfg. for repair info.
335)	On My Way	Begins with 206	05/94-05/95	Crash test failure. Call mfg. for repair info.

Car Seat Recalls and Safety Notifications: MODELS 10 YEARS OLD AND OLDER

<i>List No.</i>	<i>Manufacturer Model Name</i>	<i>Model # ("X" = more numbers or letters follow)</i>	<i>Customer assistance Mfg Date</i>	<i>Problem Type and Consumer Action</i>
<i>Evenflo (continued)</i>				
336)	On My Way	Begins with 207, 492	12/95-07/97	When used as a carrier, the locking mechanism on the handle can slip, flipping the seat forward and tossing the baby on the ground. Call mfg. for repair info.
337)	On My Way	Begins with 200, 211, 447, 499	Pre- 02/10/00	Safety Notification: Alignment posts in base can become bent after repeated use. Contact mfg. for free upgrade kit.
338)	On My Way base	639001, 639002	Pre- 02/10/00	Safety Notification: Alignment posts in base can become bent after repeated use. Contact mfg. for free upgrade kit.
339)	One-Step	221, 401 thru 409	04/85-04/90	Buckle. Call mfg. for repair info.
340)	One-Step Deluxe	222, 223, 4176	04/85-04/90	Buckle. Call mfg. for repair info.
341)	Scout	229x	06/93-12/96	Crash test failure. Call mfg. for repair info.
342)	Scout	219x, 224x, 225x, 229x	10/96-02/97	Crash test failure. Call mfg. for repair info.
343)	Seven Year Seat	453, 454	02/87-08/88	Upholstery buttons. Call mfg. for repair info.
344)	Seven Year Seat	228, 453, 454	04/85-04/90	Buckle. Call mfg. for repair info.
345)	Travel Tandem (Joyride + base)	205x	01/88-03/96	Test failure with base. Use without base and call mfg. for repair info.
346)	Travel Tandem (Joyride + base)	205x, 210x	01/88-12/98	When used as an infant carrier, the carry handle can unexpectedly release, cause the seat to flip forward, and cause infant to fall to the ground. Call mfg. for repair info.
347)	Tribute	378x, 379x	09/08/05-09/22/05	Certain areas of the plastic shell may be prone to stress fractures. Call mfg. to receive a replacement seat.
348)	Triumph	264x	10/20/01-01/31/02	Slide loop connectors in the harness may not be strong enough to fully secure the child in a crash. Call mfg. for repair kit.
349)	Triumph	264x, 359x, 389x	09/06/01-10/31/05	Portions of the cloth cover can be pulled back exposing the foam liner in an area that is reachable by a child occupant. A child inside the seat may break off and potentially choke on a piece of the foam liner. Contact mfg. for repair kit.
350)	Trooper (shield)	21940, 219164, 219180, 219186, 219188	11/95-1/96	Instructions. Call mfg. for new instructions
351)	Two-in-One	636x, 637x	1/98-3/98	In crash tests, the seat's backrest and base have separated when 5-point harness was being used. Call mfg. for information and replacement seat.
352)	Ultara 1	420	9/88-7/89	Buckle. Call mfg. for repair info.
353)	Ultara 1	231	2/93-8/93	Plastic sleeve on harness. Call mfg. for repair info.
354)	Ultara II	227	1/90-6/90	Crash test failure. Call mfg. for repair info.
355)	Ultara II	232	2/93-8/93	Plastic sleeve on harness. Call mfg. for repair info.
Fisher Price ALL MODELS OLDER THAN 10 YEARS - DESTROY & REPLACE				
356)	Car Seat	9100	Pre-1987	Harness/shield. Call mfg. for repair info.
357)	Car Seat	9100, 9101	4/85-1/89	Upholstery. Call mfg. for repair info.
358)	Car Seat	9100, 9101	2/90-3/90	Buckle. Call mfg. for repair info.
359)	Car Seat	9100	4/85-8/85	Shield. Call mfg. for repair info.
360)	Car Seat	9100, 9101	5/87-1/89	Buckle. Call mfg. for repair info.

Car Seat Recalls and Safety Notifications: MODELS 10 YEARS OLD AND OLDER

<i>List No.</i>	<i>Manufacturer Model Name</i>	<i>Model # ("X" = more numbers or letters follow)</i>	<i>Mfg Date</i>	<i>Customer assistance Problem Type and Consumer Action</i>
Fisher Price (continued)				
361)	Car Seat	9100, 9101	2/89-11/89	Buckle (extended 5/87-1/89). Call mfg. for repair info.
362)	Car Seat	9100, 9101	Pre 91	Loose button. Call mfg. for repair info.
363)	Car Seat	9100, 9101	2/91-1/92	Harness/shield. Call mfg. for repair info.
364)	Car Seat	9100, 9101	Pre 7/89	Label on shield. Call mfg. for repair info.
365)	Delux Car Seat	9104	6/15-9/92	Buckle. Call mfg. for repair info.
366)	Infant Seat	9149	1/91-2/91	Shield. Call mfg. for repair info.
367)	Infant Seat	9173	9/94-10-94	Air bag label. Call mfg. for repair info.
368)	Booster	9104	4/92-9/92	Buckle. Call mfg. for repair info.
369)	Booster	9104	4/92-9/92	Buckle. Call mfg. for repair info.
370)	Safe Embrace	79700	5/97-3/98	Harness adjuster. Call mfg. for repair info.

Ford		ALL MODELS OLDER THAN 10 YEARS - REPLACEMENT PROGRAM DISCONTINUED - DESTROY & REPLACE		
371)	Infant Love Seat	All	81/82	Plastic shell may develop cracks. Destroy & replace seat.

General Motors		ALL MODELS OLDER THAN 10 YEARS - REPLACEMENT PROGRAM DISCONTINUED - DESTROY & REPLACE		
372)	Infant Love Seat	All	81/82	Plastic shell may develop cracks. Destroy & replace seat.
373)	Child Love Seat	All	3/84-11/84	Plastic shell may develop cracks. Destroy & replace seat.

Gerry		Contact Evenflo: 800-525-2472 / 800-233-5921		
374)	Guardian	All	01/90-05/90	Buckle. Call mfg. for repair info.
375)	Secure Ride	626	08/94-03-95	Air bag label. Call mfg. for new label

Graco		800-345-4109 / www.gracobaby.com		
376)	ComfortSport	8629x, 8630x, 8631x, 8632x, 8635x, 8639x, 8C00x, 8C01x, 8C02x, 8C03x, 8C04x, 8433x	01/02/07-07/31/07	Lower Anchorage belt may have been misrouted during assembly process. Use the vehicle seatbelt instead of LATCH to install affected models in the rear-facing position until it is inspected and, if necessary, corrected. Call mfg. or visit gracobaby.com website for additional info.
377)	GT 1000	All	1/85-1/86	Crash test failure. Call mfg. for repair info.
378)	SnugRide	7493, 7497, 7499, 841101, 841102, 841103, 841203, 8412T02, 8457, 8458, 8459, 8460, 8462, 8471, 8472, 8473, 8474, 8476, 8477, 8478	08/31/99-02/28/02	May be missing 1 or 2 metal hooks and their retainer pins on the base of the carrier shell or the "U" shaped bars on the carrier shell that are used to attach the carrier to the base. If the hooks, pins or "U" bars are missing, the carrier may not be securely attached to the base and the carrier could detach from the base in the event of a sudden stop or crash. Call Graco to receive a free replacement seat or base. NOTE: All affected model numbers may also begin with the letter "A" and/or also be followed by letters.

Car Seat Recalls and Safety Notifications: MODELS 10 YEARS OLD AND OLDER

<i>List No.</i>	<i>Manufacturer Model Name</i>	<i>Model # ("X" = more numbers or letters follow)</i>	<i>Mfg Date</i>	<i>Customer assistance Problem Type and Consumer Action</i>
Graco (continued)				
379)	SnugRide	8402, 8402L, 8403x, 8412, 8442x, 8443, 8443L, 8444, 8444L, 8446, 8446L, 8447, 8447L, 8448, 8448L, 8457, 8458, 8459, 8463x, 8464, 8470, 8471, 8478, 8601, 8602x, 8603M, 8605x, 8607x, 8608D, C844342	03/01/02-03/08/03	May have missing hardware used to attach the carrier to the base. Contact mfg. at 866-473-0163 or www.gracobaby.com for inspection and repair information. All models can safely be installed without the base. [NOTE: The initial 03/12/03 recall campaign for this problem included models manufactured through 03/06/03. A recall extension announced 08/13/03 added models manufactured through 03/08/03.]
380)	SnugRide	8609x, 8616x, 8643x, 8645x, 8646x	08/01/06-06/30/07	The backing of the seat pad may pull away from the seams in an area reachable to the child occupant, exposing the pad filling and posing a potential choking hazard. Contact mfg. For repair kit.

International**ALL MODELS OLDER THAN 10 YEARS - NO LONGER IN BUSINESS - DESTROY & REPLACE**

381)	Astroseat	All	12/80-7/81	Buckle. Destroy & replace seat.
------	-----------	-----	------------	---------------------------------

Kolcraft**ALL MODELS OLDER THAN 10 YEARS - NO LONGER IN BUSINESS - DESTROY & REPLACE**

382)	Automate	180-600, 180-601	Pre 4/93	Buckle. Call mfg. for repair info.
383)	Carter Travel 5	13833, 13842, 13852	5/96-9/96	Crash test failure of buckle. Call mfg. for repair info.
384)	Dial-A-Fit	180-200, 180-300	1/87-8/89	Upholstery clips. Call mfg. for repair info.
385)	Dial-A-Fit	180-200, 180-300	10/88-8/89	Crash test failure. Call mfg. for repair info.
386)	Dial-A-Fit II	180-600	11/90-8/91	Crash test failure. Call mfg. for repair info.
387)	Infant Car Seat	1383x	1/93-6/99	Carrier handle can release and allow the seat to rotate. Does not affect safety as car seat. Call mfg. for repair info.
388)	Infant Restraint	43xxx	1/93-6/99	Carrier handle can release and allow the seat to rotate. Does not affect safety as car seat. Call mfg. for repair info.
389)	Infant Rider	138xx, 368xx	3/96-8/96	Crash test failure of buckle. Call mfg. for repair info.
390)	Infant Rider	1312x, 1382x, 1383x, 368xx	1/93-6/99	Carrier handle can release and allow the seat to rotate. Does not affect safety as car seat. Call mfg. for repair info.
391)	Flip 'N' Go	19127 thru 19130	1/85-3/87	Shield. Call mfg. for repair info.
392)	Flip 'N' Go II	19127	1/85-3/88	Shield. Call mfg. for repair info.
393)	Perfect Fitt	180-100, 180-150	Pre 4/90	Upholstery clips. Call mfg. for repair info.
394)	Perfect Fitt	180-150, 180-200	3/89-10/90	Crash test failure. Call mfg. for repair info.
395)	Perfect Fitt	180-200	Pre 10/90	Upholstery. Call mfg. for repair info.
396)	Performa	All	3/96-10-96	Upholstery. Call mfg. for repair info.
397)	Performa	All	1/96-7/97	Buckle release force. Call mfg. for repair info.
398)	Playskool Car Seat	140-155, 180-400	12/89-8/90	Upholstery. Call mfg. for repair info.
399)	Playskool Car Seat	77001, 77002	1/91-6/93	Buckle. Call mfg. for repair info.

Car Seat Recalls and Safety Notifications: MODELS 10 YEARS OLD AND OLDER

<i>List No.</i>	<i>Manufacturer Model Name</i>	<i>Model # ("X" = more numbers or letters follow)</i>	<i>Mfg Date</i>	<i>Customer assistance Problem Type and Consumer Action</i>
Kolcraft (continued)				
400)	Playskool Infant Car Seat	77005, 77007	1/93-6/99	Carrier handle can release and allow the seat to rotate. Does not affect safety as car seat. Call mfg. for repair info.
401)	Plus 4	138xx, 368xx	3/96-8/96	Crash test failure of buckle. Call mfg. for repair info.
402)	Plus 4	1382x, 1383x, 1384x, 368xx	1/93-6/99	Carrier handle can release and allow the seat to rotate. Does not affect safety as car seat. Call mfg. for repair info.
403)	Plus 5	138xx, 368xx	3/96-8/96	Crash test failure of buckle. Call mfg. for repair info.
404)	Plus 5	13833, 13842, 13852	5/96-9/96	Crash test failure of buckle. Call mfg. for repair info.
405)	Plus 5	1382x, 1383x, 1384x, 1385x, 368xx	1/93-6/99	Carrier handle can release and allow the seat to rotate. Does not affect safety as car seat. Call mfg. for repair info.
406)	Rock 'N' Ride	13123	2/85-6/85	Plastic shell. Call mfg. to replace seat.
407)	Rock 'N' Ride	131-101	Pre 3/90	Upholstery clips. Call mfg. for repair info.
408)	Secura	43xxx	1/93-6/99	Carrier handle can release and allow the seat to rotate. Does not affect safety as car seat. Call mfg. for repair info.
409)	Secure Fit	All	1/96-7/97	Buckle release force. Call mfg. for repair info.
410)	Travel About	138xx, 368xx	3/96-8/96	Crash test failure of buckle. Call mfg. for repair info.
411)	Travel About	13833, 13842, 13852	5/96-9/96	Crash test failure of buckle. Call mfg. for repair info.
412)	Travel-About	1382x, 1383x, 1384x, 1385x	1/93-6/99	Carrier handle can release and allow the seat to rotate. Does not affect safety as car seat. Call mfg. for repair info.
413)	Traveler 700	All	11/01/94-12/31/95	Voluntary action: Buckle concerns. Call mfg. for repair info.
414)	Traveler 700	150-100	1/91-8/91	Cracks in plastic. Call mfg. to replace seat.
415)	Traveler 700	All	1/91-6/93	Rusting of buckle. Call mfg. for repair info.
Lin Lih/MCP Ent.		ALL MODELS OLDER THAN 10 YEARS - REPLACEMENT PROGRAM DISCONTINUED - DESTROY & REPLACE		
416)	Lin Lih	All	ALL	Counterfeit seat. Call NHTSA: 800-424-9393
417)	Lin Lih	180-200, 180-300	10/88-8/89	Crash test failure. Call NHTSA: 800-424-9394
Mia Moda		866-642-6632 - www.miamodainc.com		
418)	Viva	5000 (seat), 5001 (base)	12/19/06-02/06/07	The lower anchor connector adjuster assembly may interfere with the connection of the infant carrier to the restraint base when installed using LATCH. Installation with seat belt is not affected. In addition, registration cards were not provided with the Viva or separately sold bases. Contact mfg. For repair kit and to register CR with mfg.
Mercedes-Benz USA		800-367-6372 - www.mbusa.com		
419)	Booster	BQ6910157, BQ6910163	02/01/97-07/31/99	BabySmart airbag deactivation device may not automatically deactivate the passenger airbag. Contact mfg. for free replacement seat and instructional video.
420)	Infant Restraint	BQ6910155	02/01/97-07/31/99	BabySmart airbag deactivation device may not automatically deactivate the passenger airbag. Contact mfg. for free replacement seat and instructional video.

Car Seat Recalls and Safety Notifications: MODELS 10 YEARS OLD AND OLDER

<i>List No.</i>	<i>Manufacturer Model Name</i>	<i>Model # ("X" = more numbers or letters follow)</i>	<i>Mfg Date</i>	<i>Customer assistance Problem Type and Consumer Action</i>
Mercedes-Benz USA (continued)				
421)	Kiddy TopSafe (mfg. by Sicartex)	B66868203 B66868204 B66868209	03/01/03-11/30/03	Lower LATCH attachment may not be strong enough to hold in the event of a crash. Immediately replace with another model and return Kiddy Top seat to Mercedes-Benz dealer for refund. Install with vehicle seat belt until replacement is obtained. Contact Mercedes-Benz for further information.
Peg Perego USA		877-737-3468 / 219-482-8191 - www.perego.com		
422)	Primo Viaggio	CS00MU1, CS00US1, CS00US8	02/01/01-06/10/01	The latch mechanism securing the seat to the base does not completely engage on a small number of seats due to improper positioning of the metal reinforcement bracket. Call mfg. for repair info. Note: Primo Viaggio infant seat sold separately and with strollers as part of Pliko and Primo Viaggio Travel Systems.
423)	Primo Viaggio	CS00MU1, CS00US1, CS00US8, LV34USL, LV34USN, LN34S09, LN34S10, ST33USL, ST33USN, ST38USL, ST38USN, AL33USL, AL33USN, AL34USN, AL34USL	05/20/01-02/15/02	The harness adjustment/locking mechanism may not fully lock and allow the harness to slip. The strap tension adjuster cover of affected models have a red circle around a dark button. Contact mfg. for full identification and repair information. Note: Primo Viaggio infant seat sold separately and with strollers as a part of Pliko, Primo Viaggio, and Atlantico Travel Systems.
Playskool		Contact Kolcraft: 800-453-7673		
424)	Car Seat	140-155, 180-400	12/89-8/90	Upholstery. Call Kolcraft
425)	Car Seat	77001, 77002	1/91-6/93	Buckle. Call Kolcraft
426)	Infant Car Seat	77005, 77007	1/93-6/99	Carrier handle can release and allow the seat to rotate. Does not affect safety as car seat. Call mfg. for repair info.
Pride Trimble/Virco		800-521-5198		
427)	Click-n-Go	890, 891, 892	2/86-10/87	Crash test failure. Call mfg. to replace seat.
428)	Click-n-Go	890, 891, 892	1/88-4/89	Crash test failure. Call mfg. to replace seat.
429)	Pride Ride	832	1/88-4/89	Crash test failure. Call mfg. to replace seat.
Questor		Contact Evenflo: 800-233-5921		
430)	Kantwet Car Seat	All	5/69-3/73	May pinch child's fingers. Call mfg. for repair info.
Renolux (FBS)		ALL MODELS OLDER THAN 10 YEARS - NO LONGER IN BUSINESS - DESTROY & REPLACE		
431)	GT 1000	All	8/88-10/88	Buckle/recline angle. Destroy & replace seat.
432)	GT 2000	All	8/88-10/88	Buckle/recline angle. Destroy & replace seat.
433)	GT 2000	All	1/92-1/93	Foam padding failed HIC (head injury) limits. Destroy & replace seat.
434)	GT 2000	All	5/89-6/93	Flammability of upholstery. Destroy & replace seat.
435)	GT 4000	All	1/92-1/93	Foam padding failed HIC (head injury) limits. Destroy & replace seat.
436)	GT 4000	All	5/89-6-93	Flammability of upholstery. Destroy & replace seat.
437)	GT 5000	All	1/92-1/93	Foam padding failed HIC (head injury) limits. Destroy & replace seat.
438)	GT 5000	All	5/89-6-93	Flammability of upholstery. Destroy & replace seat.

Car Seat Recalls and Safety Notifications: MODELS 10 YEARS OLD AND OLDER

<i>List No.</i>	<i>Manufacturer Model Name</i>	<i>Model # ("X" = more numbers or letters follow)</i>	<i>Mfg Date</i>	<i>Customer assistance Problem Type and Consumer Action</i>
Renolux (FBS) (continued)				
439)	GT 5000 Turn A Tot	All	2/90-4/91	Test failure/upholstery. Destroy & replace seat.
440)	GT 5000 Turn A Tot	All	1/92-1/93	Foam padding failed HIC (head injury) limits. Destroy & replace seat.
441)	GT 5000 Turn A Tot	All	5/89-6-93	Flammability of upholstery. Destroy & replace seat.
442)	GT 5500	All	1/92-1/93	Foam padding failed HIC (head injury) limits. Destroy & replace seat.
443)	GT 5500	All	5/89-6-93	Flammability of upholstery. Destroy & replace seat.
444)	GT 7000	All	All	Remote may overheat/ fire hazard. Destroy & replace seat.
445)	GT 7000	All	1/92-1/93	Foam padding failed HIC (head injury) limits. Destroy & replace seat.
446)	GT 7000	All	5/89-6-93	Flammability of upholstery. Destroy & replace seat.

Safeline Kids		800-829-1625 - www.tripleplayproducts.com		
447)	Sit'n'Stroll	3240	6/9/97-8/9/97	Air bag labels. The air bag warning label was omitted from the seat cover. Contact Mfg. for new seat cover that has the required air bag warning label.
448)	Sit'n'Stroll	3240	11/1/96-6/30/99	Labels recommend use rear-facing for children up to 25 pounds. Contact Mfg. for new labels to be placed over the existing labels. New labels recommend use rear-facing for children up to 22 pounds.
449)	Sit'n'Stroll	2240	04/01/01-10/01/01	The FAA certification statement on label is in yellow lettering instead of the required RED lettering. Flight attendants may not allow its use on an airplane. Contact mfg. for replacement label.
450)	Sit'n'Stroll	2003	09/01/02-10/21/03	Child's head may move too far forward in a crash when lower forward-facing belt path or shoulder and buckle pads are used. Remove and discard shoulder and buckle pads and use upper forward-facing belt path only. Contact mfg. for revised instructions and labels.

Safety 1st (Dorel)		Dorel Juvenile Group: 866-623-3139 / 800-219-0509 / 866-611-3022 / 812-372-0141 www.djgusa.com		
451)	Alpha Elite	All Models	11/01/03-12/31/05	There is a potential for the harness adjustment strap to loosen during use. Contact mfg. for free repair kit.
452)	Alpha Omega Elite	22151 22455	11/01/03-12/31/05	There is a potential for the harness adjustment strap to loosen during use. Contact mfg. for free repair kit.
453)	Alpha Sport	All Models	11/01/03-12/31/05	There is a potential for the harness adjustment strap to loosen during use. Contact mfg. for free repair kit.
454)	Designer 22	02-621-SAL, 02-620-xxx	01/03/02-02/13/02	Plastic handle can unexpectedly release from the carrying position when used as a carrier. Does not affect safety as a child restraint. Contact mfg. for repair kit.
455)	Designer 22	22-325 xxx GB1B	08/19/03-10/20/04	Harness can loosen if not properly tightened. Contact mfg. for free repair kit. Parents should continue to use the seat while waiting to receive/install the repair kit but are advised to make sure that the seat is properly adjusted while in use. NOTE: Models involved were sold only as travel systems (with a stroller) and any line code other than GB1B in the model # is not included in the recall.

Car Seat Recalls and Safety Notifications: MODELS 10 YEARS OLD AND OLDER

<i>List No.</i>	<i>Manufacturer Model Name</i>	<i>Model # ("X" = more numbers or letters follow)</i>	<i>Mfg Date</i>	<i>Customer assistance Problem Type and Consumer Action</i>
-----------------	--------------------------------	---	-----------------	---

Safety 1st (Dorel) (continued)

456)	Enspira	22450, 22451, 22452, 22453, 22480, 22481	11/01/03-12/31/05	There is a potential for the harness adjustment strap to loosen during use. Contact mfg. for free repair kit.
457)	Intera	22460	11/01/03-12/31/05	There is a potential for the harness adjustment strap to loosen during use. Contact mfg. for free repair kit.

Snug Seat

800-336-7684 - www.snugseat.com

458)	Gorilla	200-1000	07/26/02-01/15/03	A washer in tether anchor kit does not meet corrosion requirements of FMVSS 213. Contact mfg. for replacement kit # FW-50250-12-ZY
459)	Spelcast	600-1000	07/26/02-01/15/03	A washer in tether anchor kit does not meet corrosion requirements of FMVSS 213. Contact mfg. for replacement kit # FW-50250-12-ZY
460)	Traveller Plus (Mfg. by Britax for Snug Seat)	E9L32	Pre-07/24/04	The adjuster strap may slip within the metal buckle that controls the tightness of the shoulder harness and may allow the harness to loosen. Contact Britax at 800-683-2045 or 704-409-1700 for repair kit.

Strolee

ALL MODELS OLDER THAN 10 YEARS - NO LONGER IN BUSINESS - DESTROY & REPLACE

461)	Wee Care	All	Pre 4/80	Crash test failure. Destroy & replace seat.
462)	Wee Care	599	12/80-5/81	Upholstery. Destroy & replace seat.
463)	Wee Care	609, 610	ALL	Plastic shell. Destroy & replace seat.
464)	Quick Click	605	ALL	Plastic shell. Destroy & replace seat.
465)	GT 3000	All	87/88	Crash test failure. Destroy & replace seat.

Team-Tex America

877-912-1313

466)	Babyride	374099	08/31/06-10/23/06	Belt routing label with "horizontal reference line" was incorrectly placed on the CR. Contact mfg. for a correct label and placement instructions. NOTE: According to Team-Tex America, all seats that were affected by this recall were caught and corrected before being purchased by consumers and thus should not be found in use.
------	----------	--------	-------------------	--

TRW

ALL MODELS OLDER THAN 10 YEARS - REPLACEMENT PROGRAM DISCONTINUED - DESTROY & REPLACE

467)	Infant Love Seat	All	81/82	Plastic shell may develop cracks. Destroy & replace seat.
468)	Child Love Seat	All	3/84-11/84	Plastic shell may develop cracks. Destroy & replace seat.

Volvo

800-458-1552 / 800-221-9136 / 201-768-7300

469)	ALL SEATS	All	Thru 12/88	Buckle. Call mfg. for refund info.
------	-----------	-----	------------	------------------------------------

<i>List No.</i>	<i>Manufacturer Model Name</i>	<i>Model # ("X" = more numbers or letters follow)</i>	<i>Customer assistance</i>	<i>Mfg Date</i>	<i>Problem Type and Consumer Action</i>
-----------------	--------------------------------	---	----------------------------	-----------------	---

	<i>XSCi</i>		<i>800-630-6850 / 719-593-8881</i>		
470)	Pioneered ACIS	None*		02/01/02-03/07/02	Exceeds the maximum head excursion criteria of FMVSS 213. In a crash, the cradle can detach from the deflector base. Contact mfg for replacement information (replacements produced by an alternate mfg.) *No model number is associated, but affects serial numbers 01C-000000002 to 01C-000000108. [NHTSA No. 02E-024] **NOTE: According to XSCi, all seats that were affected by this recall have been returned (as of May 8, 2002) and thus should not be found in use.**

OLDER MODEL LIST

OLDER MODEL LIST

OLDER MODEL LIST

OLDER MODEL LIST

OLDER MODEL LIST

OLDER MODEL LIST

OLDER MODEL LIST

OLDER MODEL LIST