

USING THE HIGHWAY SAFETY RESEARCH CENTER CAR SEAT RECALL LIST

Last Revisions – Newer Model List: May 8, 2018

Older Model List: October 13, 2017

Download this list & sign up for email notification of updates: buckleupnc.org/car-seat-recall-list

About Car Seats and Recalls

It is very important to pay attention to recall notices and for parents to check if their seats are safe to use or if they need to be repaired or replaced. Recalls can be issued for any failure to meet Federal Motor Vehicle Safety Standard 213 established and enforced by the National Highway Traffic Safety Administration (NHTSA). Most recalls are issued due to reasons related to the crashworthiness of the car seat, but some recalls are for deviations from the standards related to labeling requirements, flammability of the upholstery or padding, or for parts that may come loose and pose a choking hazard.

Car seats are required to have a label indicating the manufacturer, model information, and date of manufacture. Car seats should not be used if the labels are missing such that the manufacturer, model name, model number, and date of manufacture cannot be determined.

Car seat manufacturers have supplied registration cards with each new seat since 1993. It is important for the user to complete the registration card and send it to the manufacturer for quick notification in the event of a recall or safety notification. If the card for a restraint has been lost, it can be registered by contacting the manufacturer through the phone numbers provided in the instructions and on the label on the seat.

Some recall notices are related to problems that do not make the seats unsafe in a crash, but all problems should be corrected. Phone numbers are provided on the recall list when a corrective action can be taken. The manufacturer should be able to advise the parent whether to continue using the current car seat or to obtain another one until the problem can be corrected. Parents and other caregivers are encouraged to contact the manufacturer for model specific recommendations.

In cases where the manufacturer has gone out of business or discontinued replacement programs, parents are advised to destroy the seat and use another one. Unsafe seats should NOT be thrown in the trash where they can be picked up and used by others. Discarded seats should be taken apart and stripped of upholstery, padding and straps and then destroyed by having them crushed to prevent others from using them.

To report any suspected car seat or vehicle safety defects, call the National Highway Traffic Safety Administration Auto Safety Hotline at 888-327-4236 / (TTY): 800-424-9153..

About Older Car Seats and Recalls

Car seats manufactured before 1981 were not required to be crash tested and must not be used. Most manufacturers stamp their car seats with an expiration date, typically six to eight years from the date of manufacture, on a label or in the shell of the seat. Most child passenger safety advocates recommend that if no expiration date can be found, car seats older than ten years should be replaced by a new one. Older models, those manufactured since 1981, are included as a part of this recall list because care givers will sometimes choose to use older car seats even though it goes against the recommendations of most car seat manufacturers, organizations, and advocates. Knowing that a particular model is under recall, and if the defect cannot be corrected, should help to encourage the care giver to destroy the older seat and obtain a new one.

About the HSRC Recall List

The UNC Highway Safety Research Center (HSRC) car seat recall list identifies recalls and safety notifications for car seats known by the HSRC at the time it is published. This list is updated by HSRC as soon as possible after recall notifications are announced and after the information can be verified for completeness and accuracy. To be notified via email whenever the HSRC Recall List is updated, send us an email at cps@hsrc.unc.edu

The HSRC recall list is formatted in a compact format without much detail, but does serve to indicate if a particular model has been recalled. Users of this (or any other) recall list should remind parents/caregivers to contact the manufacturer to be certain whether or not a particular car seat is affected by any recalls and how to proceed with repairs or replacement.

The HSRC recall list is formatted with older models being separated from newer models. Recalls for models of car seats where most or all of the affected units are 10 years old or older appear at the end of the list. A separate index for the older models precedes the list. The listing of older models with recalls will only be updated as "newer" models get to be old enough to be moved to the "older" models list.

The index listing numbers and page numbers for the older models section will stay the same until the older model section is updated or otherwise revised. Programs that make multiple copies of the list, e. g., for use at clinics or permanent checking/fitting stations, should only have to make copies of the older model section when it is revised regardless of how often the main (newer model) section is revised. Most clinics or permanent checking/fitting stations should only need to print/copy one or two older model lists for reference. The list title "Car Seat Recalls and Safety Notifications: MODELS 10 YEARS OLD AND OLDER" is included in the footer to make it easier to see at a glance that it is the older model list.

Instructions for Using the PDF Version of the HSRC Recall List

Find the manufacturer, model name, model number, and date of manufacture on the label of the car seat itself. Using this information:

1. Look to see if the manufacturer and model name and/or model number are listed in the index*. **Car seats under recall are listed in the index by both model name and model number.** Each entry on the list and in the index is assigned a listing number (List No.) based on its location in the list. The list is alphabetized by manufacturer and model name. List numbers for individual models will change in subsequent lists as models are added to or removed from the list.
2. If that model name or model number is listed in the index, make note of the "List No." and use the List No. to locate the recall information for that model. Once located, check to see if the date range for the recall includes the date of manufacture listed on the label of the car seat.
3. If the seat is included in the recall, the manufacturer should be contacted for verification of the recall and steps to take to correct the problem.
4. If the manufacturer has gone out of business or discontinued their repair or replacement program, the car seat should be destroyed after a replacement seat is obtained.
5. If the car seat is not included in the recall, inform the parent of this but still refer the parent to the manufacturer for verification of the seat's recall status and to make sure it is registered with the manufacturer in case there is a recall issued on it in the future.

*Notes:

- 1) Dorel Juvenile Group (DJG) products are indexed under each individual product line (Alpha Elite, Beatrix Potter, Cosco, Eddie Bauer, Maxi-Cosi, and Safety 1st) as well as under the broader "Dorel" label.
- 2) Graco announced a recall in February 2014 on the harness buckles used on most convertible car seats and harnessed booster seats manufactured from 2009 through July 2013. Since model numbers's are not available for the model names included in this recall, Graco seats with dates from 2009 through July 2013 should be looked up by model name rather than number.

For further information, contact:

Bevan Kirley or Kristel Robison

The University of North Carolina Highway Safety Research Center

CB# 3430, Chapel Hill, NC 27599

800-672-4527 x2 or cps@hsrc.unc.edu

www.buckleupnc.org/car-seat-recall-list

The following lists identify recalls and safety notifications for car seats known by the UNC Highway Safety Research Center (HSRC) as of May 8, 2018. This list is updated by HSRC as soon as possible after recall notifications are announced. The most recent additions to the list are denoted by >>. Updated versions are available on-line at www.buckleupnc.org/car-seat-recall-list

Car seats are required to have labels indicating the manufacturer, model name and number, and date of manufacture. Model names and numbers are listed for most of the recalls. For the model numbers, "x" means that more numbers or letters follow. If the label is missing on a car seat, contact the manufacturer to see if it can be identified through other information. **A car seat should not be used if its recall status cannot be determined because the model name, model number, date of manufacture or manufacturer is not available.**

Car seats manufactured before 1981 were not required to be crash tested and must not be used. Car seats beyond their expiration dates should also not be used. Most car seats expire after 6 years from the date of manufacture, but expiration dates vary by manufacturer and model. Most manufacturers stamp their car seats, on a label or in the shell, with an expiration date, typically six to eight years from the date of manufacture. If needed, you can call the manufacturer. **Models older than ten years and under recall are included on a separate list with a separate index** for use as a reference. The index for older models can be found following the last page of the "Models Less Than 10 Years Old" list and the list of older models with recalls follows the second index. **The "Models At Least 10 Years Old" list was last revised October 13, 2017.**

Some of the recalls/notifications for car seats on this list may be more or less date- or lot-specific than what is listed. More detailed information should be obtained through the manufacturer and **it is the manufacturer who can and should make the final determination if a specific car seat is subject to recall.**

Some of the recall notices are related to problems that do not make the seats unsafe in a crash, but **all problems should be corrected.** Phone numbers are provided when a corrective action can be taken. The manufacturer should advise you whether to continue using your current car seat or to obtain another one until the problem can be corrected.

In cases where the manufacturer has gone out of business or discontinued replacement programs, you are advised to destroy the car seat and obtain and use another one as soon as possible. Do not throw unsafe models in the trash where they can be picked up and used by others. Discarded car seats should be destroyed by having them crushed. At the very least, they should be taken apart and stripped of upholstery, padding and straps to prevent others from using them.

To report any suspected car seat or vehicle safety defects, contact the National Highway Traffic Safety Administration Auto Safety Hotline: (888) 327-4236 / (TTY): 800-424-9153.

CAR SEATS LESS THAN 10 YEARS OLD

Download this list & sign up for email notification of updates: buckleupnc.org/car-seat-recall-list

Index of Recalls and Safety Notifications
For the model numbers "x" = more numbers or letters follow.

Model numbers and model names for car seats under recall are followed by their index number which corresponds to the "List No." for each listing. If the model number is not found, check the model name also. Model numbers are not available for all model names.

- Notes:**
- 1) Dorel Juvenile Group products are indexed under each individual product line (Alpha Elite, Alpha Sport, Beatrix Potter, Bertini, Cosco, Eddie Bauer, Maxi-Cosi, and Safety 1st) as well as under "Dorel."
 - 2) Graco issued recalls in February and July 2014 on the harness buckles used on many convertible, harnessed booster, and infant seats manufactured from 2009 through January 2014. Since model #'s are not available for the model names included in this recall, Graco seats with dates from 2009 through January 2014 should be looked up by model name rather than number.

4moms # 1032 2 Infant Car Seat 2	Alcot ALL MODELS 2 All Our Kids ALL MODELS 3	Alpha Elite (Dorel) # 22148x 5 # 22149x 5 # 22158x 5 # 22459x 5
--	---	---

For the model numbers "x" = more numbers or letters follow

Index number refers to "List No." for each listing

Alpha Elite (Dorel) (continued)	# E1A016H	31	# E9LT85S	31
# 22462x	# E1A025Q	23	# E9LT86A	31
Alpha Luxe	# E1A116L	37	# E9LT86F	31
Alpha Omega All-N-1	# E1A135Q	31	# E9LT86G	31
Alpha Omega Elite	# E1A183F	26	# E9LT86H	31
	# E1A185x	26	# E9LT95N	23
Alpha Sport (Dorel)	# E1A186R	26	# E9LT95Q	23
# 22452x	# E1A203F	26	# E9LT95Z	23
# 22458x	# E1A205x	26	# E9LU63F	24
# 22546x	# E1A206x	26	# E9LU65P	24
# 22547x	# E1A207E	26	# E9LU65V	26
Enspira	# E1A215x	28	# E9LU66R	24
Vantage	# E1A216P	28	# E9LU66x	26
	# E1A221Q	28	# E9LU67x	26
American Motors	# E1A225x	28	# EXA116L	37
ALL MODELS	# E1A226L	28	# EXA185M	26
	# E9L14	34	# EXA216L	28
Baby Jogger	# E9L20	34	# EXLT34A	29
# BJ61500	# E9L5490	36	# EXLU65M	24
# BJ64510	# E9L54E7	35, 36	# S01298600	28
# BJ64529	# E9L54H6	35	# S01635200	25
# BJ70411	# E9L54H7	35	# S02063xxx	26, 28
# BJ70424	# E9L54M6	35	# S02064000	28
# BJ70431	# E9L692J	33	# S03803xxx	26
# BJ72510	# E9L692K	33	# S04144xxx	26
# BJ80400	# E9L692L	33	# S04145000	26
City GO Car Seat	# E9L692M	33	# S04281xxx	28
City GO Car Seat Base	# E9L69P2	32	# S04402800	26
City Mini Car Seat/Stroller	# E9L69P3	32	# S04628500	28
Vue Lite Car Seat/Stroller	# E9L69P5	32	# S04884xxx	26
	# E9L80	34	# S04975600	26
Baby Trend	# E9LG81A	22	# S04978900	26
# 6400	# E9LG83x	22	# S05260200	26
# 6439	# E9LJ91x	30	# S06018800	28
# 6448	# E9LJ92E	30	# S06020xxx	26, 28
# 6481	# E9LJ93P	30	# S06051300	28
# FB60070	# E9LJ93S	30	# S06147100	26
# FB60408	# E9LK31x	38	# S914900	25
Rigid Latch-Loc	# E9LK32x	38	# S915200	25
Rigid Latch-Loc Base	# E9LK33Q	38	# S915400	25
TrendZ Fastback	# E9LK91A	30	# S921800	26
	# E9LL11x	38	# S921900	25
Babyhood Industries	# E9LL12x	38	# S923700	28
ALL MODELS	# E9LL21A	22	Advocate 70-G3	22
	# E9LL23P	22	Advocate ClickTight	23
Basic Comfort	# E9LL23Y	22	B-Agile Travel System	25
ALL MODELS	# E9LS55T	27	B-Safe 35	24, 26
	# E9LS55U	27	B-Safe 35 Elite	27, 28
Beatrix Potter (Dorel)	# E9LS56P	27	B-Safe 35 Elite Travel Systems	28
ALL MODELS	# E9LS5xx	28	B-Safe 35 Elite XE	27
	# E9LS63F	24	B-Safe 35 Travel System	25
Bertini (Dorel)	# E9LS65U	27	B-Safe 35 Travel Systems	26
# 22346x	# E9LS66C	27	B-Safe 35 XE	24
SureFit	# E9LT34x	29	B-Safe BOB 35	29
	# E9LT35X	29	Boulevard 70-G3	30
Bolform	# E9LT71Q	37	Boulevard ClickTight	31
ALL MODELS	# E9LT75R	37	Chaperone	32, 33
	# E9LT76B	37	Companion	34
Britax	# E9LT76L	37	Frontier	35, 36
# E1A005R	# E9LT76N	37	Marathon ClickTight	37
# E1A006B	# E9LT76P	37	Pavilion 70-G3	38
# E1A015Q	# E9LT85Q	31		
# E1A016A		31		

For the model numbers "x" = more numbers or letters follow

Index number refers to "List No." for each listing

Century	# 30400	54	# 22-627 KGS (Eddie Bauer)	64
ALL MODELS	Olympia	53	# 22-627 SNW (Eddie Bauer)	64
	Pacifica	54	# 22-627 WAV (Safety 1st)	147
Chicco	Radian R100	55	# 22-627 WPR (Eddie Bauer)	64
# All	Radian R120	56	# 22-655 BYTE (Eddie Bauer)	64
Cortina Travel System	Radian RXT	57	# 22077x (Safety 1st)	148
Key Fit	Rainier	58	# 22078x (Safety 1st)	148
Key Fit 30			# 22148x (Alpha Elite)	5
			# 22149x (Alpha Elite)	5
Childcare	Disney (Dorel)		# 22150x (Cosco)	48
ALL MODELS	# 22-305 NAB	59	# 22152x (Safety 1st)	142
	# 22-305 PPH	59	# 22154x (Cosco)	49
	# 22-355 LBF	59	# 22155x (Cosco)	49
Chrysler [Aftermarket]	# 22-355 PWK	59	# 22158x (Alpha Elite)	5
ALL MODELS	# 22-627 AWF	59	# 22158x (Cosco)	49
	Infant Car Seat	59	# 22159x (Safety 1st)	142
Chrysler [Integrated]			# 22172x (Safety 1st)	142
Town and Country		158, 159, 160, 161	# 22177x (Safety 1st)	142
	Dodge [Integrated]		# 22178x (Safety 1st)	142
	Caravan	162, 163, 164, 165	# 22185x (Safety 1st)	142
	Grand Caravan	162, 163, 164, 165	# 22187xxx (Safety 1st)	143
Collier-Keyworth			# 22188x (Safety 1st)	142
ALL MODELS	Dorel		# 22195x (Safety 1st)	142
	(Beatrix Potter)	19	# 22346x (Bertini)	20
Combi	# 22-057 CLN (Safety 1st)	147	# 22356x (Safety 1st)	148
# 8220	# 22-057 DBY (Safety 1st)	147	# 22371x (Maxi-Cosi)	125
# 8220x	# 22-057 HRT (Safety 1st)	147	# 22372x (Maxi-Cosi)	125
# 8815	# 22-057 LPH (Safety 1st)	147	# 22412x (Safety 1st)	142
# 8836	# 22-085 DWA (Safety 1st)	147	# 22439x (Safety 1st)	144
Coccoro	# 22-085 LYN (Safety 1st)	147	# 22449x (Safety 1st)	144
Zeus 360	# 22-095 RBK (Safety 1st)	147	# 22452x (Alpha Sport)	6
Zeus Turn	# 22-300 CSF (Cosco)	51	# 22453x (Safety 1st)	146
	# 22-300 FZN (Cosco)	51	# 22456x (Safety 1st)	142
Compass Baby	# 22-300 JJV (Cosco)	51	# 22458x (Alpha Sport)	6
ALL MODELS	# 22-300 OSF (Cosco)	51	# 22459x (Alpha Elite)	5
	# 22-300 THD (Cosco)	51	# 22462x (Alpha Elite)	4
Cosco	# 22-300 TWD (Cosco)	51	# 22465x (Safety 1st)	142
# 22-300 CSF	# 22-305 NAB (Disney)	59	# 22465xxx (Safety 1st)	143
# 22-300 FZN	# 22-305 PPH (Disney)	59	# 22469x (Safety 1st)	142
# 22-300 JJV	# 22-322 HRR (Safety 1st)	147	# 22475x (Safety 1st)	151
# 22-300 OSF	# 22-322 KDL (Safety 1st)	147	# 22476x (Maxi-Cosi)	126
# 22-300 THD	# 22-322 LXI (Safety 1st)	147	# 22486x (Maxi-Cosi)	126
# 22-300 TWD	# 22-322 MAI (Safety 1st)	147	# 22546x (Alpha Sport)	7
# 22150x	# 22-322 OLY (Safety 1st)	147	# 22547x (Alpha Sport)	7
# 22154x	# 22-322 PRS (Safety 1st)	147	# 22553x (Safety 1st)	152
# 22155x	# 22-322 PTK (Safety 1st)	147	# 22554x (Safety 1st)	152
# 22158x	# 22-325 COB (Safety 1st)	147	# 22560x (Safety 1st)	152
# IC123 FSM	# 22-325 PAC (Safety 1st)	147	# 22561x (Safety 1st)	152
Alpha Omega All-N-1	# 22-355 LBF (Disney)	59	# 22564x (Safety 1st)	152
Alpha Omega Elite	# 22-355 PWK (Disney)	59	# 22567x (Safety 1st)	152
Comfy Carry	# 22-371 (Eddie Bauer)	123	# 22574x (Safety 1st)	152
Infant Car Seat	# 22-371 HFL (Maxi-Cosi)	124	# 22580x (Safety 1st)	150
	# 22-371 JUC (Maxi-Cosi)	124	# 22657x (Eddie Bauer)	66
Cyber (Regal Lager)	# 22-371 LMD (Maxi-Cosi)	124	# 22740x (Eddie Bauer)	63
# 0500200xx	# 22-371 ORE (Maxi-Cosi)	124	# 22741x (Eddie Bauer)	63
# 0500760xx	# 22-371 PNG (Maxi-Cosi)	124	# 22755x (Eddie Bauer)	61
Solution X-fix	# 22-372 (Eddie Bauer)	123	# 22758x (Eddie Bauer)	61
	# 22-372 TTH (Maxi-Cosi)	124	# 22759x (Eddie Bauer)	61
Diono	# 22-380 LGA (Safety 1st)	147	# 22790x (Eddie Bauer)	61
# 16000	# 22-380 MSA (Safety 1st)	147	# 22790xxx (Eddie Bauer)	62
# 16600	# 22-515 (Eddie Bauer)	123	# 22799x (Eddie Bauer)	61
# 16800	# 22-515 BLK (Maxi-Cosi)	124	# 22880x (Eddie Bauer)	65
# 16900	# 22-627 AWF (Disney)	59		
# 300000	# 22-627 CGT (Eddie Bauer)	64		
# 30100	# 22-627 FRK (Eddie Bauer)	64		
# 30300				

For the model numbers "x" = more numbers or letters follow

Index number refers to "List No." for each listing

Dorel (continued)	# CC046xxx	62	Momentum 65	78	
# CC033xxx (Safety 1st)	143	# IC072x	66	Momentum 65 DLX	78
# CC046xxx	62	Deluxe 3-in-1	61, 62	Secure Kid 100	79
# CC046xxx (Eddie Bauer)	62	Enspira	63	Secure Kid 300	79
# CC046xxx (Safety 1st)	143	Infant Car Seat	64	Secure Kid 400	79
# CC050xxx (Safety 1st)	145	Prospect Adjustable Hiback Booster	65	Secure Kid LX	79
# CC051xxx (Safety 1st)	145	SureFit	66	Secure Kid LX Factory Sel	79
# IC072x (Eddie Bauer)	66			Snugli All-in-One	80
# IC123 FSM (Cosco)	50	Evenflo		Snugli Booster	81
# IC124 FSM (Safety 1st)	149	# 3021769Z	71	Snugli Embrace 35	82
Alpha Luxe (Alpha Elite)	4	# 3021854Z	71	SureRide DLX	83
Alpha Omega All-N-1 (Alpha Elite)	5	# 306xxx	68	Symphony	85
Alpha Omega All-N-1 (Cosco)	48	# 30711365	82	Symphony 65 DLX	84
Alpha Omega All-N-1 (Safety 1st)	142	# 308xxx	79, 81	Symphony 65 E3	85
Alpha Omega Elite (Alpha Elite)	5	# 30911118AD	67	Symphony DLX	84
Alpha Omega Elite (Cosco)	49	# 30911120D	67	Symphony LX	84
Alpha Omega Elite (Safety 1st)	142, 143	# 30911173AD	67	Titan 65	86
Avenue (Safety 1st)	144	# 3091967AD	67	Titan 65 Factory Select	86
Comfy Carry (Cosco)	50	# 31011048	76	Transitions	87
Complete Air LX	145	# 31011049	76		
Deluxe 3-in-1 (Eddie Bauer)	61, 62	# 31011057C	76	Fisher Price	
Enspira (Alpha Sport)	6	# 31011059	76	ALL MODELS	88
Enspira (Eddie Bauer)	63	# 3101198	76		
Enspira (Safety 1st)	146	# 3101980	76	Ford [Aftermarket]	
Infant Car Seat (Cosco)	51	# 310xxx	77	ALL MODELS	89
Infant Car Seat (Disney)	59	# 3151198	72		
Infant Car Seat (Eddie Bauer)	64	# 31511xxx	72	Ford [Integrated]	
Infant Car Seat (Safety 1st)	147	# 3151953	72	Windstar	166
Mico (Maxi-Cosi)	123, 124, 125	# 31521138	72		
OnBoard (Safety 1st)	148	# 329xxx	69, 74	General Motors [Aftermarket]	
OnBoard 35 (Safety 1st)	149	# 34411029	87	ALL MODELS	90
Priori (Maxi-Cosi)	126	# 34411686	87		
Prospect (Safety 1st)	150	# 34411695	87	Gerry	
Prospect Adjustable Hiback Booster (Eddie Bauer)	65	# 34411700	73	ALL MODELS	91
SureFit (Bertini)	20	# 34411741	73		
SureFit (Eddie Bauer)	66	# 345xxx	84	Graco	
Uptown (Safety 1st)	151	# 346xxx	80, 85	# 1794333	98
Vantage (Alpha Sport)	7	# 3604098	75	# 1794334	104
Vantage (Safety 1st)	152	# 371xxx	83, 86	# 1812930	95
Vantage Highback (Safety 1st)	152	# 385xxx	78	# 1813015	104
Vantage Point/Surveyor (Safety 1st)	152	# 390	70	# 1813040	98
		# 391	70	# 1813074	104
Downunder		# 46811xxx	72	# 1853478	104
ALL MODELS	60	# 48111xxx	72	# 1871689	104
		# 48411xxx	72	# 1872691	104
Eddie Bauer		# 52911307A	72	# 1877535	104
# 22-627 CGT	64	# 52921040	72	# 1908152	104
# 22-627 FRK	64	# 534	70	# 1910130	102
# 22-627 KGS	64	# 552	70	# 1923980	102
# 22-627 SNW	64	# 55311xxx	72	# 1924519	109
# 22-627 WPR	64	Big Kid Booster	67	# 1924520	109
# 22-655 BYTE	64	Chase DLX	69	# 1926538	102
# 22657x	66	Chase Factory Select	68	# 1926539	102
# 22740x	63	Chase LX	68, 69	# 1954477	100
# 22741x	63	Chase Select	68	# 1963973	117
# 22755x	61	Discovery	70, 71	# 1963974	117
# 22758x	61	Embrace 35	72	# 1963975	117
# 22759x	61	Evolve 3-in-1	73	# 1963976	117
# 22759x	61	Express Factory Select	74	# 1967886	117
# 22790x	61	First Choice	75	# 1975173	117
# 22790xxx	62	Maestro	76, 77	# 8487x	94
# 22799x	61	Maestro Factory Select	77	# 8686x	94
# 22880x	65			# 8689x	94

For the model numbers "x" = more numbers or letters follow

Index number refers to "List No." for each listing

Graco (continued)	# 22-372 TTH 124	Recaro	# 330.00.xxx 139
# 8D01x 94	# 22-515 123	# 330.01.xxx 139	# 331.00.xxx 135
# 8D02x 94	# 22-515 BLK 124	# 331.01.xxx 135	# 332.01.xxx 137
# 8D03x 94	# 22371x 125	# 332.01.xxx 137	# 333.01.xxx 136
# 8D04x 94	# 22372x 125	# 385.01.xxx 138	Como 135
# 8D05x 94	# 22476x 126	Performance RIDE 136	ProRIDE 137
# 8D10x 94	# 22486x 126	ProSport 138	Signo 139
Aprica A30 92	Mico 123, 124, 125		
Argos 70 93	Priori 126		
Argos 70 Elite 93			
CarGo 94	Mercedes-Benz USA		
Classic Ride 95	ALL MODELS 127		
Classic Ride 50 96			
ComfortSport 97, 98	Mia Moda		
Cozy Cline 99	# 5000 128	Regal Lager (Cybex)	
Extend2Fit 100	# 5001 128	# 0500200xx 52	
Head Wise 70 + SftySurnd 101	# 5050 128	# 0500760xx 52	
Milestone 102	# 5051 128	Solution X-fix 52	
My Ride 65 103, 104	# 5070 128		
My Ride 65 + SftySurnd 103	# 5071 128	Renolux (FBS)	
My Ride 70 105	# 5080 128	ALL MODELS 140	
My Size 70 106	# 5081 128		
Nautilus 3-in-1 107	Viva 128	Safeline Kids (see Triple Play also)	
Nautilus Elite 107	Viva Supreme 128	ALL MODELS 141	
Nautilus Plus 107			
Ready Ride 108, 109	Orbit Baby	Safety 1st (Dorel)	
SafeSeat - Step 2 110	# ORB822000 (Base) 129	# 22-057 CLN 147	
Size4Me70 111	Car Seat Base G2 129	# 22-057 DBY 147	
Smart Seat 112		# 22-057 HRT 147	
Smart Seat + SftySurnd 112		# 22-057 LPH 147	
Snug Ride 113	Peg Perego	# 22-085 DWA 147	
Snug Ride 30 114	# 32MD41KN41 131	# 22-085 LYN 147	
Snug Ride 35 115	# 35CR13BU13 131	# 22-095 RBK 147	
Snug Ride Classic Conct 30 114	# 35CR13PL46 131	# 22-322 HRR 147	
Snug Ride Classic Conct 35 115	# 35CR24BU24 131	# 22-322 KDL 147	
Snug Ride Click Conct 40 116	# 35TL49KN53 131	# 22-322 LXI 147	
SnugRide Classic Connect 113	# 35TL53KN46 131	# 22-322 MAI 147	
TurboBooster 117	# 61FG13ST53 131	# 22-322 OLY 147	
	# 61FG53ST49 131	# 22-322 PRS 147	
	# 61FG53ST64 131	# 22-322 PTK 147	
Harmony	# 61ST13IC53 131	# 22-325 COB 147	
Big Boost Deluxe 118	# 61ST34IC53 131	# 22-325 PAC 147	
	# 61ST48IC53 131	# 22-380 LGA 147	
International	# CS00MU1 131	# 22-380 MSA 147	
ALL MODELS 119	# IMCB00JA57RJ31JU31 130	# 22-627 WAV 147	
	Jacadi 130	# 22077x 148	
Kiddy USA	Primo Viaggio SIP 30/30 131	# 22078x 148	
# 51 100 WP 120		# 22152x 142	
World Plus 120		# 22159x 142	
	Playskool	# 22172x 142	
Kolcraft	ALL MODELS 132	# 22177x 142	
ALL MODELS 121		# 22178x 142	
	Plymouth [Integrated]	# 22185x 142	
Lin Lih/MCP	Grand Voyager 167, 168, 169, 170	# 22187xxx 143	
ALL MODELS 122	Voyager 167, 168, 169, 170	# 22188x 142	
		# 22195x 142	
Maxi-Cosi		# 22356x 148	
# 22-371 123	Pride Trimble/Virco	# 22412x 142	
# 22-371 HFL 124	ALL MODELS 133	# 22449 144	
# 22-371 JUC 124		# 22453x 146	
# 22-371 LMD 124	Questor	# 22456x 142	
# 22-371 ORE 124	ALL MODELS 134	# 22465x 142	
# 22-371 PNG 124		# 22465xxx 143	
# 22-372 123			

Safety 1st (Dorel) (continued)

22469x 142

22475x 151

22553x 152

22554x 152

22560x 152

22561x 152

22564x 152

22567x 152

22574x 152

22580x 150

CC033xxx 143

CC046xxx 143

CC050xxx 145

CC051xxx 145

IC124 FSM 149

22439x 144

Alpha Omega All-N-1 142

Alpha Omega Elite 142, 143

Avenue 144

Complete Air LX 145

Enspira 146

Infant Car Seat 147

OnBoard 148

OnBoard 35 149

Prospect 150

Uptown 151

Vantage 152

Vantage Highback 152

Vantage Point/Surveyor 152

Snugli

See Evenflo 80, 81, 82

Strolee

ALL MODELS 152, 153

Team-Tex

374199 154

Babyride 154

Triple Play (see Safeline Kids also)

4002 155

Sit'n'Stroll 155

TRW

ALL MODELS 156

XSCi

ALL MODELS 157

Recent additions to the list are denoted by >>

<i>List No.</i>	<i>Manufacturer Model Name</i>	<i>Model No. (X = more numbers or letters follow)</i>	<i>Customer Assistance Mfg Date</i>	<i>Problem Type and Consumer Action</i>
4moms <i>4moms - 888-614-6667 / www.4moms.com</i>				
2)	Infant Car Seat	1032	07/01/16- 10/31/16	The hooks that lock the carrier into the base can stick and fail to attach the carrier to the car seat base. Contact mfg. for free replacement seat.
2) Alcot (Childcare) <i>REFER TO OLDER MODELS LIST - ALL MODELS ARE OLDER THAN 10 YEARS - REPLACEMENT PROGRAM DISCONTINUED - DESTROY & REPLACE</i>				
3) All Our Kids <i>REFER TO OLDER MODELS LIST - ALL MODELS ARE OLDER THAN 10 YEARS - REPLACEMENT PROGRAM DISCONTINUED - DESTROY & REPLACE</i>				
Alpha Elite (Dorel) <i>Dorel Juvenile Group: 866-623-3139 / 800-219-0509 / 866-611-3022 / 812-372-0141 www.djgusa.com</i>				
4)	Alpha Luxe	22462x	05/01/08- 04/30/09	Harness locking and release button does not always return to its locked position and could result in a loose harness, increasing the risk of being injured a crash. Contact mfg. for repair kit.
5)	Alpha Omega All-N-1 Alpha Omega Elite	22459x 22148x, 22149x, 22158x	05/01/08- 04/30/09	Harness locking and release button does not always return to its locked position and could result in a loose harness, increasing the risk of being injured a crash. Contact mfg. for repair kit.
Alpha Sport (Dorel) <i>Dorel Juvenile Group: 866-623-3139 / 800-219-0509 / 866-611-3022 / 812-372-0141 www.djgusa.com</i>				
6)	Enspira	22452x, 22458x	05/01/08- 04/30/09	Harness locking and release button does not always return to its locked position and could result in a loose harness, increasing the risk of being injured a crash. Contact mfg. for repair kit.
7)	Vantage	22546x, 22547x	05/01/08- 04/30/09	Harness locking and release button does not always return to its locked position and could result in a loose harness, increasing the risk of being injured a crash. Contact mfg. for repair kit.
8) American Motors <i>REFER TO OLDER MODELS LIST - ALL MODELS ARE OLDER THAN 10 YEARS - REPLACEMENT PROGRAM DISCONTINUED - DESTROY & REPLACE</i>				
Baby Jogger <i>800-241-1848 - www.babyjogger.com</i>				
9)	City GO Infant Car Seat	BJ64510, BJ64529	11/03/14- 04/30/15	The labels, instruction manual, and registration card of affected models do not comply with FMVSS 213 requirements for content and formatting. Contact mfg. for free replacement car seat.
10)	City GO Infant Car Seat Base	BJ80400, BJ61500	11/03/14- 04/30/15	The labels, instruction manual, and registration card of affected models do not comply with FMVSS 213 requirements for content and formatting. Contact mfg. for free replacement car seat.
11)	City Mini Infant Car Seat/ Stroller System	BJ72510	11/03/14- 04/30/15	The labels, instruction manual, and registration card of affected models do not comply with FMVSS 213 requirements for content and formatting. Contact mfg. for free replacement car seat.
12)	Vue Lite Infant Car Seat/ Stroller System	BJ70411, BJ70424, BJ70431	11/03/14- 04/30/15	The labels, instruction manual, and registration card of affected models do not comply with FMVSS 213 requirements for content and formatting. Contact mfg. for free replacement car seat.
Baby Trend <i>800-328-7363 - www.babytrend.com</i>				
13)	Hybrid 3-in-1 LX	FB48417, FB58181	07/14/16 - 07/23/16	The center adjuster may detach in a crash when used in the harnessed mode with a child weighing more than 40lbs. Contact mfg. for free replacement seat.

Recent additions to the list are denoted by >>

List No.	Manufacturer Model Name	Model No. (X = more numbers or letters follow)	Customer Assistance	
			Mfg Date	Problem Type and Consumer Action
Baby Trend (continued)				
14)	Rigid Latch-Loc	6439, 6448, 6481	05/14/07-04/01/08	Incorrect steel used on the latch connector can crack and allow the child seat base to detach from the vehicle's latch anchors during a severe crash. Contact mfg. for a replacement base. Install with vehicle seat belt until base is replaced.
15)	Rigid Latch-Loc Base	6400	05/14/07-04/01/08	Incorrect steel used on the latch connector can crack and allow the child seat base to detach from the vehicle's latch anchors during a severe crash. Contact mfg. for a replacement base. Install with vehicle seat belt until base is replaced.
16)	TrendZ Fastback 3-in-1	FB60070, FB60408	10/01/11-07/31/13	The harness buckle may become stuck in a latched condition so that it cannot be opened by pushing the release button, thus making it difficult to remove the child from the restraint in an emergency. Contact mfg. for replacement buckle.
17)	Babyhood Industries		REFER TO OLDER MODELS LIST - ALL MODELS ARE OLDER THAN 10 YEARS - REPLACEMENT PROGRAM DISCONTINUED - DESTROY & REPLACE	
18)	Basic Comfort		REFER TO OLDER MODELS LIST - ALL MODELS ARE OLDER THAN 10 YEARS - REPLACEMENT PROGRAM DISCONTINUED - DESTROY & REPLACE	
19)	Beatrix Potter (Dorel)		REFER TO OLDER MODELS LIST	
Bertini (Dorel)		Dorel Juvenile Group: 866-623-3139 / 800-219-0509 / 866-611-3022 / 812-372-0141 www.djgusa.com		
20)	SureFit (Travel system)	22346x	05/01/08-04/30/09	Harness locking and release button does not always return to its locked position and could result in a loose harness, increasing the risk of being injured a crash. Contact mfg. for repair kit.
21)	Bolform Corp.		REFER TO OLDER MODELS LIST - ALL MODELS ARE OLDER THAN 10 YEARS - REPLACEMENT PROGRAM DISCONTINUED - DESTROY & REPLACE	
Britax		888-427-4829 / 704-409-1699 - Britax.Recall@britax.com / www.britaxusa.com		
22)	Advocate 70-G3	E9LG81A, E9LG83x, E9LL21A, E9LL23P, E9LL23Y	06/01/12-08/31/12	Children who bite or chew on the shoulder strap HUGS pads could bite off small pieces, presenting a choking hazard. Contact mfg. for replacement HUGS pads and instructions.
23)	Advocate ClickTight	E1A025Q, E9LT95N, E9LT95Q, E9LT95Z	08/01/14-07/29/15	The harness adjuster button (red) on affected models may remain down in the "release" position after the harness is tightened. This will enable the shoulder harnesses to loosen from a child's movements while secured in the seat. Contact mfg. for repair kit.
24)	B-Safe 35 B-Safe 35 XE	E9LU65M, E9LU65P, E9LU63F, E9LU66R, EXLU65M, E9LS63F	10/01/14-07/01/15	Cracks may develop in the carry handle, potentially resulting in injury if the cracks cause the handle to break. Recall does not affect the safety performance of the seat when used in a motor vehicle. Customers may continue using the car seat when secured in a vehicle or stroller but should not lift or carry the seat by the carry handle until the remedy kit has been installed. Contact mfg. for repair kit. Visit www.bsaf35recall.com for more information.
25)	B-Safe 35 Travel System B-Agile Travel System	S914900, S915400, S915200, S01635200, S921900	10/01/14-07/01/15	Cracks may develop in the carry handle, potentially resulting in injury if the cracks cause the handle to break. Recall does not affect the safety performance of the seat when used in a motor vehicle. Customers may continue using the car seat when secured in a vehicle or stroller but should not lift or carry the seat by the carry handle until the remedy kit has been installed. Contact mfg. for repair kit. Visit www.bsaf35recall.com for more information.

Recent additions to the list are denoted by >>

List No.	Manufacturer Model Name	Model No. (X = more numbers or letters follow)	Customer Assistance	
			Mfg Date	Problem Type and Consumer Action
<i>Britax (continued)</i>				
26)	B-Safe 35 B-Safe 35 Travel Systems	E1A183F, E1A185x, E1A186R, E1A203F, E1A205x, E1A206x, E1A207E, E9LU65V, E9LU66x, E9LU67x, EXA185M, S02063xxx, S03803xxx, S04144xxx, S04145000, S04402800, S04884xxx, S04975600, S04978900, S05260200, S06020xxx, S06147100, S921800	11/01/15- 05/31/17	The center tab on the chest clips of the affected seats can break, presenting a choking hazard. Contact mfg. for repair kit. Affected seats can be safely used as long as consumers remove the chest clip or monitor it for signs of breakage.
27)	B-Safe 35 Elite B-Safe 35 Elite XE	E9LS55T, E9LS56P, E9LS55U, E9LS66C, E9LS65U	10/01/14- 07/01/15	Cracks may develop in the carry handle, potentially resulting in injury if the cracks cause the handle to break. Recall does not affect the safety performance of the seat when used in a motor vehicle. Customers may continue using the car seat when secured in a vehicle or stroller but should not lift or carry the seat by the carry handle until the remedy kit has been installed. Contact mfg. for repair kit. Visit www.bsaf35recall.com for more information.
28)	B-Safe 35 Elite B-Safe 35 Elite Travel Systems	E1A215x, E1A216P, E1A221Q, E1A225x, E1A226L, E9LS5xx, EXA216L, S01298600, S02063xxx, S02064000, S04281xxx, S04628500, S06018800, S06020xxx, S06051300, S923700	11/01/15- 05/31/17	The center tab on the chest clips of the affected seats can break, presenting a choking hazard. Contact mfg. for repair kit. Affected seats can be safely used as long as consumers remove the chest clip or monitor it for signs of breakage.
29)	B-Safe BOB 35	E9LT34x, E9LT35X, EXLT34A	11/01/15- 05/31/17	The center tab on the chest clips of the affected seats can break, presenting a choking hazard. Contact mfg. for repair kit. Affected seats can be safely used as long as consumers remove the chest clip or monitor it for signs of breakage.
30)	Boulevard 70- G3	E9LJ91x, E9LJ92E, E9LJ93P, E9LJ93S, E9LK91A	06/01/12- 08/31/12	Children who bite or chew on the shoulder strap HUGS pads could bite off small pieces, presenting a choking hazard. Contact mfg. for replacement HUGS pads and instructions.
31)	Boulevard ClickTight	E1A015Q, E1A016A, E1A016H, E1A135Q, E9LT85Q, E9LT85S, E9LT86A, E9LT86F, E9LT86G, E9LT86H	08/01/14- 07/29/15	The harness adjuster button (red) on affected models may remain down in the "release" position after the harness is tightened. This will enable the shoulder harnesses to loosen from a child's movements while secured in the seat. Contact mfg. for repair kit.
32)	Chaperone	E9L69N9, E9L69P2, E9L69P3, E9L69P5	04/01/09- 05/31/10	The chest clip may break when it is engaged as the infant is secured into the infant car seat creating a safety hazard. Contact mfg. for repair kit.
33)	Chaperone	E9L692J, E9L692K, E9L692L, E9L692M	09/01/10- 04/30/11	Voluntary Recall - The harness adjuster may detach from the shell due to an improperly installed rivet. Contact mfg. for repair kit.
34)	Companion	E9L14, E9L20, E9L80	All	Consumer Advisory - NOT A RECALL: Britax advises that the user should adjust the carrier handle so that it is completely down and behind the carrier after installation in the vehicle with or without the base assembly. Contact mfg. for additional info.
35)	Frontier	E9L54E7, E9L54H6, E9L54H7, E9L54M6	04/01/08- 09/14/08	Harness straps may become detached from the metal yoke on the back of the seat if they are loosened one strap at a time with excessive force. Contact mfg. for repair kit.
36)	Frontier	E9L5490	04/01/08- 09/17/08	Harness straps may become detached from the metal yoke on the back of the seat if they are loosened one strap at a time with excessive force. Contact mfg. for repair kit.

Recent additions to the list are denoted by >>

<i>List No.</i>	<i>Manufacturer Model Name</i>	<i>Model No. (X = more numbers or letters follow)</i>	<i>Customer Assistance Mfg Date</i>	<i>Problem Type and Consumer Action</i>
-----------------	--------------------------------	---	-------------------------------------	---

Britax (continued)

- | | | | | |
|-----|---------------------|--|-------------------|---|
| 37) | Marathon ClickTight | E1A005R, E1A006B, E1A116L, E9LT71Q, E9LT75R, E9LT76B, E9LT76L, E9LT76N, E9LT76P, EXA116L | 08/01/14-07/29/15 | The harness adjuster button (red) on affected models may remain down in the "release" position after the harness is tightened. This will enable the shoulder harnesses to loosen from a child's movements while secured in the seat. Contact mfg. for repair kit. |
| 38) | Pavilion 70-G3 | E9LK31x, E9LK32x, E9LK33Q, E9LL11x, E9LL12x | 06/01/12-08/31/12 | Children who bite or chew on the shoulder strap HUGS pads could bite off small pieces, presenting a choking hazard. Contact mfg. for replacement HUGS pads and instructions. |

39) ***Century Products***

REFER TO OLDER MODELS LIST - ALL MODELS ARE OLDER THAN 10 YEARS - REPLACEMENT PROGRAM DISCONTINUED - DESTROY & REPLACE

Chicco

800-807-8817 / 877-424-4226 - www.chiccousa.com

- | | | | | |
|-----|--|-----|-------------------|--|
| 40) | Key Fit Key Fit 30 Cortina Travel Systems BASES ONLY | All | 02/26/08-03/17/08 | Recall applies only to <u>bases</u> manufactured between 2/26/2008 and 3/17/2008. When installed with LATCH, the webbing used to tighten the base can slip through the adjustment lock. Bases with serial number is between 08 02 26 (February 26, 2008) and 08 03 17 (March 17, 2008) are covered by this recall. Contact mfg. for replacement base. Install the base with the vehicle seat belts until replacement base is obtained. |
|-----|--|-----|-------------------|--|

41) ***Chrysler***

REFER TO OLDER MODELS LIST - ALL MODELS ARE OLDER THAN 10 YEARS - REPLACEMENT PROGRAM DISCONTINUED - DESTROY & REPLACE

42) ***Collier-Keyworth***

REFER TO OLDER MODELS LIST - ALL MODELS ARE OLDER THAN 10 YEARS - REPLACEMENT PROGRAM DISCONTINUED - DESTROY & REPLACE

Combi USA

800-992-6624 / 803-548-6633 - www.combi-intl.com

- | | | | | |
|-----|-----------|-------|-------------------|---|
| 43) | Coccoro | 8220 | 01/06/09-12/05/12 | Harness webbing fails to meet FMVSS 213 minimum breaking strength requirements. Contact mfg. for free harness replacement kit and instructions. The seats can continue to be used until the kits are made available and repairs are made. |
| 44) | Coccoro | 8220x | 01/01/09-06/29/16 | Too much force can be placed on the child when the car seat is installed forward-facing with only the vehicle's lap belt. All other installation methods are not affected. Contact mfg. for a cover to add to the bottom of the seat. |
| 45) | Zeus 360 | 8836 | 02/25/09-05/24/12 | Harness webbing fails to meet FMVSS 213 minimum breaking strength requirements. Contact mfg. for free harness replacement kit and instructions. The seats can continue to be used until the kits are made available and repairs are made. |
| 46) | Zeus Turn | 8815 | 07/15/07-03/25/09 | Harness webbing fails to meet FMVSS 213 minimum breaking strength requirements. Contact mfg. for free harness replacement kit and instructions. The seats can continue to be used until the kits are made available and repairs are made. |

47) ***Compass Baby***

REFER TO OLDER MODELS LIST - ALL MODELS ARE OLDER THAN 10 YEARS - REPLACEMENT PROGRAM DISCONTINUED - DESTROY & REPLACE

Cosco (Dorel)

Dorel Juvenile Group: 866-623-3139 / 800-219-0509 / 866-611-3022 / 812-372-0141 www.djgusa.com

- | | | | | |
|-----|---------------------|--------|-------------------|--|
| 48) | Alpha Omega All-N-1 | 22150x | 05/01/08-04/30/09 | Harness locking and release button does not always return to its locked position and could result in a loose harness, increasing the risk of being injured a crash. Contact mfg. for repair kit. |
|-----|---------------------|--------|-------------------|--|

Recent additions to the list are denoted by >>

<i>List No.</i>	<i>Manufacturer Model Name</i>	<i>Model No. (X = more numbers or letters follow)</i>	<i>Customer Assistance Mfg Date</i>	<i>Problem Type and Consumer Action</i>
<i>Cosco (Dorel) (continued)</i>				
49)	Alpha Omega Elite	22154x, 22155x, 22158x	05/01/08-04/30/09	Harness locking and release button does not always return to its locked position and could result in a loose harness, increasing the risk of being injured a crash. Contact mfg. for repair kit.
50)	Comfy Carry	IC123 FSM	05/01/11-04/25/12	Some models were sold without a base and therefore did not provide lower LATCH attachments as required by FMVSS 213. Carriers can safely be installed without the base using the seat belt. Contact mfg. to obtain a base.
51)	Infant Car Seat	22-300 CSF, 22-300 FZN, 22-300 JJV, 22-300 OSF, 22-300 THD, 22-300 TWD	01/06/08-04/06/09	The child restraint carry handle can loosen and come off posing a fall hazard to infants. The safety as a child restraint is not affected. Do not use handle until repaired. Contact mfg. for free repair kit. NOTE: Only those models sold as a part of the Spirit and Sprint Travel Systems are affected.
<hr/>				
<i>Cyber</i>			<i>Distributed by Regal Lager: 800-593-5522 - www.regallager.com</i>	
52)	Solution X-fix	0500200xx, 0500760xx	02/01/10-02/28/10	Booster seats have an incorrect warning statement about restraining unoccupied seats. Contact mfg. for replacement sticker and owner's manual.
<hr/>				
<i>Diono</i>			<i>855-463-4666 - www.us.diono.com</i>	
53)	Olympia	30100	04/12/14-03/31/15	The seat may not adequately protect a child in a crash when used in harnessed mode and installed forward-facing.
54)	Pacifica	30400, 300000	04/12/14-05/13/16	Children who weigh more than 65 lbs: Seats installed forward-facing (with any installation method) require the use of a top tether for children weighing more than 65 lbs in harnessed mode. If no top tether anchor is available, use the seat in booster mode.
55)	Radian R100	16600, 16000	01/03/14-09/05/17	
56)	Radian R120	16800, 16000	01/03/14-08/30/17	Children who weigh 65 lbs or less: Seats installed forward-facing using only the lap belt require the use of the top tether for children who weigh 65 lbs or less in harnessed mode. If no top tether anchor is available, contact mfg. for a free repair kit.
57)	Radian RXT	16900, 16000	11/25/13-09/05/17	
58)	Rainier	30300, 300000	04/12/14-09/05/17	
<hr/>				
<i>Disney (Dorel)</i>			<i>Dorel Juvenile Group: 866-623-3139 / 800-219-0509 / 866-611-3022 / 812-372-0141 www.djgusa.com</i>	
59)	Infant Car Seat	22-305 NAB, 22-305 PPH, 22-355 LBF, 22-355 PWK, 22-627 AWF	01/06/08-04/06/09	The child restraint carry handle can loosen and come off posing a fall hazard to infants. The safety as a child restraint is not affected. Do not use handle until repaired. Contact mfg. for free repair kit. NOTE: Only those models sold as a part of the Propack Travel System are affected.
<hr/>				
60)	<i>Downunder</i>			<i>REFER TO OLDER MODELS LIST - ALL MODELS ARE OLDER THAN 10 YEARS - REPLACEMENT PROGRAM DISCONTINUED - DESTROY & REPLACE</i>
<hr/>				
<i>Eddie Bauer (Dorel)</i>			<i>Dorel Juvenile Group: 866-623-3139 / 800-219-0509 / 866-611-3022 / 812-372-0141 www.djgusa.com</i>	
61)	Deluxe 3-in-1	22755x, 22758x, 22759x, 22790x, 22799x	05/01/08-04/30/09	Harness locking and release button does not always return to its locked position and could result in a loose harness, increasing the risk of being injured a crash. Contact mfg. for repair kit.
62)	Deluxe 3-in-1	22790xxx, CC046xxx	07/20/10-05/18/11	The rear-facing belt path installation arrows are incorrect, possibly appearing to point toward the forward-facing vehicle belt path location. Contact mfg. for replacement label kit.

Recent additions to the list are denoted by >>

List No.	Manufacturer	Model No. (X = more numbers or letters follow)	Customer Assistance	
	Model Name		Mfg Date	Problem Type and Consumer Action

Eddie Bauer (Dorel) (continued)

63)	Enspira	22740x, 22741x	05/01/08-04/30/09	Harness locking and release button does not always return to its locked position and could result in a loose harness, increasing the risk of being injured a crash. Contact mfg. for repair kit.
64)	Infant Car Seat	22-627 CGT, 22-627 FRK, 22-627 KGS, 22-627 SNW, 22-627 WPR, 22-655 BYTE	01/06/08-04/06/09	The child restraint carry handle can loosen and come off posing a fall hazard to infants. The safety as a child restraint is not affected. Do not use handle until repaired. Contact mfg. for free repair kit. NOTE: Only those models sold as a part of the Adventurer and Endeavor Travel Systems are affected.
65)	Prospect Adjustable Hibox Booster	22880x	05/01/08-04/30/09	Harness locking and release button does not always return to its locked position and could result in a loose harness, increasing the risk of being injured a crash. Contact mfg. for repair kit.
66)	SureFit	22657x, IC072x	05/01/08-04/30/09	Harness locking and release button does not always return to its locked position and could result in a loose harness, increasing the risk of being injured a crash. Contact mfg. for repair kit.

Evenflo**800-525-2472 / 800-233-5921 / 800-490-7497 - www.evenflo.com**

67)	Big Kid Booster	30911173AD, 3091967AD, 30911118AD, 30911120D	ALL	The affected seats - originally intended for display models - were packaged without the instruction manual or the required registration card. Otherwise, including crashworthiness, they were fully compliant with FMVSS 213. However, some seats were inadvertently shipped to institutional customers to be given to families. None of the affected units were sold at retail stores. Affected seats end with the letter "D" and have a label stating: "DISPLAY ONLY – NOT INTENDED FOR SALE," located on the back of the booster seat headrest. Contact mfg. for remedy kit.
68)	Chase Factory Select Chase LX Chase Select	306xxx	06/12/12-10/03/13	The harness buckle may become resistant to unlatching over time so that it cannot be opened by pushing the release button, thus making it difficult to remove the child from the restraint in an emergency. NOTE: Date ranges for specific model numbers of affected models may differ from date range listed here. Contact mfg. for specific dates and replacement buckle if needed.
69)	Chase DLX Chase LX	329xxx	08/23/11-03/03/14	The harness buckle may become resistant to unlatching over time so that it cannot be opened by pushing the release button, thus making it difficult to remove the child from the restraint in an emergency. NOTE: Date ranges for specific model numbers of affected models may differ from date range listed here. Contact mfg. for specific dates and replacement buckle if needed.
70)	Discovery	390, 391, 534, 552	Pre-02/01/08	Voluntary Safety Recall - Testing showed that the car seat could potentially become separated from its base in high impact side collisions. Contact mfg. for free supplemental dual-hook fastener for enhanced safety performance.
71)	Discovery	3021769Z, 3021854Z	02/04/08	A small number of Discovery car seats may have shipped without complete assembly of the red release handle located on the back of the seat making it possible for the seat to separate from its base. Contact mfg. for replacement seat and base. Affected models can be used without the base while waiting for replacement.
72)	Embrace 35	3151198, 3151953, 31511xxx, 31521138, 46811xxx, 48111xxx, 48411xxx, 52911307A, 55311xxx, 52921040	12/01/11-05/31/13*	The harness buckle may become resistant to unlatching over time so that it cannot be opened by pushing the release button, thus making it difficult to remove the child from the restraint in an emergency. *NOTE: Not all Embrace 35 models in the 12/01/11-05/31/13 date range are impacted. Contact mfg. for specific dates and replacement buckle if needed.
73)	Evolve 3-in-1	34411700, 34411741	02/26/15-02/09/16	The central front harness adjuster button may be within the child's reach which could allow the child to loosen the harness and be at an increased risk of injury in the event of a crash. Contact mfg. for a free repair kit.

Recent additions to the list are denoted by >>

List No.	Manufacturer Model Name	Model No. (X = more numbers or letters follow)	Customer Assistance	
			Mfg Date	Problem Type and Consumer Action
<i>Evenflo (continued)</i>				
74)	Express Factory Select	329xxx	08/23/11- 03/03/14	The harness buckle may become resistant to unlatching over time so that it cannot be opened by pushing the release button, thus making it difficult to remove the child from the restraint in an emergency. NOTE: Date ranges for specific model numbers of affected models may differ from date range listed here. Contact mfg. for specific dates and replacement buckle if needed.
75)	First Choice	3604098	01/16/09- 09/29/09	A label containing certain contact and certification information was inadvertently left off these car seats. Contact mfg. for a set of replacement labels.
76)	Maestro	3101198, 3101980, 31011048, 31011049, 31011059, 31011057C*	11/24/09- 04/09/10*	A crack may form at the front of the seat adjacent to the harness adjuster in a crash. Evenflo recommends that the seat not be used with children < 40 pounds until repaired. Use as a booster for children > 40 pounds is OK. Call mfg. for free reinforcement kit. *Canadian seat 31011057C mfg dates: 12/17/09-04/26/10
77)	Maestro Maestro Factory Select	310xxx	08/22/11- 10/17/13	The harness buckle may become resistant to unlatching over time so that it cannot be opened by pushing the release button, thus making it difficult to remove the child from the restraint in an emergency. NOTE: Date ranges for specific model numbers of affected models may differ from date range listed here. Contact mfg. for specific dates and replacement buckle if needed.
78)	Momentum 65 Momentum 65 DLX	385xxx	03/04/13- 08/26/13	The harness buckle may become resistant to unlatching over time so that it cannot be opened by pushing the release button, thus making it difficult to remove the child from the restraint in an emergency. NOTE: Date ranges for specific model numbers of affected models may differ from date range listed here. Contact mfg. for specific dates and replacement buckle if needed.
79)	Secure Kid 100 Secure Kid 300 Secure Kid 400 Secure Kid LX Secure Kid LX Factory Select	308xxx	12/13/11- 03/03/14	The harness buckle may become resistant to unlatching over time so that it cannot be opened by pushing the release button, thus making it difficult to remove the child from the restraint in an emergency. NOTE: Date ranges for specific model numbers of affected models may differ from date range listed here. Contact mfg. for specific dates and replacement buckle if needed.
80)	Snugli All-in- One	346xxx	10/02/12- 08/26/13	The harness buckle may become resistant to unlatching over time so that it cannot be opened by pushing the release button, thus making it difficult to remove the child from the restraint in an emergency. NOTE: Date ranges for specific model numbers of affected models may differ from date range listed here. Contact mfg. for specific dates and replacement buckle if needed.
81)	Snugli Booster	308xxx	12/13/11- 03/03/14	The harness buckle may become resistant to unlatching over time so that it cannot be opened by pushing the release button, thus making it difficult to remove the child from the restraint in an emergency. NOTE: Date ranges for specific model numbers of affected models may differ from date range listed here. Contact mfg. for specific dates and replacement buckle if needed.
82)	Snugli Embrace 35	30711365	06/01/12- 11/30/12	The harness buckle may become resistant to unlatching over time so that it cannot be opened by pushing the release button, thus making it difficult to remove the child from the restraint in an emergency. Contact mfg. for a free repair kit.
83)	SureRide DLX	371xxx	06/20/12- 10/17/13	The harness buckle may become resistant to unlatching over time so that it cannot be opened by pushing the release button, thus making it difficult to remove the child from the restraint in an emergency. NOTE: Date ranges for specific model numbers of affected models may differ from date range listed here. Contact mfg. for specific dates and replacement buckle if needed.
84)	Symphony 65 DLX Symphony DLX Symphony LX	345xxx	10/02/12- 08/26/13	The harness buckle may become resistant to unlatching over time so that it cannot be opened by pushing the release button, thus making it difficult to remove the child from the restraint in an emergency. NOTE: Date ranges for specific model numbers of affected models may differ from date range listed here. Contact mfg. for specific dates and replacement buckle if needed.

Recent additions to the list are denoted by >>

List No.	Manufacturer Model Name	Model No. (X = more numbers or letters follow)	Customer Assistance	
			Mfg Date	Problem Type and Consumer Action
<i>Evenflo (continued)</i>				
85)	Symphony Symphony 65 E3	346xxx	10/02/12- 08/26/13	The harness buckle may become resistant to unlatching over time so that it cannot be opened by pushing the release button, thus making it difficult to remove the child from the restraint in an emergency. NOTE: Date ranges for specific model numbers of affected models may differ from date range listed here. Contact mfg. for specific dates and replacement buckle if needed.
86)	Titan 65 Titan 65 Factory Select	371xxx	06/20/12- 10/17/13	The harness buckle may become resistant to unlatching over time so that it cannot be opened by pushing the release button, thus making it difficult to remove the child from the restraint in an emergency. NOTE: Date ranges for specific model numbers of affected models may differ from date range listed here. Contact mfg. for specific dates and replacement buckle if needed.
87)	Transitions 3-in-1	34411029, 34411686, 34411695	12/18/14- 01/29/16	The central front harness adjuster button may be within the child's reach which could allow the child to loosen the harness and be at an increased risk of injury in the event of a crash. Contact mfg. for a free repair kit.
88)	Fisher Price		<i>REFER TO OLDER MODELS LIST - ALL MODELS WITH RECALLS ARE OLDER THAN 10 YEARS</i>	
89)	Ford		<i>REFER TO OLDER MODELS LIST - ALL MODELS ARE OLDER THAN 10 YEARS - REPLACEMENT PROGRAM DISCONTINUED - DESTROY & REPLACE</i>	
90)	General Motors		<i>REFER TO OLDER MODELS LIST - ALL MODELS ARE OLDER THAN 10 YEARS - REPLACEMENT PROGRAM DISCONTINUED - DESTROY & REPLACE</i>	
91)	Gerry		<i>REFER TO OLDER MODELS LIST - ALL MODELS WITH RECALLS ARE OLDER THAN 10 YEARS</i>	
Graco			800-345-4109 - www.gracobaby.com	
92)	Aprica A30	All Models	07/01/11- 04/30/12	The harness buckle may become stuck so that it cannot be opened by pushing the release button, thus making it difficult to remove the child from the restraint in an emergency. Contact mfg. for replacement buckle.
93)	Argos 70 / Argos 70 Elite	All Models	05/01/11- 07/31/13	The harness buckle may become stuck so that it cannot be opened by pushing the release button, thus making it difficult to remove the child from the restraint in an emergency. Contact mfg. for replacement buckle.
94)	CarGo	8487x, 8686x, 8689x, 8D01x, 8D02x, 8D03x, 8D04x, 8D05x, 8D10x	01/09/07- 03/03/08	An incorrect NHTSA Hotline telephone number appears on an information label affixed to the back of the seat. Contact mfg. for a replacement label.
95)	Classic Ride	1812930	03/01/14- 02/28/15	The labels of affected models did not include information about the location and use of the instruction manual as required by FMVSS 213. Recall does not affect the safety performance of the seat. Contact mfg. for replacement labels.
96)	Classic Ride 50	All Models	10/01/11- 09/30/13	The harness buckle may become stuck so that it cannot be opened by pushing the release button, thus making it difficult to remove the child from the restraint in an emergency. Contact mfg. for replacement buckle.
97)	ComfortSport	All Models	10/01/10- 09/30/13	The harness buckle may become stuck so that it cannot be opened by pushing the release button, thus making it difficult to remove the child from the restraint in an emergency. Contact mfg. for replacement buckle.
98)	ComfortSport	1794333, 1813040	03/01/14- 02/28/15	The labels of affected models did not include information about the location and use of the instruction manual as required by FMVSS 213. Recall does not affect the safety performance of the seat. Contact mfg. for replacement labels.

Recent additions to the list are denoted by >>

List No.	Manufacturer Model Name	Model No. (X = more numbers or letters follow)	Customer Assistance	
			Mfg Date	Problem Type and Consumer Action
<i>Graco (continued)</i>				
99)	Cozy Cline	All Models	01/01/06-04/30/10	The harness buckle may become stuck so that it cannot be opened by pushing the release button, thus making it difficult to remove the child from the restraint in an emergency. Contact mfg. for replacement buckle.
100)	Extend2Fit	1954477	11/27/15-01/20/16	The recline labels on affected models do not meet FMVSS 213. Labels on the side of affected car seats, including the recline label, may not be in the same language (i.e. all English on one side of the car seat and all Spanish on the other side). Recall does not affect the safety performance of the seat. Contact mfg for replacement labels.
101)	Head Wise 70 with Safety Surround	All Models	01/01/12-07/31/13 & 08/03/13	The harness buckle may become stuck so that it cannot be opened by pushing the release button, thus making it difficult to remove the child from the restraint in an emergency. Contact mfg. for replacement buckle.
102)	Milestone	1910130, 1923980, 1926538, 1926539	07/09/15-10/09/15	The labels on affected seats do not include specific phrasing about how to install the car seat, as required by FMVSS 213. Recall does not affect the safety performance of the seat. Contact mfg. for free replacement labels.
103)	My Ride 65 / My Ride 65 with Safety Surround	All Models	04/01/09-07/31/13 & 09/30/13	The harness buckle may become stuck so that it cannot be opened by pushing the release button, thus making it difficult to remove the child from the restraint in an emergency. Contact mfg. for replacement buckle.
104)	My Ride 65	1794334, 1813015, 1813074, 1853478, 1871689, 1872691, 1877535, 1908152	05/16/14 - 08/01/14	The harness webbing used on certain My Ride 65 convertible car seats do not meet FMVSS 213 requirements for breaking strength. Harnesses with the webbing tag code "2014/06" are the only models affected by this recall. Contact mfg. for replacement harness. Consumers may continue to use the My Ride 65 convertible car seats while waiting for a replacement kit.
105)	My Ride 70	All Models	05/01/12-07/31/13	The harness buckle may become stuck so that it cannot be opened by pushing the release button, thus making it difficult to remove the child from the restraint in an emergency. Contact mfg. for replacement buckle.
106)	My Size 70	All Models	01/01/12-07/31/13 & 08/03/13	The harness buckle may become stuck so that it cannot be opened by pushing the release button, thus making it difficult to remove the child from the restraint in an emergency. Contact mfg. for replacement buckle.
107)	Nautilus 3-in-1 / Nautilus Elite / Nautilus Plus	All Models	10/01/07-07/31/13 & 08/19/13	The harness buckle may become stuck so that it cannot be opened by pushing the release button, thus making it difficult to remove the child from the restraint in an emergency. Contact mfg. for replacement buckle.
108)	Ready Ride	All Models	10/01/10-09/30/13	The harness buckle may become stuck so that it cannot be opened by pushing the release button, thus making it difficult to remove the child from the restraint in an emergency. Contact mfg. for replacement buckle.
109)	Ready Ride	1924519, 1924520	03/01/14-02/28/15	The labels of affected models did not include information about the location and use of the instruction manual as required by FMVSS 213. Recall does not affect the safety performance of the seat. Contact mfg. for replacement labels.
110)	SafeSeat - Step 2	All Models	01/01/06-04/30/10	The harness buckle may become stuck so that it cannot be opened by pushing the release button, thus making it difficult to remove the child from the restraint in an emergency. Contact mfg. for replacement buckle.
111)	Size4Me70	All Models	01/01/12-07/31/13 & 08/03/13	The harness buckle may become stuck so that it cannot be opened by pushing the release button, thus making it difficult to remove the child from the restraint in an emergency. Contact mfg. for replacement buckle.

Recent additions to the list are denoted by >>

List No.	Manufacturer	Model No. (X = more numbers or letters follow)	Customer Assistance	
	Model Name		Mfg Date	Problem Type and Consumer Action

Graco (continued)

112)	Smart Seat / Smart Seat with Safety Surround	All Models	12/01/10- 09/30/13 & 10/09/13; 12/25/13; 1/10/14	The harness buckle may become stuck so that it cannot be opened by pushing the release button, thus making it difficult to remove the child from the restraint in an emergency. Contact mfg. for replacement buckle.
113)	SnugRide, SnugRide Classic Connect	All Models	03/01/11- 05/31/13	The harness buckle may become stuck so that it cannot be opened by pushing the release button, thus making it difficult to remove the child from the restraint in an emergency. Contact mfg. for replacement buckle.
114)	SnugRide 30 SnugRide Classic Connect 30	All Models	07/01/10- 01/31/13	The harness buckle may become stuck so that it cannot be opened by pushing the release button, thus making it difficult to remove the child from the restraint in an emergency. Contact mfg. for replacement buckle.
115)	SnugRide 35 SnugRide Classic Connect 35	All Models	05/01/11- 01/31/13	The harness buckle may become stuck so that it cannot be opened by pushing the release button, thus making it difficult to remove the child from the restraint in an emergency. Contact mfg. for replacement buckle.
116)	SnugRide Click Connect 40	All Models	06/01/12- 12/31/12	The harness buckle may become stuck so that it cannot be opened by pushing the release button, thus making it difficult to remove the child from the restraint in an emergency. Contact mfg. for replacement buckle.
117)	TurboBooster	1963973, 1963974, 1963975, 1963976, 1967886, 1975173	12/22/15- 04/05/16	Instructions are missing the information required by FMVSS 213 that the seats should be securely belted to the vehicle at all times, even if the seat is unoccupied. Recall does not affect the safety performance of the seat. Contact mfg. to obtain missing instructions.

Harmony**877-306-1001 / www.harmonyjuvenile.com**

>> 118)	Big Boost Deluxe	All Models	11/01/15- 06/24/17	In the event of a crash, a child's chest may experience forces that exceed FMVSS 213 limits. Owners should contact Harmony customer service for more information.
---------	---------------------	------------	-----------------------	---

119) **International****REFER TO OLDER MODELS LIST - ALL MODELS ARE OLDER THAN 10 YEARS - REPLACEMENT PROGRAM DISCONTINUED - DESTROY & REPLACE****Kiddy USA****855-925-4339 / info@kiddyusa.com / www.kiddyusa.com**

120)	World Plus	51 100 WP	02/01/12- 10/05/13	Recall affects all World Plus seats ever made. The buckle/tongue on the impact shield of affected seats may only partially engage, appearing to be fully latched when it is not. Kiddy will reimburse owners the full purchase price of the car seat. Contact mfg. (855-925-4339) for more information.
------	------------	-----------	-----------------------	---

121) **Kolcraft****REFER TO OLDER MODELS LIST - ALL MODELS ARE OLDER THAN 10 YEARS - REPLACEMENT PROGRAM DISCONTINUED - DESTROY & REPLACE**122) **Lin Lih/MCP Ent.****REFER TO OLDER MODELS LIST - ALL MODELS ARE OLDER THAN 10 YEARS - REPLACEMENT PROGRAM DISCONTINUED - DESTROY & REPLACE**

Recent additions to the list are denoted by >>

<i>List No.</i>	<i>Manufacturer Model Name</i>	<i>Model No. (X = more numbers or letters follow)</i>	<i>Customer Assistance Mfg Date</i>	<i>Problem Type and Consumer Action</i>
Maxi-Cosi (Dorel)		Dorel Juvenile Group: 866-623-3139 / 800-219-0509 / 866-611-3022 / 812-372-0141 www.djgusa.com		
123)	Mico Mico (base)	22-371, 22-372 22-515	07/01/07- 02/17/08	Attachment difficulties between the infant carrier and the base may lead to the carrier being improperly mounted to the base. Contact mfg. for replacement base.
124)	Mico Mico (base)	22-371 HFL, 22-371 JUC, 22-371 LMD, 22-371 ORE, 22-371 PNG, 22-372 TTH 22-515 BLK	02/18/08- 06/28/08	Attachment difficulties between the infant carrier and the base may lead to the carrier being improperly mounted to the base. Contact mfg. for repair kit. NOTE: This is an extension of an earlier recall.
125)	Mico	22371x, 22372x	05/01/08- 04/30/09	Harness locking and release button does not always return to its locked position and could result in a loose harness, increasing the risk of being injured a crash. Contact mfg. for repair kit.
126)	Priori	22476x, 22486x	05/01/08- 04/30/09	Harness locking and release button does not always return to its locked position and could result in a loose harness, increasing the risk of being injured a crash. Contact mfg. for repair kit.
127)	Mercedes-Benz USA	REFER TO OLDER MODELS LIST - ALL MODELS WITH RECALLS ARE OLDER THAN 10 YEARS		
Mia Moda		866-642-6632 - www.miamodainc.com		
128)	Viva Viva Supreme	5000 (seat), 5001 (base), 5050 (seat), 5051 (base), 5070 (seat), 5071 (base) 5080 (seat), 5081 (base)	12/01/06- 05/31/09	Sharp edges on the harness splitter plate can cut the harness. Also, the base could crack in a crash. Contact mfg. at 877-546-8437 for a full refund. <u>Mia Moda is urging parents/caregivers to discontinue use of the seat until it can be replaced.</u> According to Lerado/Mia Moda, there have been no injuries reported due to these problems and this is a voluntary precaution they are taking.
Orbit Baby		877-672-2229 / 510-793-5007 - www.orbitbaby.com		
129)	Car Seat Base G2	ORB822000	03/20/13- 07/20/13	Voluntary recall of the Orbit Baby Car Seat Base G2 with listed manufacturer dates AND with a Batch Number of A0840, A0860, or A0880. The knob on the base used to tighten the base into the vehicle may detach or spin without tightening the base. <u>The Infant Car Seat G2 is not affected by this recall and can continue to be used without the base.</u> Contact mfg. for a free repair kit.
Peg Perego USA		877-737-3468 / 219-482-8191 - www.perego.com		
130)	Jacadi	IMCB00JA57RJ31JU31	07/01/07- 03/14/08	The plastic adjustment cover of affected models could have exposed sharp edges that could cause cuts, scratches, or abrasions on the feet or legs of bare-footed infants. Does not affect safety as car seat. Contact mfg. for a free repair kit.
131)	Primo Viaggio SIP 30/30	32MD41KN41, 35CR13BU13, 35CR13PL46, 35CR24BU24, 35TL49KN53, 35TL53KN46, 61FG13ST53, 61FG53ST49, 61FG53ST64, 61ST13IC53, 61ST34IC53, 61ST48IC53	07/01/07- 03/14/08	The plastic adjustment cover of affected models could have exposed sharp edges that could cause cuts, scratches, or abrasions on the feet or legs of bare-footed infants. Does not affect safety as car seat. Contact mfg. For a free repair kit. Note: Affected model numbers begin with IMUN00US.
132)	Playskool	REFER TO OLDER MODELS LIST - ALL MODELS ARE OLDER THAN 10 YEARS - REPLACEMENT PROGRAM DISCONTINUED - DESTROY & REPLACE		
133)	Pride Trimble/Virco	REFER TO OLDER MODELS LIST - ALL MODELS ARE OLDER THAN 10 YEARS - REPLACEMENT PROGRAM DISCONTINUED - DESTROY & REPLACE		
134)	Questor	REFER TO OLDER MODELS LIST - ALL MODELS ARE OLDER THAN 10 YEARS - REPLACEMENT PROGRAM DISCONTINUED - DESTROY & REPLACE		

Recent additions to the list are denoted by >>

List No.	Manufacturer Model Name	Model No. (X = more numbers or letters follow)	Customer Assistance	
			Mfg Date	Problem Type and Consumer Action
Recaro			888-973-2276 / 800-873-2276 / 248-364-3818/ - www.recaropromotion.com	
135)	Como	331.00.xxx, 331.01.xxx	11/01/07-02/16/09	The front harness adjuster strap may slip within the adjuster/lock that controls tightness of the harness and may prevent the harness from staying properly tight. Contact mfg. for free replacement seat. NOTE: Models with a green dot above the bar code on the model # sticker are OK to use.
136)	Performance RIDE	333.01.xxx	01/15/13 - 06/09/15	The top tether anchorage on the seat may detach from the plastic shell in a crash. Contact mfg. for repair kit.
137)	ProRIDE	332.01.xxx	04/09/10 - 06/09/15	The top tether anchorage on the seat may detach from the plastic shell in a crash. Contact mfg. for repair kit.
138)	ProSport	385.01.xxxx	06/16/10-01/31/13	When the affected child seats are installed with the LATCH lower anchors only (without the top tether), the child's head can move too much, increasing the risk of injury in a crash. Contact mfg. for replacement labels and complete set of new instructions informing owners to discontinue use of the LATCH system when the weight of the child reaches 40 pounds.
139)	Signo	330.00.xxx, 330.01.xxx	11/01/07-02/16/09	The front harness adjuster strap may slip within the adjuster/lock that controls tightness of the harness and may prevent the harness from staying properly tight. Contact mfg. for free replacement seat. NOTES: This date range is an expansion of the initial date range (02/01/08-09/30/08) for this recall. Models with a green dot above the bar code on the model # sticker are OK to use.
140)	Renolux (FBS)			REFER TO OLDER MODELS LIST - ALL MODELS ARE OLDER THAN 10 YEARS - REPLACEMENT PROGRAM DISCONTINUED - DESTROY & REPLACE
141)	Safeline Kids (See Triple Play Products also)			REFER TO OLDER MODELS LIST - ALL MODELS WITH RECALLS ARE OLDER THAN 10 YEARS
Safety 1st (Dorel)			Dorel Juvenile Group: 866-623-3139 / 800-219-0509 / 866-611-3022 / 812-372-0141 - www.djgusa.com	
142)	Alpha Omega All-N-1 Alpha Omega Elite	22152x, 22159x, 22172x, 22177x, 22178x, 22185x, 22188x, 22195x, 22412x, 22456x, 22465x, 22469x	05/01/08-04/30/09	Harness locking and release button does not always return to its locked position and could result in a loose harness, increasing the risk of being injured a crash. Contact mfg. for repair kit.
143)	Alpha Omega Elite	22187xxx, 22465xxx, CC033xxx, CC046xxx	07/20/10-05/18/11	The rear-facing belt path installation arrows are incorrect, possibly appearing to point toward the forward-facing vehicle belt path location. Contact mfg. for replacement label kit.
144)	Avenue	22439x, 22449x	05/01/08-04/30/09	Harness locking and release button does not always return to its locked position and could result in a loose harness, increasing the risk of being injured a crash. Contact mfg. for repair kit.
145)	Complete Air LX Complete Air SE	CC050xxx CC051xxx	07/20/10-05/18/11	The rear-facing belt path installation arrows are incorrect, possibly appearing to point toward the forward-facing vehicle belt path location. Contact mfg. for replacement label kit.
146)	Enspira	22453x	05/01/08-04/30/09	Harness locking and release button does not always return to its locked position and could result in a loose harness, increasing the risk of being injured a crash. Contact mfg. for repair kit.

Recent additions to the list are denoted by >>

<i>List No.</i>	<i>Manufacturer Model Name</i>	<i>Model No. (X = more numbers or letters follow)</i>	<i>Customer Assistance Mfg Date</i>	<i>Problem Type and Consumer Action</i>
-----------------	--------------------------------	---	-------------------------------------	---

Safety 1st (Dorel) (continued)

147)	Infant Car Seat	22-057 CLN, 22-057 DBY, 22-057 HRT, 22-057 LPH, 22-085 DWA, 22-085 LYN, 22-095 RBK, 22-322 HRR, 22-322 KDL, 22-322 LXI, 22-322 MAI, 22-322 OLY, 22-322 PRS, 22-322 PTK, 22-325 COB, 22-325 PAC, 22-380 LGA, 22-380 MSA, 22-627 WAV	01/06/08-04/06/09	The child restraint carry handle can loosen and come off posing a fall hazard to infants. The safety as a child restraint is not affected. Do not use handle until repaired. Contact mfg. for free repair kit. NOTE: Only those models sold as a part of the Eurostar, Explorer, Lite Wave, Sojourn, and Vector Travel Systems are affected.
148)	OnBoard	22077x, 22078x, 22356x	05/01/08-04/30/09	Harness locking and release button does not always return to its locked position and could result in a loose harness, increasing the risk of being injured a crash. Contact mfg. for repair kit.
149)	OnBoard 35	IC124 FSM	05/01/11-04/25/12	Some models were sold without a base and therefore did not provide lower LATCH attachments as required by FMVSS 213. Carriers can safely be installed without the base using the seat belt. Contact mfg. to obtain a base.
150)	Prospect	22580x	05/01/08-04/30/09	Harness locking and release button does not always return to its locked position and could result in a loose harness, increasing the risk of being injured a crash. Contact mfg. for repair kit.
151)	Uptown	22475x	05/01/08-04/30/09	Harness locking and release button does not always return to its locked position and could result in a loose harness, increasing the risk of being injured a crash. Contact mfg. for repair kit.
152)	Vantage Vantage Point/ Surveyor Vantage Hiback	22553x, 22554x, 22560x, 22561x, 22564x, 22567x, 22574x	05/01/08-04/30/09	Harness locking and release button does not always return to its locked position and could result in a loose harness, increasing the risk of being injured a crash. Contact mfg. for repair kit.

Snuggli*See Evenflo*153) **Strolee***REFER TO OLDER MODELS LIST - ALL MODELS ARE OLDER THAN 10 YEARS - REPLACEMENT PROGRAM DISCONTINUED - DESTROY & REPLACE***Team-Tex America****877-912-1313**

154)	Babyride	374199	12/18/08	The belt routing label with the "horizontal reference line" for determining the correct recline angle is incorrectly placed on the child restraint. Contact mfg. for replacement label and instructions.
------	----------	--------	----------	--

**TriplePlay Products
(See Safeline Kids also)****800-829-1625 - www.tripleplayproducts.com**

155)	Sit'n'Stroll	4002	05/05/08	The webbing used in the center adjuster for the harness fails to comply with the initial breaking strength requirements of FMVSS 213. Contact mfg. for repair kit and instructions. NOTE: According to TriplePlay, the only units affected were a small number of seats manufactured on May 5, 2008 and sold through their website. All purchasers are being contacted and notified of this recall.
------	--------------	------	----------	---

156) **TRW***REFER TO OLDER MODELS LIST - ALL MODELS ARE OLDER THAN 10 YEARS - REPLACEMENT PROGRAM DISCONTINUED - DESTROY & REPLACE*157) **XSCi***REFER TO OLDER MODELS LIST - ALL MODELS ARE OLDER THAN 10 YEARS - REPLACEMENT PROGRAM DISCONTINUED - DESTROY & REPLACE*

Recent additions to the list are denoted by >>

Integrated (built-into the vehicle) seats

	<i>Manufacturer</i>	<i>Model Year</i>	<i>Customer Assistance</i>
<i>Chrysler</i>			<i>800-853-1403 / 800-992-1997</i>
158)	Town and Country	1996	Bolts securing seat to frame can break. Contact Chrysler Corp. or dealer for repair
159)	Town and Country	1988	Harness restraint webbing incorrectly routed around the metal reinforcement bar on these seats. Child may not be properly restrained in the event of a crash. Dealers will inspect and correct improperly routed webbing.
160)	Town and Country	1996, 1997	Safety improvement campaign: The latch plate can remain in the locked position due to food or other items. Owners are being provided with decals/instructions describing the operation of the buckle and the latch plate
161)	Town and Country	1996, 1997	The harness on the integrated child seat can become difficult to release when the safety belt latch plate gets dirty. Dealers will clean the latch, modify the emergency release anchor, and provide additional instructions.
<i>Dodge</i>			<i>800-853-1403 / 800-992-1997</i>
162)	Caravan Grand Caravan	1996	Bolts securing seat to frame can break. Contact Chrysler Corp. or dealer for repair
163)	Caravan Grand Caravan	1988	Harness restraint webbing incorrectly routed around the metal reinforcement bar on these seats. Child may not be properly restrained in the event of a crash. Dealers will inspect and correct improperly routed webbing.
164)	Caravan Grand Caravan	1996, 1997	Safety improvement campaign: The latch plate can remain in the locked position due to food or other items. Owners are being provided with decals/instructions describing the operation of the buckle and the latch plate
165)	Caravan Grand Caravan	1996, 1997	The harness on the integrated child seat can become difficult to release when the safety belt latch plate gets dirty. Dealers will clean the latch, modify the emergency release anchor, and provide additional instructions.
<i>Ford</i>			<i>800-392-3673</i>
166)	Windstar	1998	The headrest lockout mechanism on the integrated child seats may not engage and lock the headrest in the "down" position, as intended. Replace bench seats with integrated child seats with seats built with revised headrest lockout mechanisms.
<i>Plymouth</i>			<i>800-853-1403 / 800-992-1997</i>
167)	Voyager Grand Voyager	1996	Bolts securing seat to frame can break. Contact Chrysler Corp. or dealer for repair
168)	Voyager Grand Voyager	1988	Harness restraint webbing incorrectly routed around the metal reinforcement bar on these seats. Child may not be properly restrained in the event of a crash. Dealers will inspect and correct improperly routed webbing.
169)	Voyager Grand Voyager	1996, 1997	Safety improvement campaign: The latch plate can remain in the locked position due to food or other items. Owners are being provided with decals/instructions describing the operation of the buckle and the latch plate
170)	Voyager Grand Voyager	1996, 1997	The harness on the integrated child seat can become difficult to release when the safety belt latch plate gets dirty. Dealers will clean the latch, modify the emergency release anchor, and provide additional instructions.

Car seats manufactured before 1981 were not required to be crash tested and must not be used. Most manufacturers stamp their car seats with an expiration date, typically six to eight years from the date of manufacture, on a label or in the shell of the seat. Many child passenger safety advocates recommend that if no expiration date can be found, car seats older than ten years should be replaced by a new one. Older models are included as a part of this recall list because care givers will sometimes choose to use older car seats even though it goes against the recommendations of most organizations and advocates. Knowing that a particular model is under recall, and if the defect cannot be corrected, should help to encourage the care giver to destroy the older seat and obtain a new one.

Following are recalls and safety notifications that were issued for models where all or most models sold are at least 10 years old as of October 13, 2017. The listing of older models with recalls will only be updated as "newer" models get to be old enough to be moved to the "older" models list.

Programs that make multiple copies of the HSRC recall list, e. g., for use at clinics or permanent checking/fitting stations, should only have to make copies of this older model section when it is revised, regardless of how often the main (newer model) section is revised. Most clinics or permanent checking/fitting stations should only need to print/copy one or two older model lists for reference. Updated versions of this list, as well as the list of models less than 10 years old, are posted on-line at www.buckleupnc.org/car-seat-recall-list.

CAR SEATS 10 YEARS OLD AND OLDER

Download this list & sign up for email notification of updates: buckleupnc.org/car-seat-recall-list

**Index of Recalls and Safety Notifications
For the model numbers "x" = more numbers or letters follow.**

Model numbers and model names for car seats under recall are followed by their index number which corresponds to the "List No." for each listing. If the model number is not found, check the model name also. Model numbers are not available for all model names.

Note: Dorel Juvenile Group products are indexed under each individual product line (e.g., Cosco) as well as under "Dorel."

Alcot (Childcare)	Basic Comfort	# E9L20 217
Child Love Seat 201	# 960 210, 211	# E9L30 220, 221, 222
All Our Kids	# 961 210, 211	# E9L32 229
# 600 202	Galaxy 2000 210, 211	# E9L3998 225
# 602 203	Beatrix Potter (Dorel)	# E9L39x 224
Little Cargo Vest 202, 203	# 02-620-xxx 212	# E9L47 218
Alpha Elite (Dorel)	# 02-621-SAL 212	# E9L57 215
# 22331 BLA 204, 205	Designer 22 212	# E9L80 217
# 22332 RLA 204, 205	Bolform Corp.	# E9W06 223
Comfort Infant Seat 204, 205	# 84E-019 213	Advantage 214
American Motors	Buckle-Up Harness 213	Boulevard 215
Child Love Seat 207	Britax	Companion 216, 217
Infant Love Seat 206	# 101 219	Decathlon 218
Babyhood Industries	# 161 226	Freeway 219
# 810 208	# E902228 214	Husky 220, 221
# 8200 209	# E9031 227, 228	Marathon 222, 223
Baby-Sitter 209	# E906 223	Regent 224, 225
Wonda Chair 208	# E9L06 223	Roundabout 226
	# E9L07 230	Super Elite 227, 228
	# E9L14 216, 217	Traveller Plus 229
		Wizard 230

Car Seat Recalls and Safety Notifications: MODELS 10 YEARS OLD AND OLDER

For the model numbers "x" = more numbers or letters follow

Index number refers to "List No." for each listing

Century		# 4480	254, 257	Breverra Contour	263
# 11-564	249	# 4490	254, 257	Breverra Premiere	264
# 11-565	249	# 4500	269	Child Love Seat	265
# 11-570	248, 249	# 4510	269	Encore	266
# 11-575	249	# 45100	260	Infant Car Seat	267, 268
# 11-576	249	# 4513	268	Infant Love seat	269
# 11-578	249	# 4515	268	Smart Fit	270
# 11-595	249	# 4516	268	Smart Move	271, 272
# 11-597	248, 249	# 4518	268	Chrysler	
# 11-598	249	# 4520	269	Child Love Seat	273
# 11-599	249	# 45200	260	Collier-Keyworth	
# 11-600	248, 249	# 4525	270	Co-Pilot	274
# 11-650	248	# 4535	267	Commuter	276
# 12-565	268	# 4551	268	Safe and Sound II	275
# 4100	231, 232	# 4557	268	Combi	
# 4153	233	# 4558	268	# 8065	278
# 4163	233	# 4559	268	# 8074	278
# 4180	233	# 4560	267	# 8086	278
# 4200	234, 235, 236, 237	# 45600	260	# 8087	279
# 4210	234, 235, 236, 237	# 4564	268	# 8100	277
# 4214	234, 235, 236, 237	# 4565	267, 268	# 8520	278
# 4223	234, 235, 236, 237	# 4566	268	Avatar	277
# 4235	234, 235, 236, 237	# 4568	268	Centre	278
# 4253	238, 239, 240	# 4569	268	Shuttle	279
# 4261	239, 240	# 45700	260	Compass Baby	
# 4263	238, 239, 240	# 4575	261, 268	# 1420 ARD	280
# 4265	238, 239, 240	# 4576	268	# 1420 FUO	280
# 4266	239, 240	# 4580	259	# 1420 MAR	280
# 4300	241	# 4581	258, 259	Infant Car Seat	280
# 4302	241	# 4583	258, 259	Cosco	
# 4303	241	# 4585	258, 259	# 02-014-EMF	305
# 4310	241	# 4589	268	# 02-014-GDM	305
# 4323	241	# 4590	267	# 02-015-PDL	305
# 4334	241	# 4591	268	# 02-084	304, 307
# 4335	241	# 4593	268	# 02-086	287
# 4353	243, 244, 246	# 4594	268	# 02-090	301
# 4365	243, 244, 245, 246	# 4595	268	# 02-094	307
# 4365DT	242	# 4597	268	# 02-096	307
# 4366	242, 243, 244, 245, 246	# 4600	265	# 02-190	303
# 4367	245, 246	# 4662	266	# 02-290	302
# 4368	243, 244, 245, 246	# 4750	271	# 02-331	281
# 4369	245, 246	# 4875	263	# 02-332	281
# 4380	245, 247	# 4885	264	# 02-404	307
# 4381	245	100	231, 232	# 02-514-BWE	306
# 4400	250, 251	1000 STE	233	# 02-518-NDF	306
# 4434	250, 251	200	234, 235, 236, 237	# 02-531	281
# 4436	250, 251	2000 STE	238, 239, 240	# 02-533	281
# 4446	250, 251	300	241	# 02-537	281
# 4450	252, 253, 255, 256	3000 STE	242, 243, 244, 245, 246	# 02-584-OXF	306
# 4460	252, 253, 254, 255, 256	3500 STE	247	# 02-665	286
# 44612	266	4-in-1	248, 249	# 02-667	312
# 44622	262	400XL	250, 251	# 02-719-ARQ	289
# 44630	262	5000 STE	252, 253, 254, 255, 256	# 02-727	286
# 44631	262	5500 STE	257	# 02-728	286
# 44662	262	580	258, 259		
# 4470	253, 254, 255, 256	Accel	260		
# 44709	272	Affinity	261		
# 4475	252, 253, 254, 255, 256	Bravo	262		
# 4476	254, 255				

Car Seat Recalls and Safety Notifications: MODELS 10 YEARS OLD AND OLDER

For the model numbers "x" = more numbers or letters follow

Index number refers to "List No." for each listing

Cosco (continued)	# 181B	296	# 02-190 (Cosco)	303
# 02-729	# 22-001FSM	290	# 02-331 (Cosco)	281
# 02-729 TED	# 22-297	293	# 02-331 (Eddie Bauer)	315
# 02-731	# 22-298	293	# 02-332 (Cosco)	281
# 02-732	# 22-299	293	# 02-332 (Eddie Bauer)	315
# 02-733	# 22-300-JOS GB1B	288	# 02-404 (Cosco)	307
# 02-750	# 22100	309	# 02-514-BWE (Cosco)	306
# 02-751	# 22100x	310	# 02-518-NDF (Cosco)	306
# 02-753	# 22111x	310	# 02-531 (Cosco)	281
# 02-755	# 22130x	310	# 02-531 (Eddie Bauer)	315
# 02-756	# 22139MON	295	# 02-533 (Cosco)	281
# 02-757	# 22150	283	# 02-533 (Eddie Bauer)	315
# 02-758	# 22155	283	# 02-537 (Cosco)	281
# 02-759	# 22180	283	# 02-537 (Eddie Bauer)	315
# 02-760	# 22269	283	# 02-555 (Cosco)	281
# 02-761	# 313	298	# 02-555 (Eddie Bauer)	315
# 02-762	# 323	299	# 02-584-OXF (Cosco)	306
# 02-763	# 423	299	# 02-620-xxx (Beatrix Potter)	212
# 02-764	# 81A	296	# 02-620-xxx (Safety 1st)	463
# 02-765	# 81B	296	# 02-621-SAL (Beatrix Potter)	212
# 02-770	# 93084	308	# 02-621-SAL (Safety 1st)	463
# 02-771	# 93094	308	# 02-665 (Cosco)	286
# 02-772	# 93100x	310	# 02-667 (Cosco)	312
# 02-774	# 93111x	310	# 02-719 ARQ (Cosco)	289
# 02-790	# 93443	292	# 02-727 (Cosco)	286
# 02-821	# 93446	309	# 02-728 (Cosco)	286
# 02-890	# 93504	309	# 02-729 (Cosco)	286
# 02014	# 93514	292, 308	# 02-729 TED (Cosco)	285
# 02015	Alpha Omega	281, 282, 283	# 02-731 (Cosco)	286
# 02019	Alpha Omega Elite	283	# 02-732 (Cosco)	286
# 02084	Arriva	284, 285, 286	# 02-733 (Cosco)	286
# 02094	Commuter	287	# 02-750 (Cosco)	286
# 02114	Designer 22	288	# 02-751 (Cosco)	284, 286
# 02332	Dream Ride	289	# 02-753 (Cosco)	312
# 02409	DreamRide	290	# 02-755 (Cosco)	286
# 02442	Hi Back Booster	291	# 02-756 (Cosco)	286, 312
# 02443	High Rise Booster	293	# 02-757 (Cosco)	286
# 02445	Lxry Sft Shld Auto Trac	294	# 02-758 (Cosco)	312
# 02448	Regal Ride	295	# 02-759 (Cosco)	312
# 02449	Safe and Easy	298	# 02-760 (Cosco)	312
# 02450	Safe and Snug	299	# 02-761 (Cosco)	312
# 02480	Safe-T Mate	297	# 02-762 (Cosco)	312
# 02495	Safe-T-Shield	296	# 02-763 (Cosco)	312
# 02504	Sft Shld Auto Trac	302	# 02-764 (Cosco)	312
# 02514	Soft Shield	301	# 02-765 (Cosco)	312
# 02518	Soft Shield Deluxe	303	# 02-770 (Cosco)	312
# 02519	Touriva	304, 305, 306, 307, 308, 309, 310	# 02-771 (Cosco)	312
# 02524	Turnabout	312	# 02-772 (Cosco)	312
# 02531	Voyager Inf/Stroller	313	# 02-774 (Cosco)	286
# 02533			# 02-790 (Cosco)	294
# 02537	Dorel		# 02-821 (Cosco)	307
# 02555	# 02-014-EMF (Cosco)	305	# 02-890 (Cosco)	294
# 02584	# 02-014-GDM (Cosco)	305	# 02014 (Cosco)	308
# 02803	# 02-015-PDL (Cosco)	305	# 02015 (Cosco)	308
# 02806	# 02-084 (Cosco)	304, 307	# 02019 (Cosco)	308
# 02821	# 02-086 (Cosco)	287	# 02084 (Cosco)	308
# 02825	# 02-090 (Cosco)	301, 302	# 02094 (Cosco)	308
# 02935	# 02-094 (Cosco)	307	# 02114 (Cosco)	308
# 181A	# 02-096 (Cosco)	307		

Car Seat Recalls and Safety Notifications: MODELS 10 YEARS OLD AND OLDER

For the model numbers "x" = more numbers or letters follow

Index number refers to "List No." for each listing

Dorel (continued)	# 22332 RLA (Alpha Elite) 204, 205	Hi Back Booster (Eddie Bauer) 322
# 02332 (Cosco) 282	# 22450 (Safety 1st) 465	High Rise Booster (Cosco) 293
# 02409 (Cosco) 291	# 22451 (Safety 1st) 465	Intera (Safety 1st) 466
# 02409 (Eddie Bauer) 322	# 22452 (Safety 1st) 465	Lxry Sft Shld Auto Trac (Cosco) 294
# 02442 (Cosco) 291, 292	# 22453 (Safety 1st) 465	Regal Ride (Cosco) 295
# 02442 (Eddie Bauer) 322	# 22455 (Safety 1st) 461	Safe and Easy (Cosco) 298
# 02443 (Cosco) 291, 292	# 22460 (Safety 1st) 466	Safe and Snug (Cosco) 299
# 02443 (Eddie Bauer) 322	# 22480 (Safety 1st) 465	Safe-T-Mate (Cosco) 297
# 02445 (Cosco) 291	# 22481 (Safety 1st) 465	Safe-T-Shield (Cosco) 296
# 02445 (Eddie Bauer) 322	# 224x (Cosco) 311	Sft Shld Auto Trac (Cosco) 302
# 02448 (Cosco) 291, 292	# 225x (Cosco) 311	Sidekick Booster (Cosco) 300
# 02448 (Eddie Bauer) 322	# 22630xxx (Eddie Bauer) 318, 319	Soft Shield (Cosco) 301
# 02449 (Cosco) 291	# 22631xxx (Eddie Bauer) 318, 319	Soft Shield Deluxe (Cosco) 303
# 02449 (Eddie Bauer) 322	# 22740 (Eddie Bauer) 316, 321	Touriva (Cosco) 304, 308, 309, 310
# 02450 (Cosco) 291	# 22750 (Eddie Bauer) 316, 317	Touriva (Eddie Bauer) 323
# 02450 (Eddie Bauer) 322	# 22755 (Eddie Bauer) 316, 317	Touriva 5-point (Cosco) 306
# 02480 (Cosco) 291	# 22756 (Eddie Bauer) 316, 317	Touriva Shield (Cosco) 305
# 02480 (Eddie Bauer) 322	# 22757 (Eddie Bauer) 316, 317	Touriva T-Shield (Cosco) 307
# 02495 (Cosco) 291	# 22770 (Eddie Bauer) 316, 317	Trooper (Cosco) 311
# 02495 (Eddie Bauer) 322	# 229x (Cosco) 311	Turnabout (Cosco) 312
# 02504 (Cosco) 308	# 244x (Cosco) 300	Voyager Inf/Stroller (Cosco) 313
# 02514 (Cosco) 308, 309	# 313 (Cosco) 298	
# 02518 (Cosco) 308	# 323 (Cosco) 299	Downunder
# 02519 (Cosco) 308, 309	# 423 (Cosco) 299	Kangaroo Booster 314
# 02524 (Cosco) 308, 309	# 81A (Cosco) 296	
# 02531 (Cosco) 282	# 81B (Cosco) 296	Eddie Bauer
# 02533 (Cosco) 282	# 93084 (Cosco) 308	# 02-331 315
# 02537 (Cosco) 282	# 93094 (Cosco) 308	# 02-332 315
# 02555 (Cosco) 282	# 93100x (Cosco) 310	# 02-531 315
# 02584 (Cosco) 308	# 93111x (Cosco) 310	# 02-533 315
# 02803 (Cosco) 308	# 93443 (Cosco) 292	# 02-537 315
# 02806 (Cosco) 308	# 93446 (Cosco) 309	# 02-555 315
# 02821 (Cosco) 308	# 93504 (Cosco) 309	# 02409 322
# 02825 (Cosco) 308	# 93514 (Cosco) 292, 308	# 02442 322
# 02870 (Eddie Bauer) 323	3-in-1 (Eddie Bauer) 315, 316	# 02443 322
# 02871 (Eddie Bauer) 323	Alpha Elite (Safety 1st) 460	# 02445 322
# 02875 (Eddie Bauer) 323	Alpha Omega (Cosco) 281, 282, 283	# 02448 322
# 02935 (Cosco) 308	Alpha Omega (Eddie Bauer) 317	# 02449 322
# 181A (Cosco) 296	Alpha Omega (Safety 1st) 461	# 02450 322
# 181B (Cosco) 296	Alpha Omega Elite (Cosco) 283	# 02480 322
# 219x (Cosco) 311	Alpha Omega Elite (Eddie Bauer) 317	# 02495 322
# 22-001FSM (Cosco) 290	Alpha Omega Elite (Safety 1st) 461	# 02870 323
# 22-297 (Cosco) 293	Alpha Sport (Safety 1st) 462	# 02871 323
# 22-298 (Cosco) 293	Arriva (Cosco) 284, 285, 286	# 02875 323
# 22-299 (Cosco) 293	Comfort Infant Seat (Alpha Elite) 204, 205	# 22-625 xxx GB1B 320
# 22-300-JOS GB1B (Cosco) 288	Comfort Infant Seat (Eddie Bauer) 318, 319	# 22630xxx 318, 319
# 22-325 xxx GB1B (Safety 1st) 464	Commuter (Cosco) 287	# 22631xxx 318, 319
# 22-625 xxx GB1B (Eddie Bauer) 320	Deluxe 3-in-1 (Eddie Bauer) 316	# 22740 316, 321
# 22100 (Cosco) 309	Deluxe Convertible (Eddie Bauer) 316	# 22750 316, 317
# 22100x (Cosco) 310	Designer 22 (Beatrix Potter) 212	# 22755 316, 317
# 22111x (Cosco) 310	Designer 22 (Cosco) 288	# 22756 316, 317
# 22130x (Cosco) 310	Designer 22 (Eddie Bauer) 320	# 22757 316, 317
# 22139MON (Cosco) 295	Designer 22 (Safety 1st) 463, 464	# 22770 316, 317
# 22150 (Cosco) 283	Dream Ride (Cosco) 289	3-in-1 315, 316
# 22151 (Safety 1st) 461	DreamRide (Cosco) 290	Alpha Omega 317
# 22155 (Cosco) 283	Enspira (Eddie Bauer) 321	Alpha Omega Elite 317
# 22180 (Cosco) 283	Enspira (Safety 1st) 465	Comfort Infant Seat 318, 319
# 22269 (Cosco) 283	Hi Back Booster (Cosco) 291	Deluxe 3-in-1 316
# 22331 BLA (Alpha Elite) 204, 205		Deluxe Convertible 316

Car Seat Recalls and Safety Notifications: MODELS 10 YEARS OLD AND OLDER

For the model numbers "x" = more numbers or letters follow

Index number refers to "List No." for each listing

Eddie Bauer (continued)	# 416	326	Travel Tandem	349, 350
Designer 22	# 4176	344	Tribute	351
Enspira	# 420	356	Triumph	352, 353
Hi Back Booster	# 435x	338	Trooper	311, 354
Touriva	# 441	333, 334, 337	Two-in-One	355
	# 442	333, 334, 337	Ultara 1	356, 357
	# 443	333, 334, 337	Ultara II	358, 359
	# 444	333, 334, 337		
Evenflo	# 445	333, 334, 337	Fisher Price	
# 200x	# 446	333, 334, 337	# 79700	374
# 201	# 447	333, 334	# 9100	360, 361, 362, 363, 364, 365, 366, 367, 368
# 202	# 447x	341	# 9101	361, 362, 364, 365, 366, 367, 368
# 203x	# 448	333, 334, 337	# 9104	369, 372, 373
# 205x	# 453	347, 348	# 9149	370
# 206	# 454	347, 348	# 9173	371
# 207x	# 456	336, 337	Booster	372, 373
# 210x	# 458	336, 337	Car Seat	360, 361, 362, 363, 364, 365, 366, 367, 368
# 211x	# 468x	332	Delux Car Seat	369
# 219164	# 469x	332	Infant Seat	370, 371
# 219180	# 470	327, 328	Safe Embrace	374
# 219186	# 471	327, 328		
# 219188	# 476x	332	Ford	
# 21940	# 477x	332	Infant Love Seat	375
# 219x	# 478x	332		
# 221	# 480x	332	General Motors	
# 222	# 481x	332	Child Love Seat	377
# 223	# 492x	340	Infant Love Seat	376
# 224x	# 493x	338		
# 225x	# 499x	341	Gerry	
# 227	# 540xx	335	# 626	379
# 228	# 548xx	335	Guardian	378
# 229x	# 549xx	335	Secure Ride	379
# 231	# 550xx	335		
# 232	# 556xx	335	Graco	
# 242	# 597xx	335	# 7493	384
# 244x	# 598xx	335	# 7497	384
# 264x	# 599xx	335	# 7499	384
# 272x	# 636x	355	# 8402	385
# 273x	# 637x	355	# 8402L	385
# 317xx	# 639001	342	# 8403x	385
# 320xx	# 639002	342	# 841101	384
# 359x	410	324	# 841102	384
# 378x	Bobby Mac Champion	325	# 841103	384
# 379x	Bobby Mac Deluxe	326	# 8412	385
# 389x	Booster Seat	327, 328	# 841203	384
# 397xx	Champion	329, 330, 331	# 8412T02	384
# 398xx	Cozy Carry	332	# 8433x	380
# 401	Dyn-O-Mite	333, 334	# 8442x	385
# 402	Embrace	335	# 8443	385
# 403	Infant Car Seat	336, 337	# 8443L	385
# 404	Joyride	338	# 8444	385
# 405	On My Way	339, 340, 341	# 8444L	385
# 406	On My Way base	342	# 8446	385
# 407	One-Step	343	# 8446L	385
# 408	One-Step Deluxe	344	# 8447	385
# 409	Scout	345, 346	# 8447L	385
# 410	Seven Year Seat	347, 348	# 8447L	385
# 411	Sidekick	300	# 8448	385
# 412				
# 414				
# 415				

Car Seat Recalls and Safety Notifications: MODELS 10 YEARS OLD AND OLDER

For the model numbers "x" = more numbers or letters follow

Index number refers to "List No." for each listing

Graco (continued)	# 13852	389, 410, 417	Mia Moda	
# 8448L	# 1385x	411, 418	# 5000	424
# 8457	# 138xx	395, 407, 409, 416	# 5001	424
# 8458	# 140-155	404	Viva	424
# 8459	# 150-100	420		
# 8460	# 180-100	399	Peg Perego	
# 8462	# 180-150	399, 400	# AL33USL	429
# 8463x	# 180-200	390, 391, 400, 401	# AL33USN	429
# 8464	# 180-300	390, 391	# AL34USL	429
# 8470	# 180-400	404	# AL34USN	429
# 8471	# 180-600	388, 392	# CS00MU1	428, 429
# 8472	# 180-601	388	# CS00US1	428, 429
# 8473	# 19127	397, 398	# CS00US8	428, 429
# 8474	# 19128	397	# LN34S09	429
# 8476	# 19129	397	# LN34S10	429
# 8477	# 19130	397	# LV34USL	429
# 8478	# 368xx	395, 396, 407, 408, 409, 411, 416	# LV34USN	429
# 8601	# 43xxx	394, 414	# ST33USL	429
# 8602x	# 77001	405	# ST33USN	429
# 8603M	# 77002	405	# ST38USL	429
# 8605x	# 77005	406	# ST38USN	429
# 8607x	# 77007	406	Primo Viaggio	428, 429
# 8608D	Automate	388		
# 8609x	Carter Travel 5	389	Playskool	
# 8616x	Dial-A-Fit	390, 391	# 140-155	430
# 8629x	Dial-A-Fit II	392	# 180-400	430
# 8630x	Flip 'N' Go	397	# 77001	431
# 8631x	Flip 'N' Go II	398	# 77002	431
# 8632x	Infant Car Seat	393	# 77005	432
# 8635x	Infant Restraint	394	# 77007	432
# 8639x	Infant Rider	395, 396	Car Seat	430, 431
# 8643x	Perfect Fitt	399, 400, 401	Infant Car Seat	432
# 8645x	Performa	402, 403		
# 8646x	Playskool	404, 405	Pride Trimble/Virco	
# 8C00x	Playskool Infant	406	# 832	435
# 8C01x	Plus 4	407, 408	# 890	433, 434
# 8C02MRC2	Plus 5	409, 410, 411	# 891	433, 434
# 8C02x	Rock 'N' Ride	412, 413	# 892	433, 434
# 8C03x	Secura	414	Click-n-Go	433, 434
# 8C04FRR	Secure Fit	415	Pride Ride	435
# 8C04FRR2	Travel About	416, 417		
# 8C04x	Travel-About	418	Questor	
# C844342	Traveler 700	419, 420, 421	Kantwet Car Seat	436
ComfortSport	Lin Lih/MCP			
GT 1000	# 180-200	423	Recaro	
SnugRide	# 180-300	423	# 331.00.xxx	437, 438, 439
	Lin Lih	422, 423	Como	437, 438
International			Signo	439
Astroseat	Mercedes-Benz			
	# B66868203	427	Renolux (FBS)	
Kolcraft	# B66868204	427	GT 1000	440
# 131-101	# B66868209	427	GT 2000	441, 442, 443
# 13123	# BQ6910155	426	GT 4000	444, 445
# 1312x	# BQ6910157	425	GT 5000	446, 447
# 1382x	# BQ691063	425	GT 5000 Turn A Tot	448, 449, 450
# 13833	Booster Seat	425	GT 5500	451, 452
# 1383x	Infant Restraint	426	GT 7000	453, 454, 455
# 13842	Kiddy TopSafe	427		
# 1384x				

Car Seat Recalls and Safety Notifications: MODELS 10 YEARS OLD AND OLDER

For the model numbers "x" = more numbers or letters follow

Index number refers to "List No." for each listing

Safeline Kids		TRW
# 3240	456	Child Love Seat
Sit'n'Stroll	456	Infant Love Seat
Safeline Kids (see Triple Play also)		Volvo
# 2003	459	All
# 2240	458	
# 3240	457	XSci
Sit'n'Stroll	457, 458, 459	Pioneered ACIS
Safety 1st (Dorel)		
# 02-620-xxx	463	
# 02-621-SAL	463	
# 22-325xxxGB1B	464	
# 22151	461	
# 22450	465	
# 22451	465	
# 22452	465	
# 22453	465	
# 22455	461	
# 22460	466	
# 22480	465	
# 22481	465	
Alpha Elite	460	
Alpha Omega	461	
Alpha Omega Elite	461	
Alpha Sport	462	
Designer 22	463, 464	
Enspira	465	
Intera	466	
Snug Seat		
# 200-1000	467	
# 600-1000	468	
# E9L32	469	
Gorilla	467	
Spelcast	468	
Traveller Plus	469	
Strolee		
# 599	471	
# 605	473	
# 609	472	
# 610	472	
GT 3000	474	
Quick Click	473	
Wee Care	470, 471, 472	
Team-Tex		
# 374099	475	
Babyride	475	

OLDER MODEL LIST

OLDER MODEL LIST

OLDER MODEL LIST

OLDER MODEL LIST

This page intentionally left blank for 2-sided printing

OLDER MODEL LIST

OLDER MODEL LIST

OLDER MODEL LIST

OLDER MODEL LIST

OLDER MODEL LIST

<i>List No.</i>	<i>Manufacturer Model Name</i>	<i>Model # ("X" = more numbers or letters follow)</i>	<i>Mfg Date</i>	<i>Customer assistance Problem Type and Consumer Action</i>
Alcot (Childcare)				
ALL MODELS OLDER THAN 10 YEARS - REPLACEMENT PROGRAM DISCONTINUED - DESTROY & REPLACE				
201)	Child Love Seat		3/84-11/84	Plastic shell may develop cracks. Destroy & replace seat.
All Our Kids				
ALL MODELS OLDER THAN 10 YEARS - REPLACEMENT PROGRAM DISCONTINUED - DESTROY & REPLACE				
202)	Little Cargo Vest	600	4/93-3/94	Flammability of upholstery. Call mfg. for repair info.
203)	Little Cargo Vest	602	3/94-9/94	Flammability of upholstery. Call mfg. for repair info.
Alpha Elite (Dorel)				
Dorel Juvenile Group: 866-623-3139 / 800-219-0509 / 866-611-3022 / 812-372-0141 www.djgusa.com				
204)	Comfort Infant Seat	22331 BLA, 22332 RLA	07/26/05-02/28/06	Trim screws on handle can loosen resulting in a potential choking hazard. Contact mfg. at 877-229-1374 for free repair kit. Make sure the handle trim screws are tight and continue to use the existing seat while waiting to receive and install the repair kit.
205)	Comfort Infant Seat	22331 BLA, 22332 RLA	07/26/05-02/28/06	Some consumers have experienced difficulty installing the base in certain vehicles. Dorel will replace the original version of the base at no charge to the customer. Contact mfg. at 877-229-1374 to determine eligibility for a replacement base.
American Motors				
ALL MODELS OLDER THAN 10 YEARS - REPLACEMENT PROGRAM DISCONTINUED - DESTROY & REPLACE				
206)	Infant Love Seat	All	1/81-12/82	Plastic shell may develop cracks. Destroy & replace seat.
207)	Child Love Seat	All	3/84-11/84	Plastic shell may develop cracks. Destroy & replace seat.
Babyhood Industries				
ALL MODELS OLDER THAN 10 YEARS - REPLACEMENT PROGRAM DISCONTINUED - DESTROY & REPLACE				
208)	Wonda Chair	810	Pre 12/82	Harness may be misrouted. Call mfg. for instructions.
209)	Baby-Sitter	8200	1/92-6/93	Buckle. Call mfg. for repair info.
Basic Comfort				
ALL MODELS OLDER THAN 10 YEARS - REPLACEMENT PROGRAM DISCONTINUED - DESTROY & REPLACE				
210)	Galaxy 2000	960, 961	ALL	Crash test failure. Call mfg. for repair info.
211)	Galaxy 2000	960, 961	11/98-1/99	Faulty molding of foam backs and cushions may allow separation of part of the booster seat. Call mfg. for repair info.
Beatrix Potter (Dorel)				
Dorel Juvenile Group: 800-219-0509 / 866-611-3022 / 812-372-0141 www.djgusa.com				
212)	Designer 22	02-621-SAL, 02-620-xxx	01/03/02-02/13/02	Plastic handle can unexpectedly release from the carrying position when used as a carrier. Does not affect safety as a child restraint. Contact mfg. for repair kit.

Car Seat Recalls and Safety Notifications: MODELS 10 YEARS OLD AND OLDER

<i>List No.</i>	<i>Manufacturer Model Name</i>	<i>Model # ("X" = more numbers or letters follow)</i>	<i>Mfg Date</i>	<i>Customer assistance Problem Type and Consumer Action</i>
Bolform Corp.				
ALL MODELS OLDER THAN 10 YEARS - NO LONGER IN BUSINESS - DESTROY & REPLACE				
213)	Buckle-Up Harness	84E-019	ALL	Crash test failure. Destroy & replace.
Britax				
888-427-4829 / 704-409-1700				
www.britaxusa.com				
214)	Advantage	E902228	03/05/01-07/26/01	One of the tether brackets of affected seats may separate from the tether attachment point. Contact mfg. for repair kit.
215)	Boulevard	E9L57	03/01/06-08/01/06	Top tether hook can open during a crash allowing the restraint to change from an upright to a reclined position. Owners are being advised to discontinue use of the top tether when the child reaches 50 lbs. Contact mfg. for replacement labels.
216)	Companion	E9L14	10/31/03-06/06/04	One or both of two tabs on the bottom of the carrier may not be properly seated and may allow the carrier to rotate in the base too far in a crash. Correct/incorrect assembly can be determined by visual examination. Call mfg. for replacement info. Affected units may be installed without the base until receiving a replacement.
217)	Companion	E9L14, E9L20, E9L80	Pre-11/01/07	User Guide Update - NOT A RECALL: Britax has updated instructions regarding adjustment of the buckle strap position and maximum height for infant carrier use. The inner buckle strap position should be used for infants weighing less than 11 pounds. A child has exceeded the height limit for the Companion when the top of the head is less than one inch from the top of the child restraint or the child's height exceeds 30 inches (76 cm). Contact mfg for updated user guide and labels
218)	Decathlon	E9L47	02/12/05-07/31/07	Under certain circumstances the harness adjuster housing may separate from the child restraint shell and allow the adjuster to move out of position. If this happens caregivers may experience difficulty adjusting the harness. Call mfg. for repair info.
219)	Freeway	101	6/96-4/97	Buckle. Call mfg. for repair info.
220)	Husky	E9L30	08/01/02-12/31/03	Head excursions higher than allowed by FMVSS 213 could result when installed as instructed with a long/serpentine belt path. Contact mfg. for replacement labels advising the use of an alternative short belt path.
221)	Husky	E9L30	Pre-07/24/04	The adjuster strap may slip within the metal buckle that controls the tightness of the shoulder harness and may allow the harness to loosen. Contact mfg. for repair kit.
222)	Marathon	E9L06	Pre-07/24/04	The adjuster strap may slip within the metal buckle that controls the tightness of the shoulder harness and may allow the harness to loosen. Contact mfg. for repair kit.
223)	Marathon	E9L06, E9W06, E906 with top tether lot # KGR 01 A	05/23/06- 07/28/06	The top tether hook may open and have the potential to release from the tether anchor if the child exceeds 50 pounds. Contact mfg. for repair kit.
224)	Regent	E9L39x	11/10/05-06/18/07	Consumer Advisory/Product Update - NOT A RECALL: Britax has modified the Regent and revised the installation instructions. Contact mfg. to receive a free product update kit that includes a revised user guide, replacement belt-routing label, a longer LATCH connector strap, and adhesive slip resistant strips.

Car Seat Recalls and Safety Notifications: MODELS 10 YEARS OLD AND OLDER

<i>List No.</i>	<i>Manufacturer Model Name</i>	<i>Model # ("X" = more numbers or letters follow)</i>	<i>Customer assistance Mfg Date</i>	<i>Problem Type and Consumer Action</i>
<i>Britax (continued)</i>				
225)	Regent Classic	E9L3998	12/18/06-01/18/07	Affected seats were produced with an incorrect airbag warning label attached to the cover. Contact mfg. to receive a free replacement cover.
226)	Roundabout	161	1/99-3/99	Possible faulty molding of shell can allow excessive head excursion. Call mfg. for repair info.
227)	Super Elite	E9031	04/25/01-02/15/02	Harness may allow too much forward head movement. Contact mfg. to receive a free replacement harness system.
228)	Super Elite	E9031	04/01/01-08/31/02	Harness adjuster tab may begin to stick after prolonged use. Harness may loosen if it sticks in the open position. Contact mfg. for repair kit and installation instructions.
229)	Traveller Plus	E9L32 (Mfg. by Britax for Snug Seat)	Pre-07/24/04	The adjuster strap may slip within the metal buckle that controls the tightness of the shoulder harness and may allow the harness to loosen. Contact mfg. for repair kit.
230)	Wizard	E9L07	Pre-07/24/04	The adjuster strap may slip within the metal buckle that controls the tightness of the shoulder harness and may allow the harness to loosen. Contact mfg. for repair kit.

Century Products**800-837-4044 / 216-468-2000**

231)	100	4100	1/81-4/81	Upholstery buttons. Call mfg. for repair info.
232)	100	4100	4/85-2/86	Plastic shell may crack in crash. Call mfg. for repair info.
233)	1000 STE	4153, 4163, 4180	12/90-10/91	Incorrect labels on seat. Call mfg. for corrections
234)	200	4200, 4210, 4235, 4214, 4223	1/81-4/81	Upholstery buttons. Call mfg. for repair info.
235)	200	4200, 4210, 4235, 4214, 4223	June 81	Washers on frame. Call mfg. for repair info.
236)	200	4200, 4210, 4235, 4214, 4223	1/81-1/83	Buckle. Call mfg. for repair info.
237)	200	4200, 4210, 4235, 4214, 4223	4/85-2/86	Plastic shell may crack in crash. Call mfg. for repair info.
238)	2000 STE	4253, 4263, 4265	4/84-6/89	Harness. Call mfg. for repair info.
239)	2000 STE	4253, 4261, 4263, 4265, 4266	12/90-10/91	Incorrect labels on seat. Call mfg. for corrections
240)	2000 STE	4253, 4261, 4263, 4265, 4266	12/91-4/92	Buckle. Call mfg. for repair info.
241)	300	4300, 4302, 4303, 4323, 4310, 4334, 4335	4/85-2/86	Plastic shell may crack in crash. Call mfg. for repair info.
242)	3000 STE	4365DT, 4366	3/89-10/89	Upholstery. Call mfg. for repair info.
243)	3000 STE	4353, 4365, 4366, 4368	5/90-6/90	Crash test failure of buckle. Call mfg. for repair info.
244)	3000 STE	4353, 4365, 4366, 4368	Pre 91	Buckle instructions. Call mfg. for corrections
245)	3000 STE	4365, 4366, 4367, 4368, 4369, 4380, 4381	12/90-10/91	Incorrect labels on seat. Call mfg. for corrections
246)	3000 STE	4353, 4365, 4366, 4367, 4368, 4369	10/89-4/92	Buckle. Call mfg. for repair info.

Car Seat Recalls and Safety Notifications: MODELS 10 YEARS OLD AND OLDER

<i>List No.</i>	<i>Manufacturer Model Name</i>	<i>Model # ("X" = more numbers or letters follow)</i>	<i>Customer assistance Mfg Date</i>	<i>Problem Type and Consumer Action</i>
<i>Century Products (continued)</i>				
247)	3500 STE	4380	12/90-4/92	Buckle. Call mfg. for repair info.
248)	4-In-1 Travel System	11-570, 11-597, 11-600, 11-650	9/95-5/96	Buckle. Call mfg. for repair info.
249)	4-In-1 Travel System	11-564, 11-565, 11-570, 11-575, 11-576, 11-578, 11-595, 11-597, 11-598, 11-599, 11-600	01/01/91-07/31/97	Handle can break when the seat is used as an infant carrier causing the infant to fall to the ground be injured. Does not affect safety as car seat. Call 800-865-1419 for replacement handle.
250)	400XL	4400, 4434, 4436, 4446	4/85-2/86	Plastic shell may crack in crash. Call mfg. for repair info.
251)	400XL	4400, 4434, 4436, 4446	11/84-4/86	Shield. Call mfg. for repair info.
252)	5000 STE	4450, 4460, 4475	12/88-11/89	Buckle. Call mfg. for repair info.
253)	5000 STE	4450, 4460, 4470, 4475	5/90-6/90	Crash test failure of buckle. Call mfg. for repair info.
254)	5000 STE	4460, 4470, 4475, 4476, 4480, 4490	12/90-10/91	Incorrect labels on seat. Call mfg. for corrections
255)	5000 STE	4450, 4460, 4470, 4475, 4476	09/89-4/92	Buckle. Call mfg. for repair info.
256)	5000 STE	4450, 4460, 4470, 4475,	Pre 91	Buckle instructions. Call mfg. for corrections.
257)	5500 STE	4480, 4490	01/91-4/92	Buckle. Call mfg. for repair info.
258)	580	4581, 4583, 4585	6/86-10/89	Screws for carry handle. Call mfg. for repair info.
259)	580	4580, 4581, 4583, 4585	7/86-12/89	Incorrect instructions. Call mfg. for corrections.
260)	Accel	45100, 45200, 45600, 45700	04/09/01- 05/10/01	Harness adjustment lock may allow webbing to slip during a serious crash when used in the forward facing mode for some models and lot codes. Call Century at 1-800-575-6097 for replacement info.
261)	Affinity Infant Seat	4575	9/95-5/96	Buckle. Call mfg. for repair info.
262)	Bravo	44622, 44630, 44631, 44662	04/09/01- 05/10/01	Harness adjustment lock may allow webbing to slip during a serious crash when used in the forward facing mode for some models and lot codes. Call Century at 1-800-575-6097 for replacement info.
263)	Brevera Contour	4875	2/95-7/98	Product improvement campaign: Buckle for the harness can crack or break. Call mfg. for replacement information.
264)	Brevera Premiere	4885	2/95-7/98	Product improvement campaign: Buckle for the harness can crack or break. Call mfg. for replacement information.
265)	Child Love Seat	4600	3/84-11/84	Plastic shell may develop cracks. Destroy & replace seat.
266)	Encore	44612, 4662	04/09/01-05/10/01	Harness adjustment lock may allow webbing to slip during a serious crash when used in the forward facing mode for some models and lot codes. Call Century at 1-800-575-6097 for replacement info.
267)	Infant Car Seat	4535, 4560, 4565, 4590	9/95-5/96	Buckle. Call mfg. for repair info.
268)	Infant Car Seat	12-565, 4513, 4515, 4516, 4518, 4551, 4557, 4558, 4559, 4564, 4565, 4566, 4568, 4569, 4575, 4576, 4589, 4591, 4593, 4594, 4595, 4597	01/01/91-07/31/97	Handle can break when the seat is used as an infant carrier causing the infant to fall to the ground be injured. Does not affect safety as car seat. Call 800-865-1419 for replacement handle.
269)	Infant Love seat	4500, 4510, 4520	1/81-12/82	Plastic shell may develop cracks. Destroy & replace seat.
270)	Smart Fit	4525	9/95-5/96	Buckle. Call mfg. for repair info.

Car Seat Recalls and Safety Notifications: MODELS 10 YEARS OLD AND OLDER

<i>List No.</i>	<i>Manufacturer Model Name</i>	<i>Model # ("X" = more numbers or letters follow)</i>	<i>Mfg Date</i>	<i>Customer assistance Problem Type and Consumer Action</i>
Century Products (continued)				
271)	Smart Move	4750	11/95-2/96	Buckle. Call mfg. for repair info.
272)	Smart Move	44709	04/09/01- 05/10/01	Harness adjustment lock may allow webbing to slip during a serious crash when used in the forward facing mode for some models and lot codes. Call Century at 1-800-575-6097 for replacement info.
Chrysler				
ALL MODELS OLDER THAN 10 YEARS - REPLACEMENT PROGRAM DISCONTINUED - DESTROY & REPLACE				
273)	Child Love Seat	All	3/84-11/84	Plastic shell may develop cracks. Destroy & replace seat.
Collier-Keyworth				
			800-544-1108	
274)	Co-Pilot	All	82-83	Shield. Call mfg. for repair info.
275)	Safe & Sound II	All	12/84-4/85	Buckle. Call mfg. for repair info.
276)	Commuter	All	10/87-02/88	Padding. Call mfg. for repair info.
Combi USA				
			800-992-6624 / 803-548-6633 - www.combi-intl.com	
277)	Avatar	8100	11/12/03-05/07/04	Lower latch anchorage does not meet dynamic test requirements of FMVSS 213. Contact mfg. for free in-home repair kit and instructions. Affected models should be installed with the vehicle seat belt. Do not use the seat with the latch until repairs are made.
278)	Centre ST Centre DX Centre EX Centre ARB	8065 8074 8086 8520	10/19/05-12/15/07	The car seat could potentially become separated from its base in a crash. Mfg. recommends that the car seat be used without the base until it has been fixed. Contact mfg for free retrofit kit. Also affected are travel systems (# 4400, 4515, and 4520) that contain the Centre and Shuttle car seats.
279)	Shuttle	8087	10/19/05-12/15/07	The car seat could potentially become separated from its base in a crash. Mfg. recommends that the car seat be used without the base until it has been fixed. Contact mfg for free retrofit kit. Also affected are travel systems (# 4400, 4515, and 4520) that contain the Centre and Shuttle car seats.
Compass Baby				
			888-899-2229 - www.compassbaby.com	
280)	Infant Car Seat	1420 ARD 1420 FUO 1420 MAR	05/07/06, 05/13/06, and 05/15/06	The metal slide crotch anchor can become dislodged allowing excessive movement of the child and cracking of the plastic shell. This problem was discovered during testing by the manufacturer. There have been no reports of injuries and no calls from consumers regarding problems. Contact mfg. for free repair kit.
Cosco (Dorel)				
Dorel Juvenile Group: 800-219-0509 / 866-611-3022 / 812-372-0141				
281)	Alpha Omega	02-331, 02-332, 02-531, 02-533, 02-537, 02-555.	11/17/00- 01/10/01	Tether webbing could be cut and separate in a crash allowing excessive movement of the child. Contact mfg. for free repair kit.
282)	Alpha Omega	02332, 02531, 02533, 02537, 02555	01/01/00-09/30/01	Tether webbing does not conform to abrasion requirements of FMVSS 213. Contact mfg. for free repair kit.
283)	Alpha Omega Alpha Omega Elite	22150, 22180, 22269 22155	11/01/03-12/31/05	There is a potential for the harness adjustment strap to loosen during use. Contact mfg. for free repair kit.
284)	Arriva	02-751	03/95-05/95	Buckle. Call mfg. for repair info.

Car Seat Recalls and Safety Notifications: MODELS 10 YEARS OLD AND OLDER

<i>List No.</i>	<i>Manufacturer Model Name</i>	<i>Model # ("X" = more numbers or letters follow)</i>	<i>Customer assistance Mfg Date</i>	<i>Problem Type and Consumer Action</i>
Cosco (Dorel) (continued)				
285)	Arriva	02-729 TED	03/31/99- 04/07/99	Airbag warning label is missing on seat pad. Fabric color noted by "TED" is only one affected. Call mfg. for replacement pad.
286)	Arriva	02-665, 02-727, 02-728, 02-729, 02-731, 02-732, 02-733, 02-750, 02-751, 02-755, 02-756, 02-757, 02-774	03/01/95-01/31/00	Handle locks can unexpectedly release when used as a carrier, causing the seat to flip forward. Does not affect safety as car seat. Call mfg. for repair info. [Note: a recall campaign initiated 06/25/03 added models made through 01/31/00 to a previous recall of those made through 09/97.]
287)	Commuter	02-086	11/87-2/88	Upholstery/padding. Call mfg. for repair info.
288)	Designer 22	22-300-JOS GB1B	08/19/03-10/20/04	Harness can loosen if not properly tightened. Contact mfg. for free repair kit. Parents should continue to use the seat while waiting to receive/install the repair kit but are advised to make sure that the seat is properly adjusted while in use. NOTE: Models involved were sold only as travel systems (with a stroller) and any line code other than GB1B in the model # is not included in the recall.
289)	Dream Ride	02-719 ARQ	01/89-01/94	Upholstery flammability. Call mfg. for repair info.
290)	Dream Ride	22-001FSM	12/01/03-04/28/04	Failed to meet back support angle requirements of FMVSS 213. Discontinue rear-facing use and use only as a car bed or request free replacement rear-facing child restraint from DJG. Contact mfg. for warning label and information.
291)	Hi Back Booster	02409, 02442, 02443, 02445, 02448, 02449, 02450, 02480, 02495	01/01/00-09/30/01	Tether webbing does not conform to abrasion requirements of FMVSS 213. Contact mfg. for free repair kit.
292)	Hi Back Booster	02442, 02443, 02448, 93443, 93514	03/15/02-08/01/02	UV stabilizer in harness webbing does not conform to requirements of FMVSS 213. Contact mfg. for free repair kit.
293)	High Rise Booster	22-297, 22-298, 22-299	10/01/03-10/31/03	Incorrect warning label stating it is for use forward facing for children under one year of age rather than OVER one year of age. Contact mfg. for free replacement label and instructions.
294)	Luxury Soft Shield Auto Trac	02-790, 02-890	10/89-6/90	Crash test failure. Call mfg. for repair info.
295)	Regal Ride	22139MON	09/28/04-09/20/07	Elastic straps on padding can come loose and become accessible to the child allowing the child to loop the elastic strap around portions of his/her body. Contact mfg. for repair kit.
296)	Safe-T-Shield	81A or B, 181A or B	10/80-6/83	Shield. Call mfg. to replace seat.
297)	Safe-T-Mate		1984	Wrong instructions. Call mfg. for repair info.
298)	Safe and Easy	313	1/84-6/85	Plastic shell. Call mfg. for repair info.
299)	Safe and Snug	323, 423	1/84-6/85	Plastic shell. Call mfg. for repair info.
300)	Sidekick Booster	244x	04/96-5/97	Crash test failure of shield. Use only as belt-positioning booster. Call mfg. for refund info.
301)	Soft Shield	02-090	10/89-6/90	Crash test failure. Call mfg. for repair info.
302)	Soft Shield Auto Trac	02-290	10/89-6/90	Crash test failure. Call mfg. for repair info.
303)	Soft Shield Deluxe	02-190	10/89-6/90	Crash test failure. Call mfg. for repair info.
304)	Touriva	02-084	5/94-8/94	Buckle. Call mfg. for repair info.

Car Seat Recalls and Safety Notifications: MODELS 10 YEARS OLD AND OLDER

<i>List No.</i>	<i>Manufacturer Model Name</i>	<i>Model # ("X" = more numbers or letters follow)</i>	<i>Customer assistance Mfg Date</i>	<i>Problem Type and Consumer Action</i>
<i>Cosco (Dorel) (continued)</i>				
305)	Touriva Shield	02-014-EMF, 02-014-GDM, 02-015-PDL	8/97 (Mold #3)	Crash test failure of shell in front-facing recline position. Call mfg. for repair info.
306)	Touriva 5-point	02-514-BWE, 02-584-OXF, 02-518-NDF	8/97 (Mold #3)	Crash test failure of shell in front-facing recline position. Call mfg. for repair info.
307)	Touriva T-Shield	02-084, 02-094, 02-096, 02-404, 02-821	5/96-11/97	Crash test failure of post-test release pressure standard for the buckle. Call mfg. for repair info.
308)	Touriva	02014, 02015, 02019, 02084, 02094, 02114, 02504, 02514, 02518, 02519, 02524, 02584, 02803, 02806, 02821, 02825, 02935, 93084, 93094, 93514	01/01/00-09/30/01	Tether webbing does not conform to abrasion requirements of FMVSS 213. Contact mfg. for free repair kit.
309)	Touriva	02514, 02519, 02524, 22100, 93446, 93504	03/15/02-08/01/02	UV stabilizer in harness webbing does not conform to requirements of FMVSS 213. Contact mfg. for free repair kit.
310)	Touriva	22100x, 22111x, 22130x, 93100x, 93111x	09/28/04-09/20/07	Elastic straps on padding can come loose and become accessible to the child allowing the child to loop the elastic strap around portions of his/her body. Contact mfg. for repair kit.
311)	Trooper	219x, 224x, 225x, 229x	10/96-2/97	Crash test failure. Call mfg. for repair info.
312)	Turnabout	02-667, 02-753, 02-756, 02-758, 02-759, 02-760, 02-761, 02-762, 02-763, 02-764, 02-765, 02-770, 02-771, 02-772	03/01/95-01/31/00	Handle locks can unexpectedly release when used as a carrier, causing the seat to flip forward. Does not affect safety as car seat. Call mfg. for repair info. [Note: a recall campaign initiated 06/25/03 added models made through 01/31/00 to a previous recall of those made through 09/97.]
313)	Voyager Infant Seat/Stroller	All	9/97-10/97	Potential dislodgement from stroller. Does not affect safety as car seat. Call mfg. for repair info.

Downunder***ALL MODELS OLDER THAN 10 YEARS - NO LONGER IN BUSINESS - DESTROY & REPLACE***

314)	Kangaroo Booster Seat	All (Pre- 1/98)		Safety improvement campaign: The shoulder belts may not be properly located when the child is placed in the restraint. The shoulder belt guides may not help achieve correct seat belt placement. Do not use this booster if the shoulder belt does not touch the child's chest.
------	-----------------------	-----------------	--	--

Eddie Bauer (Dorel)***Dorel Juvenile Group: 800-219-0509 / 866-611-3022 / 812-372-0141
www.djgusa.com***

315)	3-in-1	02-331, 02-332, 02-531, 02-533, 02-537, 02-555	11/17/00-01/10/01	Tether webbing could be cut and separate in a crash allowing excessive movement of the child. Contact mfg. for free repair kit.
316)	3-in-1 Deluxe 3-in-1 Deluxe Convrt.	22740, 22750, 22755, 22756, 22757, 22770	11/01/03-12/31/05	There is a potential for the harness adjustment strap to loosen during use. Contact mfg. for free repair kit.
317)	Alpha Omega Alpha Omega Elite	22750, 22755, 22756, 22757, 22770	11/01/03-12/31/05	There is a potential for the harness adjustment strap to loosen during use. Contact mfg. for free repair kit.

Car Seat Recalls and Safety Notifications: MODELS 10 YEARS OLD AND OLDER

List No.	Manufacturer Model Name	Model # ("X" = more numbers or letters follow)	Mfg Date	Customer assistance Problem Type and Consumer Action
Eddie Bauer (continued)				
318)	Comfort Infant Seat	22630xxx, 22631xxx	07/26/05-02/28/06	Trim screws on handle can loosen resulting in a potential choking hazard. Contact mfg. at 877-229-1374 for free repair kit. Make sure the handle trim screws are tight and continue to use the existing seat while waiting to receive and install the repair kit. (The 22630 models are part of the 01726 Eddie Bauer Integrated Travel System.)
319)	Comfort Infant Seat	22630xxx, 22631xxx	07/26/05-02/28/06	Some consumers have experienced difficulty installing the base in certain vehicles. Dorel will replace the original version of the base at no charge to the customer. Contact mfg. at 877-229-1374 to determine eligibility for a replacement base.
320)	Designer 22	22-625 xxx GB1B	08/19/03-10/20/04	Harness can loosen if not properly tightened. Contact mfg. for free repair kit. Parents should continue to use the seat while waiting to receive/install the repair kit but are advised to make sure that the seat is properly adjusted while in use. NOTE: Models involved were sold only as travel systems (with a stroller) and any line code other than GB1B in the model # is not included in the recall.
321)	Enspira	22740	11/01/03-12/31/05	There is a potential for the harness adjustment strap to loosen during use. Contact mfg. for free repair kit.
322)	Hi Back Booster	02409, 02442, 02443, 02445, 02448, 02449, 02450, 02480, 02495	01/01/00-09/30/01	Tether webbing does not conform to abrasion requirements of FMVSS 213. Contact mfg. for free repair kit.
323)	Touriva	02870, 02871, 02875	01/01/00-09/30/01	Tether webbing does not conform to abrasion requirements of FMVSS 213. Contact mfg. for free repair kit.
<hr/>				
Evenflo			800-525-2472 / 800-233-5921	
324)	410	410	6/88-4/89	Harness/shield. Call mfg. for repair info.
325)	Bobby Mac Champion	411	4/85-4/90	Buckle. Call mfg. for repair info.
326)	Bobby Mac Deluxe	412, 414, 415, 416	4/85-4/90	Buckle. Call mfg. for repair info.
327)	Booster Seat	470, 471	2/87-8/88	Upholstery buttons. Call mfg. for repair info.
328)	Booster Seat	242, 470, 471	4/85-4/90	Buckle. Call mfg. for repair info.
329)	Champion	224x	06/93-11/96	Crash test failure. Call mfg. for repair info.
330)	Champion	224x	06/93-11/96	Crash test failure. Call mfg. for repair info.
331)	Champion	219x, 224x, 225x, 229x	10/96-2/97	Crash test failure. Call mfg. for repair info.
332)	Cozy Carry	272x, 273x, 468x, 469x, 476x, 477x, 478x, 480x, 481x	ALL (11/01/01-08/31/02)	Upgrade Kit - Not a Recall: For owners of Cozy Carry infant car seats to improve the performance of the detachable base in certain types of collisions. The kit is only for detachable bases with the words "Cozy Carry" on them. Visit www.cozycarry.com or call 800-582-6698 for free kit.
333)	Dyn-O-Mite	441 thru 448	1/85-1/89	Crash test failure. Call mfg. for repair info.
334)	Dyn-O-Mite	202, 441 thru 448	4/85-4/90	Buckle. Call mfg. for repair info.
335)	Embrace	Begins with 317, 320, 397, 398, 540, 548, 549, 550, 556, 597, 598, 599	Pre- 04/08/06	When used as an infant carrier, the handle can unexpectedly release, causing the seat to rotate forward. Handle should not be used until the repair kit has been installed. Affected restraints can continue to be used as a car seat properly installed in a vehicle. Contact mfg. for a free repair kit.
336)	Infant Car Seat	456, 458	Pre 4/89	Crash test failure. Call mfg. for repair info.

Car Seat Recalls and Safety Notifications: MODELS 10 YEARS OLD AND OLDER

<i>List No.</i>	<i>Manufacturer Model Name</i>	<i>Model # ("X" = more numbers or letters follow)</i>	<i>Customer assistance Mfg Date</i>	<i>Problem Type and Consumer Action</i>
<i>Evenflo (continued)</i>				
337)	Infant Car Seat	201, 202, 441 thru 446, 448, 456, 458	4/85-4/90	Buckle. Call mfg. for repair info.
338)	Joyride	Begins with 203, 205, 210, 435, 493	01/88-12/98	When used as an infant carrier, the carry handle can unexpectedly release, cause the seat to flip forward, and cause infant to fall to the ground. Call mfg. for repair info.
339)	On My Way	Begins with 206	05/94-05/95	Crash test failure. Call mfg. for repair info.
340)	On My Way	Begins with 207, 492	12/95-07/97	When used as a carrier, the locking mechanism on the handle can slip, flipping the seat forward and tossing the baby on the ground. Call mfg. for repair info.
341)	On My Way	Begins with 200, 211, 447, 499	Pre- 02/10/00	Safety Notification: Alignment posts in base can become bent after repeated use. Contact mfg. for free upgrade kit.
342)	On My Way base	639001, 639002	Pre- 02/10/00	Safety Notification: Alignment posts in base can become bent after repeated use. Contact mfg. for free upgrade kit.
343)	One-Step	221, 401 thru 409	04/85-04/90	Buckle. Call mfg. for repair info.
344)	One-Step Deluxe	222, 223, 4176	04/85-04/90	Buckle. Call mfg. for repair info.
345)	Scout	229x	06/93-12/96	Crash test failure. Call mfg. for repair info.
346)	Scout	219x, 224x, 225x, 229x	10/96-02/97	Crash test failure. Call mfg. for repair info.
347)	Seven Year Seat	453, 454	02/87-08/88	Upholstery buttons. Call mfg. for repair info.
348)	Seven Year Seat	228, 453, 454	04/85-04/90	Buckle. Call mfg. for repair info.
349)	Travel Tandem (Joyride + base)	205x	01/88-03/96	Test failure with base. Use without base and call mfg. for repair info.
350)	Travel Tandem (Joyride + base)	205x, 210x	01/88-12/98	When used as an infant carrier, the carry handle can unexpectedly release, cause the seat to flip forward, and cause infant to fall to the ground. Call mfg. for repair info.
351)	Tribute	378x, 379x	09/08/05-09/22/05	Certain areas of the plastic shell may be prone to stress fractures. Call mfg. to receive a replacement seat.
352)	Triumph	264x	10/20/01-01/31/02	Slide loop connectors in the harness may not be strong enough to fully secure the child in a crash. Call mfg. for repair kit.
353)	Triumph	264x, 359x, 389x	09/06/01-10/31/05	Portions of the cloth cover can be pulled back exposing the foam liner in an area that is reachable by a child occupant. A child inside the seat may break off and potentially choke on a piece of the foam liner. Contact mfg. for repair kit.
354)	Trooper (shield)	21940, 219164, 219180, 219186, 219188	11/95-1/96	Instructions. Call mfg. for new instructions
355)	Two-in-One	636x, 637x	1/98-3/98	In crash tests, the seat's backrest and base have separated when 5-point harness was being used. Call mfg. for information and replacement seat.
356)	Ultara 1	420	9/88-7/89	Buckle. Call mfg. for repair info.
357)	Ultara 1	231	2/93-8/93	Plastic sleeve on harness. Call mfg. for repair info.
358)	Ultara II	227	1/90-6/90	Crash test failure. Call mfg. for repair info.
359)	Ultara II	232	2/93-8/93	Plastic sleeve on harness. Call mfg. for repair info.

Car Seat Recalls and Safety Notifications: MODELS 10 YEARS OLD AND OLDER

<i>List No.</i>	<i>Manufacturer Model Name</i>	<i>Model # ("X" = more numbers or letters follow)</i>	<i>Mfg Date</i>	<i>Customer assistance Problem Type and Consumer Action</i>
Fisher Price		ALL MODELS OLDER THAN 10 YEARS - DESTROY & REPLACE		
360)	Car Seat	9100	Pre-1987	Harness/shield. Call mfg. for repair info.
361)	Car Seat	9100, 9101	4/85-1/89	Upholstery. Call mfg. for repair info.
362)	Car Seat	9100, 9101	2/90-3/90	Buckle. Call mfg. for repair info.
363)	Car Seat	9100	4/85-8/85	Shield. Call mfg. for repair info.
364)	Car Seat	9100, 9101	5/87-1/89	Buckle. Call mfg. for repair info.
365)	Car Seat	9100, 9101	2/89-11/89	Buckle (extended 5/87-1/89). Call mfg. for repair info.
366)	Car Seat	9100, 9101	Pre 91	Loose button. Call mfg. for repair info.
367)	Car Seat	9100, 9101	2/91-1/92	Harness/shield. Call mfg. for repair info.
368)	Car Seat	9100, 9101	Pre 7/89	Label on shield. Call mfg. for repair info.
369)	Delux Car Seat	9104	6/15-9/92	Buckle. Call mfg. for repair info.
370)	Infant Seat	9149	1/91-2/91	Shield. Call mfg. for repair info.
371)	Infant Seat	9173	9/94-10-94	Air bag label. Call mfg. for repair info.
372)	Booster	9104	4/92-9/92	Buckle. Call mfg. for repair info.
373)	Booster	9104	4/92-9/92	Buckle. Call mfg. for repair info.
374)	Safe Embrace	79700	5/97-3/98	Harness adjuster. Call mfg. for repair info.
Ford		ALL MODELS OLDER THAN 10 YEARS - REPLACEMENT PROGRAM DISCONTINUED - DESTROY & REPLACE		
375)	Infant Love Seat	All	81/82	Plastic shell may develop cracks. Destroy & replace seat.
General Motors		ALL MODELS OLDER THAN 10 YEARS - REPLACEMENT PROGRAM DISCONTINUED - DESTROY & REPLACE		
376)	Infant Love Seat	All	81/82	Plastic shell may develop cracks. Destroy & replace seat.
377)	Child Love Seat	All	3/84-11/84	Plastic shell may develop cracks. Destroy & replace seat.
Gerry		Contact Evenflo: 800-525-2472 / 800-233-5921		
378)	Guardian	All	01/90-05/90	Buckle. Call mfg. for repair info.
379)	Secure Ride	626	08/94-03-95	Air bag label. Call mfg. for new label
Graco		800-345-4109 / www.gracobaby.com		
380)	ComfortSport	8629x, 8630x, 8631x, 8632x, 8635x, 8639x, 8C00x, 8C01x, 8C02x, 8C03x, 8C04x, 8433x	01/02/07-07/31/07	Lower Anchorage belt may have been misrouted during assembly process. Use the vehicle seatbelt instead of LATCH to install affected models in the rear-facing position until it is inspected and, if necessary, corrected. Call mfg. or visit gracobaby.com website for additional info.
381)	ComfortSport	8C02MRC2	10/22/07	Seats were produced with foam thicker than specified and tested 1" thick foam. It is unclear as to what impact thicker foam will have on child seat safety. Call mfg. for seat replacement information.
382)	ComfortSport	8C04FRR, 8C04FRR2	11/01/06-10/08/07	Seats were equipped with a large supplemental "body pillow" that partially obscures the child airbag warning label on the seat pad. Graco will instruct users to discard the supplemental pillows since they are provided for comfort only. Contact mfg. for additional information.

Car Seat Recalls and Safety Notifications: MODELS 10 YEARS OLD AND OLDER

<i>List No.</i>	<i>Manufacturer Model Name</i>	<i>Model # ("X" = more numbers or letters follow)</i>	<i>Mfg Date</i>	<i>Customer assistance Problem Type and Consumer Action</i>
Graco (continued)				
383)	GT 1000	All	1/85-1/86	Crash test failure. Call mfg. for repair info.
384)	SnugRide	7493, 7497, 7499, 841101, 841102, 841103, 841203, 8412T02, 8457, 8458, 8459, 8460, 8462, 8471, 8472, 8473, 8474, 8476, 8477, 8478	08/31/99-02/28/02	May be missing 1 or 2 metal hooks and their retainer pins on the base of the carrier shell or the "U" shaped bars on the carrier shell that are used to attach the carrier to the base. If the hooks, pins or "U" bars are missing, the carrier may not be securely attached to the base and the carrier could detach from the base in the event of a sudden stop or crash. Call Graco to receive a free replacement seat or base. NOTE: All affected model numbers may also begin with the letter "A" and/or also be followed by letters.
385)	SnugRide	8402, 8402L, 8403x, 8412, 8442x, 8443, 8443L, 8444, 8444L, 8446, 8446L, 8447, 8447L, 8448, 8448L, 8457, 8458, 8459, 8463x, 8464, 8470, 8471, 8478, 8601, 8602x, 8603M, 8605x, 8607x, 8608D, C844342	03/01/02-03/08/03	May have missing hardware used to attach the carrier to the base. Contact mfg. at 866-473-0163 or www.gracobaby.com for inspection and repair information. All models can safely be installed without the base. [NOTE: The initial 03/12/03 recall campaign for this problem included models manufactured through 03/06/03. A recall extension announced 08/13/03 added models manufactured through 03/08/03.]
386)	SnugRide	8609x, 8616x, 8643x, 8645x, 8646x	08/01/06-06/30/07	The backing of the seat pad may pull away from the seams in an area reachable to the child occupant, exposing the pad filling and posing a potential choking hazard. Contact mfg. For repair kit.
International		ALL MODELS OLDER THAN 10 YEARS - NO LONGER IN BUSINESS - DESTROY & REPLACE		
387)	Astroseat	All	12/80-7/81	Buckle. Destroy & replace seat.
Kolcraft		ALL MODELS OLDER THAN 10 YEARS - NO LONGER IN BUSINESS - DESTROY & REPLACE		
388)	Automate	180-600, 180-601	Pre 4/93	Buckle. Call mfg. for repair info.
389)	Carter Travel 5	13833, 13842, 13852	5/96-9/96	Crash test failure of buckle. Call mfg. for repair info.
390)	Dial-A-Fit	180-200, 180-300	1/87-8/89	Upholstery clips. Call mfg. for repair info.
391)	Dial-A-Fit	180-200, 180-300	10/88-8/89	Crash test failure. Call mfg. for repair info.
392)	Dial-A-Fit II	180-600	11/90-8/91	Crash test failure. Call mfg. for repair info.
393)	Infant Car Seat	1383x	1/93-6/99	Carrier handle can release and allow the seat to rotate. Does not affect safety as car seat. Call mfg. for repair info.
394)	Infant Restraint	43xxx	1/93-6/99	Carrier handle can release and allow the seat to rotate. Does not affect safety as car seat. Call mfg. for repair info.
395)	Infant Rider	138xx, 368xx	3/96-8/96	Crash test failure of buckle. Call mfg. for repair info.
396)	Infant Rider	1312x, 1382x, 1383x, 368xx	1/93-6/99	Carrier handle can release and allow the seat to rotate. Does not affect safety as car seat. Call mfg. for repair info.
397)	Flip 'N' Go	19127 thru 19130	1/85-3/87	Shield. Call mfg. for repair info.
398)	Flip 'N' Go II	19127	1/85-3/88	Shield. Call mfg. for repair info.
399)	Perfect Fitt	180-100, 180-150	Pre 4/90	Upholstery clips. Call mfg. for repair info.

Car Seat Recalls and Safety Notifications: MODELS 10 YEARS OLD AND OLDER

<i>List No.</i>	<i>Manufacturer Model Name</i>	<i>Model # ("X" = more numbers or letters follow)</i>	<i>Mfg Date</i>	<i>Customer assistance Problem Type and Consumer Action</i>
Kolcraft (continued)				
400)	Perfect Fitt	180-150, 180-200	3/89-10/90	Crash test failure. Call mfg. for repair info.
401)	Perfect Fitt	180-200	Pre 10/90	Upholstery. Call mfg. for repair info.
402)	Performa	All	3/96-10-96	Upholstery. Call mfg. for repair info.
403)	Performa	All	1/96-7/97	Buckle release force. Call mfg. for repair info.
404)	Playskool Car Seat	140-155, 180-400	12/89-8/90	Upholstery. Call mfg. for repair info.
405)	Playskool Car Seat	77001, 77002	1/91-6/93	Buckle. Call mfg. for repair info.
406)	Playskool Infant Car Seat	77005, 77007	1/93-6/99	Carrier handle can release and allow the seat to rotate. Does not affect safety as car seat. Call mfg. for repair info.
407)	Plus 4	138xx, 368xx	3/96-8/96	Crash test failure of buckle. Call mfg. for repair info.
408)	Plus 4	1382x, 1383x, 1384x, 368xx	1/93-6/99	Carrier handle can release and allow the seat to rotate. Does not affect safety as car seat. Call mfg. for repair info.
409)	Plus 5	138xx, 368xx	3/96-8/96	Crash test failure of buckle. Call mfg. for repair info.
410)	Plus 5	13833, 13842, 13852	5/96-9/96	Crash test failure of buckle. Call mfg. for repair info.
411)	Plus 5	1382x, 1383x, 1384x, 1385x, 368xx	1/93-6/99	Carrier handle can release and allow the seat to rotate. Does not affect safety as car seat. Call mfg. for repair info.
412)	Rock 'N' Ride	13123	2/85-6/85	Plastic shell. Call mfg. to replace seat.
413)	Rock 'N' Ride	131-101	Pre 3/90	Upholstery clips. Call mfg. for repair info.
414)	Secura	43xxx	1/93-6/99	Carrier handle can release and allow the seat to rotate. Does not affect safety as car seat. Call mfg. for repair info.
415)	Secure Fit	All	1/96-7/97	Buckle release force. Call mfg. for repair info.
416)	Travel About	138xx, 368xx	3/96-8/96	Crash test failure of buckle. Call mfg. for repair info.
417)	Travel About	13833, 13842, 13852	5/96-9/96	Crash test failure of buckle. Call mfg. for repair info.
418)	Travel-About	1382x, 1383x, 1384x, 1385x	1/93-6/99	Carrier handle can release and allow the seat to rotate. Does not affect safety as car seat. Call mfg. for repair info.
419)	Traveler 700	All	11/01/94-12/31/95	Voluntary action: Buckle concerns. Call mfg. for repair info.
420)	Traveler 700	150-100	1/91-8/91	Cracks in plastic. Call mfg. to replace seat.
421)	Traveler 700	All	1/91-6/93	Rusting of buckle. Call mfg. for repair info.
Lin Lih/MCP Ent.				
ALL MODELS OLDER THAN 10 YEARS - REPLACEMENT PROGRAM DISCONTINUED - DESTROY & REPLACE				
422)	Lin Lih	All	ALL	Counterfeit seat. Call NHTSA: 800-424-9393
423)	Lin Lih	180-200, 180-300	10/88-8/89	Crash test failure. Call NHTSA: 800-424-9394
Mia Moda				
866-642-6632 - www.miamodainc.com				
424)	Viva	5000 (seat), 5001 (base)	12/19/06-02/06/07	The lower anchor connector adjuster assembly may interfere with the connection of the infant carrier to the restraint base when installed using LATCH. Installation with seat belt is not affected. In addition, registration cards were not provided with the Viva or separately sold bases. Contact mfg. For repair kit and to register CR with mfg.

Car Seat Recalls and Safety Notifications: MODELS 10 YEARS OLD AND OLDER

<i>List No.</i>	<i>Manufacturer Model Name</i>	<i>Model # ("X" = more numbers or letters follow)</i>	<i>Mfg Date</i>	<i>Customer assistance Problem Type and Consumer Action</i>
Mercedes-Benz USA		800-367-6372 - www.mbusa.com		
425)	Booster	BQ6910157, BQ6910163	02/01/97-07/31/99	BabySmart airbag deactivation device may not automatically deactivate the passenger airbag. Contact mfg. for free replacement seat and instructional video.
426)	Infant Restraint	BQ6910155	02/01/97-07/31/99	BabySmart airbag deactivation device may not automatically deactivate the passenger airbag. Contact mfg. for free replacement seat and instructional video.
Mercedes-Benz USA (continued)				
427)	Kiddy TopSafe (mfg. by Sicartex)	B66868203 B66868204 B66868209	03/01/03-11/30/03	Lower LATCH attachment may not be strong enough to hold in the event of a crash. Immediately replace with another model and return Kiddy Top seat to Mercedes-Benz dealer for refund. Install with vehicle seat belt until replacement is obtained. Contact Mercedes-Benz for further information.
Peg Perego USA		877-737-3468 / 219-482-8191 - www.perego.com		
428)	Primo Viaggio	CS00MU1, CS00US1, CS00US8	02/01/01-06/10/01	The latch mechanism securing the seat to the base does not completely engage on a small number of seats due to improper positioning of the metal reinforcement bracket. Call mfg. for repair info. Note: Primo Viaggio infant seat sold separately and with strollers as part of Pliko and Primo Viaggio Travel Systems.
429)	Primo Viaggio	CS00MU1, CS00US1, CS00US8, LV34USL, LV34USN, LN34S09, LN34S10, ST33USL, ST33USN, ST38USL, ST38USN, AL33USL, AL33USN, AL34USN, AL34USL	05/20/01-02/15/02	The harness adjustment/locking mechanism may not fully lock and allow the harness to slip. The strap tension adjuster cover of affected models have a red circle around a dark button. Contact mfg. for full identification and repair information. Note: Primo Viaggio infant seat sold separately and with strollers as a part of Pliko, Primo Viaggio, and Atlantico Travel Systems.
Playskool		Contact Kolcraft: 800-453-7673		
430)	Car Seat	140-155, 180-400	12/89-8/90	Upholstery. Call Kolcraft
431)	Car Seat	77001, 77002	1/91-6/93	Buckle. Call Kolcraft
432)	Infant Car Seat	77005, 77007	1/93-6/99	Carrier handle can release and allow the seat to rotate. Does not affect safety as car seat. Call mfg. for repair info.
Pride Trimble/Virco		800-521-5198		
433)	Click-n-Go	890, 891, 892	2/86-10/87	Crash test failure. Call mfg. to replace seat.
434)	Click-n-Go	890, 891, 892	1/88-4/89	Crash test failure. Call mfg. to replace seat.
435)	Pride Ride	832	1/88-4/89	Crash test failure. Call mfg. to replace seat.
Questor		Contact Evenflo: 800-233-5921		
436)	Kantwet Car Seat	All	5/69-3/73	May pinch child's fingers. Call mfg. for repair info.

Car Seat Recalls and Safety Notifications: MODELS 10 YEARS OLD AND OLDER

<i>List No.</i>	<i>Manufacturer Model Name</i>	<i>Model # ("X" = more numbers or letters follow)</i>	<i>Mfg Date</i>	<i>Customer assistance Problem Type and Consumer Action</i>
Recaro		888-973-2276 / 800-873-2276 / 248-364-3818/ - www.recaropromotion.com		
437)	Como	331.00.xxx	Pre- 09/17/07	Consumer Advisory - Not a Recall: Lap and shoulder belt guide (previously referred to as "lock-off") may not hold belt webbing snugly enough to prevent belt from loosening. Contact mfg. for locking clip and instructions included as a part of the consumer advisory.
438)	Como	331.00.xxx	Pre- 12/18/07	The harness may become disconnected from the harness connector when a child is placed in or removed from the child seat. Contact mfg. for repair kit.
439)	Signo	331.00.xxx	Pre- 12/18/07	The harness may become disconnected from the harness connector when a child is placed in or removed from the child seat. Contact mfg. for repair kit.
Renolux (FBS)		ALL MODELS OLDER THAN 10 YEARS - NO LONGER IN BUSINESS - DESTROY & REPLACE		
440)	GT 1000	All	8/88-10/88	Buckle/recline angle. Destroy & replace seat.
441)	GT 2000	All	8/88-10/88	Buckle/recline angle. Destroy & replace seat.
442)	GT 2000	All	1/92-1/93	Foam padding failed HIC (head injury) limits. Destroy & replace seat.
443)	GT 2000	All	5/89-6/93	Flammability of upholstery. Destroy & replace seat.
444)	GT 4000	All	1/92-1/93	Foam padding failed HIC (head injury) limits. Destroy & replace seat.
445)	GT 4000	All	5/89-6-93	Flammability of upholstery. Destroy & replace seat.
446)	GT 5000	All	1/92-1/93	Foam padding failed HIC (head injury) limits. Destroy & replace seat.
447)	GT 5000	All	5/89-6-93	Flammability of upholstery. Destroy & replace seat.
448)	GT 5000 Turn A Tot	All	2/90-4/91	Test failure/upholstery. Destroy & replace seat.
449)	GT 5000 Turn A Tot	All	1/92-1/93	Foam padding failed HIC (head injury) limits. Destroy & replace seat.
450)	GT 5000 Turn A Tot	All	5/89-6-93	Flammability of upholstery. Destroy & replace seat.
451)	GT 5500	All	1/92-1/93	Foam padding failed HIC (head injury) limits. Destroy & replace seat.
452)	GT 5500	All	5/89-6-93	Flammability of upholstery. Destroy & replace seat.
453)	GT 7000	All	All	Remote may overheat/ fire hazard. Destroy & replace seat.
454)	GT 7000	All	1/92-1/93	Foam padding failed HIC (head injury) limits. Destroy & replace seat.
455)	GT 7000	All	5/89-6-93	Flammability of upholstery. Destroy & replace seat.
Safeline Kids		800-829-1625 - www.tripleplayproducts.com		
456)	Sit'n'Stroll	3240	6/9/97-8/9/97	Air bag labels. The air bag warning label was omitted from the seat cover. Contact Mfg. for new seat cover that has the required air bag warning label.
457)	Sit'n'Stroll	3240	11/1/96-6/30/99	Labels recommend use rear-facing for children up to 25 pounds. Contact Mfg. for new labels to be placed over the existing labels. New labels recommend use rear-facing for children up to 22 pounds.
458)	Sit'n'Stroll	2240	04/01/01-10/01/01	The FAA certification statement on label is in yellow lettering instead of the required RED lettering. Flight attendants may not allow its use on an airplane. Contact mfg. for replacement label.

Car Seat Recalls and Safety Notifications: MODELS 10 YEARS OLD AND OLDER

<i>List No.</i>	<i>Manufacturer Model Name</i>	<i>Model # ("X" = more numbers or letters follow)</i>	<i>Mfg Date</i>	<i>Customer assistance Problem Type and Consumer Action</i>
Safeline Kids (continued)				
459)	Sit'n'Stroll	2003	09/01/02-10/21/03	Child's head may move too far forward in a crash when lower forward-facing belt path or shoulder and buckle pads are used. Remove and discard shoulder and buckle pads and use upper forward-facing belt path only. Contact mfg. for revised instructions and labels.
Safety 1st (Dorel)			Dorel Juvenile Group: 866-623-3139 / 800-219-0509 / 866-611-3022 / 812-372-0141 www.djgusa.com	
460)	Alpha Elite	All Models	11/01/03-12/31/05	There is a potential for the harness adjustment strap to loosen during use. Contact mfg. for free repair kit.
461)	Alpha Omega Alpha Omega Elite	22151 22455	11/01/03-12/31/05	There is a potential for the harness adjustment strap to loosen during use. Contact mfg. for free repair kit.
462)	Alpha Sport	All Models	11/01/03-12/31/05	There is a potential for the harness adjustment strap to loosen during use. Contact mfg. for free repair kit.
463)	Designer 22	02-621-SAL, 02-620-xxx	01/03/02-02/13/02	Plastic handle can unexpectedly release from the carrying position when used as a carrier. Does not affect safety as a child restraint. Contact mfg. for repair kit.
464)	Designer 22	22-325 xxx GB1B	08/19/03-10/20/04	Harness can loosen if not properly tightened. Contact mfg. for free repair kit. Parents should continue to use the seat while waiting to receive/install the repair kit but are advised to make sure that the seat is properly adjusted while in use. NOTE: Models involved were sold only as travel systems (with a stroller) and any line code other than GB1B in the model # is not included in the recall.
465)	Enspira	22450, 22451, 22452, 22453, 22480, 22481	11/01/03-12/31/05	There is a potential for the harness adjustment strap to loosen during use. Contact mfg. for free repair kit.
466)	Intera	22460	11/01/03-12/31/05	There is a potential for the harness adjustment strap to loosen during use. Contact mfg. for free repair kit.
Snug Seat			800-336-7684 - www.snugseat.com	
467)	Gorilla	200-1000	07/26/02-01/15/03	A washer in tether anchor kit does not meet corrosion requirements of FMVSS 213. Contact mfg. for replacement kit # FW-50250-12-ZY
468)	Spelcast	600-1000	07/26/02-01/15/03	A washer in tether anchor kit does not meet corrosion requirements of FMVSS 213. Contact mfg. for replacement kit # FW-50250-12-ZY
469)	Traveller Plus (Mfg. by Britax for Snug Seat)	E9L32	Pre-07/24/04	The adjuster strap may slip within the metal buckle that controls the tightness of the shoulder harness and may allow the harness to loosen. Contact Britax at 800-683-2045 or 704-409-1700 for repair kit.
Strolee			ALL MODELS OLDER THAN 10 YEARS - NO LONGER IN BUSINESS - DESTROY & REPLACE	
470)	Wee Care	All	Pre 4/80	Crash test failure. Destroy & replace seat.
471)	Wee Care	599	12/80-5/81	Upholstery. Destroy & replace seat.
472)	Wee Care	609, 610	ALL	Plastic shell. Destroy & replace seat.
473)	Quick Click	605	ALL	Plastic shell. Destroy & replace seat.
474)	GT 3000	All	87/88	Crash test failure. Destroy & replace seat.

Car Seat Recalls and Safety Notifications: MODELS 10 YEARS OLD AND OLDER

<i>List No.</i>	<i>Manufacturer Model Name</i>	<i>Model # ("X" = more numbers or letters follow)</i>	<i>Customer assistance Mfg Date</i>	<i>Problem Type and Consumer Action</i>
Team-Tex America 877-912-1313				
475)	Babyride	374099	08/31/06-10/23/06	Belt routing label with "horizontal reference line" was incorrectly placed on the CR. Contact mfg. for a correct label and placement instructions. NOTE: According to Team-Tex America, all seats that were affected by this recall were caught and corrected before being purchased by consumers and thus should not be found in use.
TRW ALL MODELS OLDER THAN 10 YEARS - REPLACEMENT PROGRAM DISCONTINUED - DESTROY & REPLACE				
476)	Infant Love Seat	All	81/82	Plastic shell may develop cracks. Destroy & replace seat.
477)	Child Love Seat	All	3/84-11/84	Plastic shell may develop cracks. Destroy & replace seat.
Volvo 800-458-1552 / 800-221-9136 / 201-768-7300				
478)	ALL SEATS	All	Thru 12/88	Buckle. Call mfg. for refund info.
XSci 800-630-6850 / 719-593-8881				
479)	Pioneered ACIS	None*	02/01/02-03/07/02	Exceeds the maximum head excursion criteria of FMVSS 213. In a crash, the cradle can detach from the deflector base. Contact mfg for replacement information (replacements produced by an alternate mfg.) *No model number is associated, but affects serial numbers 01C-000000002 to 01C-000000108. [NHTSA No.: 02E-024] **NOTE: According to XSci, all seats that were affected by this recall have been returned (as of May 8, 2002) and thus should not be found in use.**