

## HIGHWAY SAFETY RESEARCH CENTER CURRENT CAR SEAT RECALL LIST

Last Revision: May 30, 2023

**Download this list & sign up for email notification of updates: [buckleupnc.org/car-seat-recall-list](http://buckleupnc.org/car-seat-recall-list)**

### About Car Seats and Recalls

It is important for people to register their car seat with the manufacturer so that they are notified of recalls. Recalls can be issued for any failure to meet Federal Motor Vehicle Safety Standard (FMVSS) 213 including crashworthiness and deviations from the standards related to labeling, flammability, or for parts that may come loose and pose a choking hazard. All recalls should be corrected.

Car seats are required to have a label indicating the manufacturer, model information, and date of manufacture. If the label is missing on a car seat, contact the manufacturer to see if it can be identified through other information. A car seat should not be used if its recall status cannot be determined.

To report any suspected car seat defects, call the National Highway Traffic Safety Administration Auto Safety Hotline at 888-327-4236 / (TTY): 800-424-9153.

### About the HSRC Recall List

UNC Highway Safety Research Center compiles and updates this list based on information provided by the National Highway Traffic Safety Administration and the car seat manufacturers at the time the recall is announced. While every effort is made to keep this list up to date, sometimes new information is added or clarified after a recall is announced. Always confirm recall information with the car seat manufacturer. It is the manufacturer who can and should make the final determination if a specific car seat is subject to recall. Caregivers should contact the manufacturer's customer service with any questions.

### About Older Car Seats and Recalls

UNC HSRC also maintains an archived list of recalled car seats that are 10 or more years old. This list can be found at [buckleupnc.org/car-seat-recall-list](http://buckleupnc.org/car-seat-recall-list). While these seats are likely expired in addition to being recalled, this list is provided for those circumstances where caregivers are using an expired seat and Technicians need to be able to check its recall status.

### Instructions for Using the HSRC Recall List

Find the manufacturer, model name, model number, and date of manufacture on the label of the car seat. Using this information, look to see if the seat's information matches any listings on the recall list. The list is alphabetized by manufacturer and model name. When in doubt, contact the manufacturer for clarification.

### For further information, contact:

Bevan Kirley or Kristel Robison  
UNC Highway Safety Research Center  
[cps@hsrc.unc.edu](mailto:cps@hsrc.unc.edu)

Sign up for Recall List Updates



**About the HSRC Recall List**

The UNC Highway Safety Research Center compiles and updates this list based on information provided by the National Highway Traffic Safety Administration and the car seat manufacturers at the time the recall is announced. While every effort is made to keep this list up to date, sometimes new information is added or clarified after a recall is announced. Always confirm recall information with the car seat manufacturer. It is the manufacturer who can and should make the final determination if a specific car seat is subject to recall. Caregivers should contact the manufacturer's customer service with any questions.

**Instructions for Using the HSRC Recall List**

Find the manufacturer, model name, model number, and date of manufacture on the label of the car seat. Using this information, look to see if the seat's information matches any listings on the recall list. The list is alphabetized by manufacturer and model name. When in doubt, contact the manufacturer for clarification.

**Refer to Page 11 for the Index of Recalls and Safety Notifications**

**Download this list & sign up for email notification of updates: [buckleupnc.org/car-seat-recall-list](http://buckleupnc.org/car-seat-recall-list)**

<b>List No.</b>	<b>Model Name</b>	<b>Model No. (X or # = more numbers or letters follow)</b>	<b>Mfg Date</b>	<b>Problem Type and Consumer Action</b>
<b>4moms</b> <span style="float: right;"><b>4moms - 888-614-6667 / <a href="http://www.4moms.com">www.4moms.com</a></b></span>				
1)	Infant Car Seat	1032	07/01/16- 10/31/16	The hooks that lock the carrier into the base can stick and fail to attach the carrier to the car seat base. Contact mfg. for free replacement seat.
<b>Angel Guard (Merritt Manufacturing)</b> <span style="float: right;"><b>317-409-0146 - <a href="http://www.merrittcarseat.com">www.merrittcarseat.com</a></b></span>				
2)	AngelRide Car Bed	All Models	08/08/19- 10/24/19	The internal harness may not have been properly sewn where the buckle is attached. Contact mfg. for free replacement harness.
<b>babidéal (Dorel China America)</b> <span style="float: right;"><b>877-657-9546 - <a href="http://www.babideal-us.com">www.babideal-us.com</a></b></span>				
3)	Storm Booster	BC901BPXL	02/28/19	The label attached to the fabric cover may not have the required safety warnings and instructions. Affected models do not comply with FMVSS 213 labeling requirements. Contact mfg. for free replacement fabric cover.
<b>Baby Jogger</b> <span style="float: right;"><b>800-241-1848 - <a href="http://www.babyjogger.com">www.babyjogger.com</a></b></span>				
4)	City GO Infant Car Seat	BJ64510, BJ64529	11/03/14- 04/30/15	The labels, instruction manual, and registration card of affected models do not comply with FMVSS 213 requirements for content and formatting. Contact mfg. for free replacement car seat.
5)	City GO Infant Car Seat Base	BJ80400, BJ61500	11/03/14- 04/30/15	The labels, instruction manual, and registration card of affected models do not comply with FMVSS 213 requirements for content and formatting. Contact mfg. for free replacement car seat.
6)	City Mini Infant Car Seat/ Stroller System	BJ72510	11/03/14- 04/30/15	The labels, instruction manual, and registration card of affected models do not comply with FMVSS 213 requirements for content and formatting. Contact mfg. for free replacement car seat.
7)	Vue Lite Infant Car Seat/ Stroller System	BJ70411, BJ70424, BJ70431	11/03/14- 04/30/15	The labels, instruction manual, and registration card of affected models do not comply with FMVSS 213 requirements for content and formatting. Contact mfg. for free replacement car seat.

<b>List No.</b>	<b>Model Name</b>	<b>Model No. (X or # = more numbers or letters follow)</b>	<b>Mfg Date</b>	<b>Problem Type and Consumer Action</b>
<b>Baby Trend</b>			<b>800-328-7363 - <a href="http://www.babytrend.com">www.babytrend.com</a></b>	
8)	Hybrid 3-in-1 LX	FB48417, FB58181	07/14/16 - 07/23/16	The center adjuster may detach in a crash when used in the harnessed mode with a child weighing more than 40lbs. Contact mfg. for free replacement seat.
>> 9)	Hybrid 3-in-1 Combination Booster Car Seats	FB49E14A	12/06/21	The LATCH webbing that secures the child restraint system to the lower anchorages may fray, which can reduce the strength of the webbing and fail to properly restrain a child in a crash. Contact manufacturer for replacement LATCH assembly webbing and installation instructions. Owners can continue to safely use the car seat by installing with the vehicle seat belt as outlined in the product instruction manual.
10)	TrendZ Fastback 3-in-1	FB60070, FB60408	10/01/11- 07/31/13	The harness buckle may become stuck in a latched condition so that it cannot be opened by pushing the release button, thus making it difficult to remove the child from the restraint in an emergency. Contact mfg. for replacement buckle.
<b>Britax</b>			<b>888-427-4829 / 704-409-1699 - <a href="mailto:Britax.Recall@britax.com">Britax.Recall@britax.com</a> / <a href="http://www.britaxusa.com">www.britaxusa.com</a></b>	
11)	Advocate ClickTight	E1A025Q, E9LT95N, E9LT95Q, E9LT95Z	08/01/14- 07/29/15	The harness adjuster button (red) on affected models may remain down in the "release" position after the harness is tightened. This will enable the shoulder harnesses to loosen from a child's movements while secured in the seat. Contact mfg. for repair kit.
12)	B-Safe 35 B-Safe 35 XE	E9LU65M, E9LU65P, E9LU63F, E9LU66R, EXLU65M, E9LS63F	10/01/14- 07/01/15	Cracks may develop in the carry handle, potentially resulting in injury if the cracks cause the handle to break. Recall does not affect the safety performance of the seat when used in a motor vehicle. Customers may continue using the car seat when secured in a vehicle or stroller but should not lift or carry the seat by the carry handle until the remedy kit has been installed. Contact mfg. for repair kit. Visit <a href="http://www.bsafe35recall.com">www.bsafe35recall.com</a> for more information.
13)	B-Safe 35 Travel System B-Agile Travel System	S914900, S915400, S915200, S01635200, S921900	10/01/14- 07/01/15	Cracks may develop in the carry handle, potentially resulting in injury if the cracks cause the handle to break. Recall does not affect the safety performance of the seat when used in a motor vehicle. Customers may continue using the car seat when secured in a vehicle or stroller but should not lift or carry the seat by the carry handle until the remedy kit has been installed. Contact mfg. for repair kit. Visit <a href="http://www.bsafe35recall.com">www.bsafe35recall.com</a> for more information.
14)	B-Safe 35 B-Safe 35 Travel Systems	E1A183F, E1A185x, E1A186R, E1A203F, E1A205x, E1A206x, E1A207E, E9LU65V, E9LU66x, E9LU67x, EXA185M, S02063xxx, S03803xxx, S04144xxx, S04145000, S04402800, S04884xxx, S04975600, S04978900, S05260200, S06020xxx, S06147100, S921800	11/01/15- 05/31/17	The center tab on the chest clips of the affected seats can break, presenting a choking hazard. Contact mfg. for repair kit. Affected seats can be safely used as long as consumers remove the chest clip or monitor it for signs of breakage.
15)	B-Safe 35 Elite B-Safe 35 Elite XE	E9LS55T, E9LS56P, E9LS55U, E9LS66C, E9LS65U	10/01/14- 07/01/15	Cracks may develop in the carry handle, potentially resulting in injury if the cracks cause the handle to break. Recall does not affect the safety performance of the seat when used in a motor vehicle. Customers may continue using the car seat when secured in a vehicle or stroller but should not lift or carry the seat by the carry handle until the remedy kit has been installed. Contact mfg. for repair kit. Visit <a href="http://www.bsafe35recall.com">www.bsafe35recall.com</a> for more information.

<b>List No.</b>	<b>Model Name</b>	<b>Model No. (X or # = more numbers or letters follow)</b>	<b>Mfg Date</b>	<b>Problem Type and Consumer Action</b>
<b>Britax (continued)</b>				
16)	B-Safe 35 Elite B-Safe 35 Elite Travel Systems	E1A215x, E1A216P, E1A221Q, E1A225x, E1A226L, E9LS5xx, EXA216L, S01298600, S02063xxx, S02064000, S04281xxx, S04628500, S06018800, S06020xxx, S06051300, S923700	11/01/15- 05/31/17	The center tab on the chest clips of the affected seats can break, presenting a choking hazard. Contact mfg. for repair kit. Affected seats can be safely used as long as consumers remove the chest clip or monitor it for signs of breakage.
17)	B-Safe BOB 35	E9LT34x, E9LT35X, EXLT34A	11/01/15- 05/31/17	The center tab on the chest clips of the affected seats can break, presenting a choking hazard. Contact mfg. for repair kit. Affected seats can be safely used as long as consumers remove the chest clip or monitor it for signs of breakage.
18)	Boulevard ClickTight	E1A015Q, E1A016A, E1A016H, E1A135Q, E9LT85Q, E9LT85S, E9LT86A, E9LT86F, E9LT86G, E9LT86H	08/01/14- 07/29/15	The harness adjuster button (red) on affected models may remain down in the "release" position after the harness is tightened. This will enable the shoulder harnesses to loosen from a child's movements while secured in the seat. Contact mfg. for repair kit.
19)	Companion	E9L14, E9L20, E9L80	All	Consumer Advisory - NOT A RECALL: Britax advises that the user should adjust the carrier handle so that it is completely down and behind the carrier after installation in the vehicle with or without the base assembly. Contact mfg. for additional info.
20)	Marathon ClickTight	E1A005R, E1A006B, E1A116L, E9LT71Q, E9LT75R, E9LT76B, E9LT76L, E9LT76N, E9LT76P, EXA116L	08/01/14- 07/29/15	The harness adjuster button (red) on affected models may remain down in the "release" position after the harness is tightened. This will enable the shoulder harnesses to loosen from a child's movements while secured in the seat. Contact mfg. for repair kit.

**Clek****866-656-2462 - [www.clekinc.com](http://www.clekinc.com)**

21)	Flo	FL15, FL16, FL17, FL18, FL19	07/05/14- 05/20/21	It is possible for a child to access and remove small pieces of foam from the seat cushion. Loose pieces of foam can be a choking hazard. Contact manufacturer for a remedy kit.
22)	Foonf	F012, F014, F015, F016, F017, F018, F019	12/03/12- 05/20/21	It is possible for a child to access and remove small pieces of foam from the seat cushion. Loose pieces of foam can be a choking hazard. Contact manufacturer for a remedy kit.
23)	Liing	LG19U1	03/27/19- 09/14/20	A portion of the canopy can break if forcefully bent and leave behind a small plastic piece which could be a choking hazard. Contact manufacturer for a remedy kit.
24)	Liing	LG19U1	03/27/19- 02/22/21	The warning label affixed to some fabric covers may start to peel, potentially causing a choking hazard. Contact manufacturer for a remedy kit.
25)	Liingo	LGO20U1	05/20/20- 04/14/20	A portion of the canopy can break if forcefully bent and leave behind a small plastic piece which could be a choking hazard. Contact manufacturer for a remedy kit.
26)	Liingo	LGO20U1	05/20/20- 02/22/21	The warning label affixed to some fabric covers may start to peel, potentially causing a choking hazard. Contact manufacturer for a remedy kit.
27)	Olli	NA	01/20/20- 05/10/22	Seat does not include a model number on label. All seats manufactured within the date range are included. A required label showing the proper way to install the booster seat with a lap/shoulder belt is missing. Contact manufacturer for a replacement label ( <a href="http://clekinc.com/olliozzilabel">clekinc.com/olliozzilabel</a> ).

<b>List No.</b>	<b>Model Name</b>	<b>Model No. (X or # = more numbers or letters follow)</b>	<b>Mfg Date</b>	<b>Problem Type and Consumer Action</b>
-----------------	-------------------	--	-----------------	---

**Clek (continued)**

28)	Ozzi	NA	03/01/20-05/10/22	Seat does not include a model number on label. All seats manufactured within the date range are included. A required label showing the proper way to install the booster seat with a lap/shoulder belt is missing. Contact manufacturer for a replacement label (clekinc.com/ollozzilabel).
-----	------	----	-------------------	---

**Combi USA****800-992-6624 / 803-548-6633 - www.combi-intl.com**

29)	BabyRide	378099	05/01/16-08/31/19	The 1-inch-wide front webbing strap used to adjust the harness does not meet FMVSS 213 breaking strength requirements and in certain circumstances, may not adequately restrain a child during a crash. Contact mfg. for more information.
30)	Coccoro	8220x	01/01/09-06/29/16	Too much force can be placed on the child when the car seat is installed forward-facing with only the vehicle's lap belt. All other installation methods are not affected. Contact mfg. for a cover to add to the bottom of the seat.

**Cybex (Columbus Trading-Partners USA) 877-242-5676 cybex-online.com/en-us**

31)	Aton	514xxxxxx	06/06/17-11/01/20	The webbing for the front harness adjustment strap, used to snugly adjust the shoulder harness straps onto the infant, may fray, which can reduce its strength. Contact the manufacturer for replacement parts and installation instructions.
32)	Aton 2, Aton 2 SensorSafe	515xxxxxx, 519xxxxxx, 521xxxxxx	06/06/17-11/01/20	The webbing for the front harness adjustment strap, used to snugly adjust the shoulder harness straps onto the infant, may fray, which can reduce its strength. Contact the manufacturer for replacement parts and installation instructions.
33)	Aton M, Aton M SensorSafe	518xxxxx, 519xxxxxx	06/06/17-11/01/20	The webbing for the front harness adjustment strap, used to snugly adjust the shoulder harness straps onto the infant, may fray, which can reduce its strength. Contact the manufacturer for replacement parts and installation instructions.
34)	Aton Q	515xxxxxx, 517xxxxxx	06/06/17-11/01/20	The webbing for the front harness adjustment strap, used to snugly adjust the shoulder harness straps onto the infant, may fray, which can reduce its strength. Contact the manufacturer for replacement parts and installation instructions.
35)	Cloud Q, Cloud Q SensorSafe	515xxxxxx, 517xxxxxx, 519xxxxxx, 521xxxxxx	06/06/17-11/01/20	The webbing for the front harness adjustment strap, used to snugly adjust the shoulder harness straps onto the infant, may fray, which can reduce its strength. Contact the manufacturer for replacement parts and installation instructions.
36)	Sirona M	518000385, 518000387, 518002145, 518002149, 518002151, 518002153, 519000211	11/03/17-08/31/18	It is possible for a child to access and pick pieces of foam from the child seat headrest pad. Loose pieces of foam can be a choking hazard. Contact manufacturer for a remedy kit.

**Diono****855-463-4666 - www.us.diono.com**

37)	Cambria 2	31200-US-01, 31201-US-01, 31202-US-01	09/05/20-11/30/20	When used as a highback booster, a crack between the headrest and backrest can occur in a crash, allowing the headrest to separate. Affected products have serial numbers that start with 648762, 648801, 648802, 648803, 648825, 648842, 648843, 648844, 648846, 648847, 648925, or 648926. Contact mfg. for a replacement backrest/headrest.
-----	-----------	---	-------------------	--

**Diono (continued on next page)**

List No.	Model Name	Model No. (X or # = more numbers or letters follow)	Mfg Date	Problem Type and Consumer Action
----------	------------	---	----------	----------------------------------

**Diono (continued)**

38)	Olympia	30100	04/12/14-03/31/15	The seat may not adequately protect a child in a crash when used in harnessed mode and installed forward-facing.
39)	Pacifica	30400, 300000	04/12/14-05/13/16	<p><b>Children who weigh more than 65 lbs:</b> Seats installed forward-facing (with any installation method) require the use of a top tether for children weighing more than 65 lbs in harnessed mode. If no top tether anchor is available, use the seat in booster mode.</p> <p><b>Children who weigh 65 lbs or less:</b> Seats installed forward-facing using only the lap belt require the use of the top tether for children who weigh 65 lbs or less in harnessed mode. If no top tether anchor is available, contact mfg. for a free repair kit.</p>
40)	Radian R100	16600, 16000	01/03/14-09/05/17	
41)	Radian R120	16800, 16000	01/03/14-08/30/17	
42)	Radian RXT	16900, 16000	11/25/13-09/05/17	
43)	Rainier	30300, 300000	04/12/14-09/05/17	

**Evenflo**

**800-525-2472 / 800-233-5921 / 800-490-7497 - [www.evenflo.com](http://www.evenflo.com)**

44)	Big Kid Booster	30911173AD, 3091967AD, 30911118AD, 30911120D	ALL	The affected seats - originally intended for display models - were packaged without the instruction manual or the required registration card. Otherwise, including crashworthiness, they were fully compliant with FMVSS 213. However, some seats were inadvertently shipped to institutional customers to be given to families. None of the affected units were sold at retail stores. Affected seats end with the letter "D" and have a label stating: "DISPLAY ONLY – NOT INTENDED FOR SALE," located on the back of the booster seat headrest. Contact mfg. for remedy kit.
45)	Chase Factory Select Chase LX Chase Select	306xxx	06/12/12-10/03/13	The harness buckle may become resistant to unlatching over time so that it cannot be opened by pushing the release button, thus making it difficult to remove the child from the restraint in an emergency. NOTE: Date ranges for specific model numbers of affected models may differ from date range listed here. Contact mfg. for specific dates and replacement buckle if needed.
46)	Chase DLX Chase LX	329xxx	08/23/11-03/03/14	The harness buckle may become resistant to unlatching over time so that it cannot be opened by pushing the release button, thus making it difficult to remove the child from the restraint in an emergency. NOTE: Date ranges for specific model numbers of affected models may differ from date range listed here. Contact mfg. for specific dates and replacement buckle if needed.
47)	Evolve 3-in-1	34411700, 34411741	02/26/15-02/09/16	The central front harness adjuster button may be within the child's reach which could allow the child to loosen the harness and be at an increased risk of injury in the event of a crash. Contact mfg. for a free repair kit.
48)	Express Factory Select	329xxx	08/23/11-03/03/14	The harness buckle may become resistant to unlatching over time so that it cannot be opened by pushing the release button, thus making it difficult to remove the child from the restraint in an emergency. NOTE: Date ranges for specific model numbers of affected models may differ from date range listed here. Contact mfg. for specific dates and replacement buckle if needed.
49)	Maestro Factory Select	310xxx	08/22/11-10/17/13	The harness buckle may become resistant to unlatching over time so that it cannot be opened by pushing the release button, thus making it difficult to remove the child from the restraint in an emergency. NOTE: Date ranges for specific model numbers of affected models may differ from date range listed here. Contact mfg. for specific dates and replacement buckle if needed.

<b>List No.</b>	<b>Model Name</b>	<b>Model No. (X or # = more numbers or letters follow)</b>	<b>Mfg Date</b>	<b>Problem Type and Consumer Action</b>
<b>Evenflo (continued)</b>				
50)	Momentum 65 Momentum 65 DLX	385xxx	03/04/13- 08/26/13	The harness buckle may become resistant to unlatching over time so that it cannot be opened by pushing the release button, thus making it difficult to remove the child from the restraint in an emergency. NOTE: Date ranges for specific model numbers of affected models may differ from date range listed here. Contact mfg. for specific dates and replacement buckle if needed.
51)	Secure Kid 100 Secure Kid 300 Secure Kid 400 Secure Kid LX Secure Kid LX Factory Select	308xxx	12/13/11- 03/03/14	The harness buckle may become resistant to unlatching over time so that it cannot be opened by pushing the release button, thus making it difficult to remove the child from the restraint in an emergency. NOTE: Date ranges for specific model numbers of affected models may differ from date range listed here. Contact mfg. for specific dates and replacement buckle if needed.
52)	Snugli All-in- One	346xxx	10/02/12- 08/26/13	The harness buckle may become resistant to unlatching over time so that it cannot be opened by pushing the release button, thus making it difficult to remove the child from the restraint in an emergency. NOTE: Date ranges for specific model numbers of affected models may differ from date range listed here. Contact mfg. for specific dates and replacement buckle if needed.
53)	Snugli Booster	308xxx	12/13/11- 03/03/14	The harness buckle may become resistant to unlatching over time so that it cannot be opened by pushing the release button, thus making it difficult to remove the child from the restraint in an emergency. NOTE: Date ranges for specific model numbers of affected models may differ from date range listed here. Contact mfg. for specific dates and replacement buckle if needed.
54)	SureRide DLX	371xxx	06/20/12- 10/17/13	The harness buckle may become resistant to unlatching over time so that it cannot be opened by pushing the release button, thus making it difficult to remove the child from the restraint in an emergency. NOTE: Date ranges for specific model numbers of affected models may differ from date range listed here. Contact mfg. for specific dates and replacement buckle if needed.
55)	Symphony 65 DLX Symphony DLX Symphony LX	345xxx	10/02/12- 08/26/13	The harness buckle may become resistant to unlatching over time so that it cannot be opened by pushing the release button, thus making it difficult to remove the child from the restraint in an emergency. NOTE: Date ranges for specific model numbers of affected models may differ from date range listed here. Contact mfg. for specific dates and replacement buckle if needed.
56)	Symphony Symphony 65 E3	346xxx	10/02/12- 08/26/13	The harness buckle may become resistant to unlatching over time so that it cannot be opened by pushing the release button, thus making it difficult to remove the child from the restraint in an emergency. NOTE: Date ranges for specific model numbers of affected models may differ from date range listed here. Contact mfg. for specific dates and replacement buckle if needed.
57)	Titan 65 Titan 65 Factory Select	371xxx	06/20/12- 10/17/13	The harness buckle may become resistant to unlatching over time so that it cannot be opened by pushing the release button, thus making it difficult to remove the child from the restraint in an emergency. NOTE: Date ranges for specific model numbers of affected models may differ from date range listed here. Contact mfg. for specific dates and replacement buckle if needed.
58)	Transitions 3-in-1	34411029, 34411686, 34411695	12/18/14- 01/29/16	The central front harness adjuster button may be within the child's reach which could allow the child to loosen the harness and be at an increased risk of injury in the event of a crash. Contact mfg. for a free repair kit.

<b>List No.</b>	<b>Model Name</b>	<b>Model No. (X or # = more numbers or letters follow)</b>	<b>Mfg Date</b>	<b>Problem Type and Consumer Action</b>
<b>Graco</b>			<b>800-345-4109 - www.gracobaby.com</b>	
59)	Argos 70 / Argos 70 Elite	All Models	05/01/11-07/31/13	The harness buckle may become stuck so that it cannot be opened by pushing the release button, thus making it difficult to remove the child from the restraint in an emergency. Contact mfg. for replacement buckle.
60)	Classic Ride	1812930	03/01/14-02/28/15	The labels of affected models did not include information about the location and use of the instruction manual as required by FMVSS 213. Recall does not affect the safety performance of the seat. Contact mfg. for replacement labels.
61)	Classic Ride 50	All Models	10/01/11-09/30/13	The harness buckle may become stuck so that it cannot be opened by pushing the release button, thus making it difficult to remove the child from the restraint in an emergency. Contact mfg. for replacement buckle.
62)	ComfortSport	All Models	10/01/10-09/30/13	The harness buckle may become stuck so that it cannot be opened by pushing the release button, thus making it difficult to remove the child from the restraint in an emergency. Contact mfg. for replacement buckle.
63)	ComfortSport	1794333, 1813040	03/01/14-02/28/15	The labels of affected models did not include information about the location and use of the instruction manual as required by FMVSS 213. Recall does not affect the safety performance of the seat. Contact mfg. for replacement labels.
64)	Extend2Fit	1954477	11/27/15-01/20/16	The recline labels on affected models do not meet FMVSS 213. Labels on the side of affected car seats, including the recline label, may not be in the same language (i.e. all English on one side of the car seat and all Spanish on the other side). Recall does not affect the safety performance of the seat. Contact mfg for replacement labels.
65)	Head Wise 70 with Safety Surround	All Models	01/01/12-07/31/13 & 08/03/13	The harness buckle may become stuck so that it cannot be opened by pushing the release button, thus making it difficult to remove the child from the restraint in an emergency. Contact mfg. for replacement buckle.
66)	Milestone	1910130, 1923980, 1926538, 1926539	07/09/15-10/09/15	The labels on affected seats do not include specific phrasing about how to install the car seat, as required by FMVSS 213. Recall does not affect the safety performance of the seat. Contact mfg. for free replacement labels.
67)	My Ride 65 / My Ride 65 with Safety Surround	All Models	04/01/09-07/31/13 & 09/30/13	The harness buckle may become stuck so that it cannot be opened by pushing the release button, thus making it difficult to remove the child from the restraint in an emergency. Contact mfg. for replacement buckle.
68)	My Ride 65	1794334, 1813015, 1813074, 1853478, 1871689, 1872691, 1877535, 1908152	05/16/14 - 08/01/14	The harness webbing used on certain My Ride 65 convertible car seats do not meet FMVSS 213 requirements for breaking strength. Harnesses with the webbing tag code "2014/06" are the only models affected by this recall. Contact mfg. for replacement harness. Consumers may continue to use the My Ride 65 convertible car seats while waiting for a replacement kit.
69)	My Ride 70	All Models	05/01/12-07/31/13	The harness buckle may become stuck so that it cannot be opened by pushing the release button, thus making it difficult to remove the child from the restraint in an emergency. Contact mfg. for replacement buckle.
70)	My Size 70	All Models	01/01/12-07/31/13 & 08/03/13	The harness buckle may become stuck so that it cannot be opened by pushing the release button, thus making it difficult to remove the child from the restraint in an emergency. Contact mfg. for replacement buckle.
71)	Nautilus 3-in-1 / Nautilus Elite / Nautilus Plus	All Models	10/01/07-07/31/13 & 08/19/13	The harness buckle may become stuck so that it cannot be opened by pushing the release button, thus making it difficult to remove the child from the restraint in an emergency. Contact mfg. for replacement buckle.



<b>List No.</b>	<b>Model Name</b>	<b>Model No. (X or # = more numbers or letters follow)</b>	<b>Mfg Date</b>	<b>Problem Type and Consumer Action</b>
-----------------	-------------------	--	-----------------	---

**Graco (continued)**

72)	Ready Ride	All Models	10/01/10-09/30/13	The harness buckle may become stuck so that it cannot be opened by pushing the release button, thus making it difficult to remove the child from the restraint in an emergency. Contact mfg. for replacement buckle.
73)	Ready Ride	1924519, 1924520	03/01/14-02/28/15	The labels of affected models did not include information about the location and use of the instruction manual as required by FMVSS 213. Recall does not affect the safety performance of the seat. Contact mfg. for replacement labels.
74)	Size4Me70	All Models	01/01/12-07/31/13 & 08/03/13	The harness buckle may become stuck so that it cannot be opened by pushing the release button, thus making it difficult to remove the child from the restraint in an emergency. Contact mfg. for replacement buckle.
75)	Smart Seat / Smart Seat with Safety Surround	All Models	12/01/10-09/30/13 & 10/09/13; 12/25/13; 1/10/14	The harness buckle may become stuck so that it cannot be opened by pushing the release button, thus making it difficult to remove the child from the restraint in an emergency. Contact mfg. for replacement buckle.
76)	TurboBooster	1963973, 1963974, 1963975, 1963976, 1967886, 1975173	12/22/15-04/05/16	Instructions are missing the information required by FMVSS 213 that the seats should be securely belted to the vehicle at all times, even if the seat is unoccupied. Recall does not affect the safety performance of the seat. Contact mfg. to obtain missing instructions.

**Harmony****877-306-1001 / [www.harmonyjuvenile.com](http://www.harmonyjuvenile.com)**

77)	Big Boost Deluxe	All Models	11/01/15-06/24/17	In the event of a crash, a child's chest may experience forces that exceed FMVSS 213 limits. Owners should contact Harmony customer service for more information.
-----	------------------	------------	-------------------	---

**JD E-Commerce America****302-426-4543 / [overseas-service@jd.com](mailto:overseas-service@jd.com)**

78)	Marainbow	Any Model	Any Date	This seat (as well as materially similar products – see portable infant/child seat) does not meet FMVSS 213 requirements for installation and labeling and may increase the risk of injury. Contact manufacturer for a refund and do not use seat.
-----	-----------	-----------	----------	--

A list of specific seats included in this recall:

<https://static.nhtsa.gov/odi/rcl/2022/RMISC-22C008-4093.pdf>

79)	<b>Joybuy Express</b>			<b>See JD E-Commerce America</b>
-----	-----------------------	--	--	----------------------------------

**Kiddy USA****855-925-4339 / [info@kiddyusa.com](mailto:info@kiddyusa.com) / [www.kiddyusa.com](http://www.kiddyusa.com)**

80)	World Plus	51 100 WP	02/01/12-10/05/13	Recall affects all World Plus seats ever made. The buckle/tongue on the impact shield of affected seats may only partially engage, appearing to be fully latched when it is not. Kiddy will reimburse owners the full purchase price of the car seat. Contact mfg. (855-925-4339) for more information.
-----	------------	-----------	-------------------	---

List No.	Model Name	Model No. (X or # = more numbers or letters follow)	Mfg Date	Problem Type and Consumer Action
<b>Maxi-Cosi (Dorel)</b>			<b>877-657-9546 / www.djgusa.com</b>	
>> 81)	Coral XP	IC313xxx	05/01/20- 02/28/23	<b>Recall issue #1)</b> The lower anchors used to secure the car seat base may fail, allowing the seat to detach, which could increase the risk of injury. Discontinue use of lower anchors immediately and install using vehicle seat belt. Contact manufacturer for a replacement base. Note: The stroller included as part of the travel system has not been recalled, only the car seat component. Check model # on the car seat.
	<i>Coral XP Travel Systems:</i>			
	Mara XT	TR434xxx		
	Tayla XP	TR433xxx		
				<b>Recall issue #2)</b> The inner carrier of the child restraint is not sufficient to restrain a child without the use of the outer carrier. Only use the inner carrier when attached to the outer carrier and installed with the vehicle seat belt (see above recall), consistent with the existing instruction booklet and labels. Contact manufacturer for refund or replacement seat. Note: The stroller included as part of the travel system has not been recalled, only the car seat component. Check model # on the car seat.
>> 82)	Infant Car Seat Base	IC335xxx	05/01/20- 02/28/23	The lower anchors used to secure the car seat base may fail, allowing the seat to detach, which could increase the risk of injury. Discontinue use of lower anchors immediately and install using vehicle seat belt. Contact manufacturer for a replacement base.
>> 83)	Mico XP Max Infant Car Seat	IC336xxx, IC337xxx, IC338xxx	05/01/20- 02/28/23	The lower anchors used to secure the car seat base may fail, allowing the seat to detach, which could increase the risk of injury. Discontinue use of lower anchors immediately and install using vehicle seat belt. Contact manufacturer for a replacement base.
	<i>Mico XP Travel Systems:</i>			
	Adorra	TR430xxx		
	Gia XP	TR416xxx		
	Tayla	TR428xxx		
	Zelia 2 Max	TR427xxx		
>> 84)	Mico Luxe + Infant Car Seat	IC370xxx	05/01/20- 02/28/23	The lower anchors used to secure the car seat base may fail, allowing the seat to detach, which could increase the risk of injury. Discontinue use of lower anchors immediately and install using vehicle seat belt. Contact manufacturer for a replacement base.
85)	Pria 70	CC133xxx	01/01/19 - 07/31/19	When installed forward-facing using only the vehicle lap belt, the seat may not adequately protect the child from head injury in the event of a crash. As such, these child seats fail to conform to the requirements of FMVSS 213. Contact manufacturer for more information and a free remedy kit.
86)	Pria 85 Pria 85 Max	CC121xxx, CC156xxx, CC182xxx, CC183xxx, CC191xxx, CC201xxx, CC212xxx, CC213xxx, CC217xxx, CC221xxx	01/01/19- 08/17/21	When installed forward-facing using only the vehicle lap belt, the seat may not adequately protect the child from head injury in the event of a crash. As such, these child seats fail to conform to the requirements of FMVSS 213. Contact manufacturer for more information and a free remedy kit.
<b>Orbit Baby</b>			<b>877-672-2229 / 510-793-5007 - www.orbitbaby.com</b>	
87)	Car Seat Base G2	ORB822000	03/20/13- 07/20/13	Voluntary recall of the Orbit Baby Car Seat Base G2 with listed manufacturer dates AND with a Batch Number of A0840, A0860, or A0880. The knob on the base used to tighten the base into the vehicle may detach or spin without tightening the base. <u>The Infant Car Seat G2 is not affected by this recall and can continue to be used without the base.</u> Contact mfg. for a free repair kit.

<b>List No.</b>	<b>Model Name</b>	<b>Model No. (X or # = more numbers or letters follow)</b>	<b>Mfg Date</b>	<b>Problem Type and Consumer Action</b>
-----------------	-------------------	--	-----------------	---

**Portable Child/Infant Seat**

**Contact NHTSA 888-327-4236 / <https://www.nhtsa.gov/report-a-safety-problem> with concerns.**

88) **Consumer Advisory** – A number of products sold as "portable child/infant seats" fail to meet FMVSS213 requirements for protection, installation, and/or labeling and may increase the risk of injury. These seats are not certified for the protection of children in the U.S.

Signs of seats that fail to meet FMVSS213: no lower anchor attachments, labels in languages other than English and Spanish (or missing entirely), no manufacturer contact information, and/or missing instruction labels with pictures or diagrams.

**Recaro**

**888-973-2276 / 800-873-2276 / 248-364-3818/ - [www.recaropromotion.com](http://www.recaropromotion.com)**

- |     |                  |            |  |
|-----|------------------|------------|--|
| 89) | Performance RIDE | 333.01.xxx | 01/15/13 - The top tether anchorage on the seat may detach from the plastic shell in a crash.<br>06/09/15 Contact mfg. for repair kit. |
| 90) | ProRIDE          | 332.01.xxx | 04/09/10 - The top tether anchorage on the seat may detach from the plastic shell in a crash.<br>06/09/15 Contact mfg. for repair kit. |

**Safety 1st (Dorel)**

**877-657-9546 / [www.djgusa.com](http://www.djgusa.com)**

- |        |  |                      |   |
|--------|--|----------------------|---|
| >> 91) | Onboard35 SecureTech / SecureTech Base | IC351xxx<br>IC372xxx | 05/01/20- The lower anchors used to secure the car seat base may fail, allowing the seat to detach, which could increase the risk of injury. Discontinue use of lower anchors immediately and install using vehicle seat belt. Contact manufacturer for a replacement base.<br>02/28/23 |
|--------|--|----------------------|---|

92) **Snugli**

*See Evenflo*

**WAYB**

**888-924-9292 - [www.wayb.com](http://www.wayb.com)**

- |     |      |                            |  |
|-----|------|----------------------------|--|
| 93) | Pico | All Models<br>CSTPI-##-001 | 03/01/19- The headrest's aluminum tubular frame can break allowing the headrest to detach.<br>05/12/19 Contact mfg. for replacement headrest and instructions. |
|-----|------|----------------------------|--|

**Index of Recalls and Safety Notifications**  
**For the model numbers, "x" or "#" means that more numbers or letters follow.**

Model numbers and model names for car seats under recall are followed by their index number which corresponds to the "List No." for each listing. If the model number is not found, check the model name also. Model numbers are not available for all model names.

<b>4moms</b>	# E1A215x . . . . . 16	# S04402800 . . . . . 14
# 1032 . . . . . 1	# E1A216P . . . . . 16	# S04628500 . . . . . 16
Infant Car Seat . . . . . 1	# E1A221Q . . . . . 16	# S04884xxx . . . . . 14
	# E1A225x . . . . . 16	# S04975600 . . . . . 14
<b>Angel Guard (Merritt Manufacturing)</b>	# E1A226L . . . . . 16	# S04978900 . . . . . 14
AngelRide Car Bed . . . . . 2	# E9L14 . . . . . 19	# S05260200 . . . . . 14
	# E9L20 . . . . . 19	# S06018800 . . . . . 16
<b>babidéal (Dorel China America)</b>	# E9L80 . . . . . 19	# S06020xxx . . . . . 14, 16
# BC901BPXL . . . . . 3	# E9LS55T . . . . . 15	# S06051300 . . . . . 16
Storm Booster . . . . . 3	# E9LS55U . . . . . 15	# S06147100 . . . . . 14
	# E9LS56P . . . . . 15	# S914900 . . . . . 13
<b>Baby Jogger</b>	# E9LS5xx . . . . . 16	# S915200 . . . . . 13
# BJ61500 . . . . . 5	# E9LS63F . . . . . 12	# S915400 . . . . . 13
# BJ64510 . . . . . 4	# E9LS65U . . . . . 15	# S921800 . . . . . 14
# BJ64529 . . . . . 4	# E9LS66C . . . . . 15	# S921900 . . . . . 13
# BJ70411 . . . . . 7	# E9LT34x . . . . . 17	# S923700 . . . . . 16
# BJ70424 . . . . . 7	# E9LT35X . . . . . 17	Advocate ClickTight . . . . . 11
# BJ70431 . . . . . 7	# E9LT71Q . . . . . 20	B-Agile Travel System . . . . . 13
# BJ72510 . . . . . 6	# E9LT75R . . . . . 20	B-Safe 35 . . . . . 12, 14
# BJ80400 . . . . . 5	# E9LT76B . . . . . 20	B-Safe 35 Elite . . . . . 15, 16
City GO Car Seat . . . . . 4	# E9LT76L . . . . . 20	B-Safe 35 Elite Travel Systems . . . . . 16
City GO Car Seat Base . . . . . 5	# E9LT76N . . . . . 20	B-Safe 35 Elite XE . . . . . 15
City Mini Car Seat/Stroller . . . . . 6	# E9LT76P . . . . . 20	B-Safe 35 Travel System . . . . . 13
Vue Lite Car Seat/Stroller . . . . . 7	# E9LT85Q . . . . . 18	B-Safe 35 Travel Systems . . . . . 14
	# E9LT85S . . . . . 18	B-Safe 35 XE . . . . . 12
<b>Baby Trend</b>	# E9LT86A . . . . . 18	B-Safe BOB 35 . . . . . 17
# FB48417 . . . . . 8	# E9LT86F . . . . . 18	Boulevard ClickTight . . . . . 18
# FB49E14A . . . . . 9	# E9LT86G . . . . . 18	Companion . . . . . 19
# FB58181 . . . . . 8	# E9LT86H . . . . . 18	Marathon ClickTight . . . . . 20
# FB60070 . . . . . 10	# E9LT95N . . . . . 11	
# FB60408 . . . . . 10	# E9LT95Q . . . . . 11	<b>Clek</b>
Hybrid 3-in-1 Combo Booster Seat . . . . . 9	# E9LT95Z . . . . . 11	# F012 . . . . . 22
Hybrid 3-in-1 LX . . . . . 8	# E9LU63F . . . . . 12	# F014 . . . . . 22
TrendZ Fastback . . . . . 10	# E9LU65P . . . . . 12	# F015 . . . . . 22
	# E9LU65V . . . . . 14	# F016 . . . . . 22
<b>Britax</b>	# E9LU66R . . . . . 12	# F017 . . . . . 22
# E1A005R . . . . . 20	# E9LU66x . . . . . 14	# F018 . . . . . 22
# E1A006B . . . . . 20	# E9LU67x . . . . . 14	# F019 . . . . . 22
# E1A015Q . . . . . 18	# EXA116L . . . . . 20	# FL15 . . . . . 21
# E1A016A . . . . . 18	# EXA185M . . . . . 14	# FL16 . . . . . 21
# E1A016H . . . . . 18	# EXA216L . . . . . 16	# FL17 . . . . . 21
# E1A025Q . . . . . 11	# EXLT34A . . . . . 17	# FL18 . . . . . 21
# E1A116L . . . . . 20	# EXLU65M . . . . . 12	# FL19 . . . . . 21
# E1A135Q . . . . . 18	# S01298600 . . . . . 16	# LG19U1 . . . . . 23, 24
# E1A183F . . . . . 14	# S01635200 . . . . . 13	# LGO20U1 . . . . . 25, 26
# E1A185x . . . . . 14	# S02063xxx . . . . . 14, 16	Flo . . . . . 21
# E1A186R . . . . . 14	# S02064000 . . . . . 16	Foonf . . . . . 22
# E1A203F . . . . . 14	# S03803xxx . . . . . 14	Liing . . . . . 23, 24
# E1A205x . . . . . 14	# S04144xxx . . . . . 14	Liingo . . . . . 25, 26
# E1A206x . . . . . 14	# S04145000 . . . . . 14	Olli . . . . . 27
# E1A207E . . . . . 14	# S04281xxx . . . . . 16	Ozzi . . . . . 28

For the model numbers "x" = more numbers or letters follow

Index number refers to "List No." for each listing

<b>Combi</b>		# CC213xxx . . . . .	86	Chase Factory Select . . . . .	45
# 378099 . . . . .	29	# CC217xxx . . . . .	86	Chase LX . . . . .	45, 46
# 8220x . . . . .	30	# CC221xxx . . . . .	86	Chase Select . . . . .	45
BabyRide . . . . .	29	# IC313xxx . . . . .	81	Evolve 3-in-1 . . . . .	47
Coccoro . . . . .	30	# IC335xxx . . . . .	82	Express Factory Select . . . . .	48
		# IC336xxx . . . . .	83	Maestro . . . . .	49
		# IC337xxx . . . . .	83	Maestro Factory Select . . . . .	49
<b>Cybex (CTP)</b>		# IC338xxx . . . . .	83	Momentum 65 . . . . .	50
# 514xxxxxx . . . . .	31	# IC370xxx . . . . .	84	Momentum 65 DLX . . . . .	50
# 515xxxxxx . . . . .	32, 34, 35	# TR416xxx . . . . .	83	Secure Kid 100 . . . . .	51
# 517xxxxxx . . . . .	34, 35	# TR427xxx . . . . .	83	Secure Kid 300 . . . . .	51
# 518000385 . . . . .	36	# TR428xxx . . . . .	83	Secure Kid 400 . . . . .	51
# 518000387 . . . . .	36	# TR430xxx . . . . .	83	Secure Kid LX . . . . .	51
# 518002145 . . . . .	36	# TR433xxx . . . . .	81	Secure Kid LX Factory Sel . . . . .	51
# 518002149 . . . . .	36	# TR434xxx . . . . .	81	Snugli All-in-One . . . . .	52
# 518002151 . . . . .	36	Adorra . . . . .	83	Snugli Booster . . . . .	53
# 518002153 . . . . .	36	Coral XP . . . . .	81	SureRide DLX . . . . .	54
# 518xxxxxx . . . . .	33	Gia XP . . . . .	83	Symphony . . . . .	56
# 519000211 . . . . .	36	IC335xxx . . . . .	82	Symphony 65 DLX . . . . .	55
# 519xxxxxx . . . . .	32, 33, 35	Mara XT . . . . .	81	Symphony 65 E3 . . . . .	56
# 521xxxxxx . . . . .	32, 35	Mico Luxe + . . . . .	84	Symphony DLX . . . . .	55
Aton . . . . .	31	Mico XP Max . . . . .	83	Symphony LX . . . . .	55
Aton 2 . . . . .	32	Pria 70 . . . . .	85	Titan 65 . . . . .	57
Aton 2 SensorSafe . . . . .	32	Pria 85 . . . . .	86	Titan 65 Factory Select . . . . .	57
Aton M . . . . .	33	Pria 85 Max . . . . .	86	Transitions . . . . .	58
Aton M SensorSafe . . . . .	33	Tayla . . . . .	83		
Aton Q . . . . .	34	Tayla XT . . . . .	81		
Cloud Q . . . . .	35	Zelia 2 Max . . . . .	83		
Cloud Q SensorSafe . . . . .	35				
Sirona M . . . . .	36				
		<b>Dorel (Safety 1st)</b>		<b>Graco</b>	
<b>Diono</b>		# IC351xxx . . . . .	91	# 1794333 . . . . .	63
# 16000 . . . . .	40, 41, 42	# IC372xxx . . . . .	91	# 1794334 . . . . .	68
# 16600 . . . . .	40	Onboard35 SecureTech . . . . .	91	# 1812930 . . . . .	60
# 16800 . . . . .	41	SecureTech Base . . . . .	91	# 1813015 . . . . .	68
# 16900 . . . . .	42			# 1813040 . . . . .	63
# 300000 . . . . .	39, 43	<b>Dorel China America (babidéal)</b>		# 1813074 . . . . .	68
# 30100 . . . . .	38	# BC901BPXL . . . . .	3	# 1853478 . . . . .	68
# 30300 . . . . .	43	Storm Booster . . . . .	3	# 1871689 . . . . .	68
# 30400 . . . . .	39			# 1872691 . . . . .	68
# 31200-US-01 . . . . .	37	<b>Evenflo</b>		# 1877535 . . . . .	68
# 31201-US-01 . . . . .	37	# 306xxx . . . . .	45	# 1908152 . . . . .	68
# 31202-US-01 . . . . .	37	# 308xxx . . . . .	51, 53	# 1910130 . . . . .	66
Cambria 2 . . . . .	37	# 30911118AD . . . . .	44	# 1923980 . . . . .	66
Olympia . . . . .	38	# 30911120D . . . . .	44	# 1924519 . . . . .	73
Pacifica . . . . .	39	# 30911173AD . . . . .	44	# 1924520 . . . . .	73
Radian R100 . . . . .	40	# 3091967AD . . . . .	44	# 1926538 . . . . .	66
Radian R120 . . . . .	41	# 310xxx . . . . .	49	# 1926539 . . . . .	66
Radian RXT . . . . .	42	# 329xxx . . . . .	46, 48	# 1954477 . . . . .	64
Rainier . . . . .	43	# 34411029 . . . . .	58	# 1963973 . . . . .	76
		# 34411686 . . . . .	58	# 1963974 . . . . .	76
		# 34411695 . . . . .	58	# 1963975 . . . . .	76
<b>Dorel (Maxi-Cosi)</b>		# 34411700 . . . . .	47	# 1963976 . . . . .	76
# CC121xxx . . . . .	86	# 34411741 . . . . .	47	# 1967886 . . . . .	76
# CC133xxx . . . . .	85	# 345xxx . . . . .	55	# 1975173 . . . . .	76
# CC156xxx . . . . .	86	# 346xxx . . . . .	52, 56	Argos 70 . . . . .	59
# CC182xxx . . . . .	86	# 371xxx . . . . .	54, 57	Argos 70 Elite . . . . .	59
# CC183xxx . . . . .	86	# 385xxx . . . . .	50	Classic Ride . . . . .	60
# CC191xxx . . . . .	86	Big Kid Booster . . . . .	44	Classic Ride 50 . . . . .	61
# CC201xxx . . . . .	86	Chase DLX . . . . .	46	ComfortSport . . . . .	62, 63
# CC212xxx . . . . .	86			Extend2Fit . . . . .	64
				Head Wise 70 + SftySurnd . . . . .	65
				Milestone . . . . .	66

For the model numbers "x" = more numbers or letters follow

Index number refers to "List No." for each listing

**Graco (continued)**

My Ride 65 ..... 67, 68  
 My Ride 65 + SftySurnd..... 67  
 My Ride 70 ..... 69  
 My Size 70..... 70  
 Nautilus 3-in-1 ..... 71  
 Nautilus Elite ..... 71  
 Nautilus Plus ..... 71  
 Ready Ride ..... 72, 73  
 Size4Me70..... 74  
 Smart Seat..... 75  
 Smart Seat + SftySurnd..... 75  
 TurboBooster..... 76

**Harmony**

# 9999 - All Models ..... 77  
 Big Boost Deluxe ..... 77

**JD E-Commerce America**

Marainbow ..... 78

**Joybuy Express**

See JD E-Commerce America ..... 79

**Kiddy USA**

# 51 100 WP ..... 80  
 World Plus ..... 80

**Maxi-Cosi (Dorel)**

# CC121xxx ..... 86  
 # CC133xxx ..... 85  
 # CC156xxx ..... 86  
 # CC182xxx ..... 86  
 # CC183xxx ..... 86  
 # CC191xxx ..... 86  
 # CC201xxx ..... 86  
 # CC212xxx ..... 86  
 # CC213xxx ..... 86  
 # CC217xxx ..... 86  
 # CC221xxx ..... 86  
 # IC313xxx ..... 81  
 # IC335xxx ..... 82  
 # IC336xxx ..... 83  
 # IC337xxx ..... 83  
 # IC338xxx ..... 83  
 # IC370xxx ..... 84  
 # TR416xxx ..... 83  
 # TR427xxx ..... 83  
 # TR428xxx ..... 83  
 # TR430xxx ..... 83  
 # TR433xxx ..... 81  
 # TR434xxx ..... 81  
 Adorra ..... 83  
 Coral XP ..... 81  
 Gia XP ..... 83  
 Infant Car Seat Base ..... 82  
 Mara XT ..... 81  
 Mico Luxe + ..... 84  
 Mico XP Max ..... 83

Pria 70 ..... 85  
 Pria 85 ..... 86  
 Pria 85 Max ..... 86  
 Tayla ..... 83  
 Tayla XP ..... 81  
 Zelia 2 Max ..... 83

**Merritt Manufacturing (Angel Guard)**

AngelRide Car Bed ..... 2

**Orbit Baby**

# ORB822000 (Base) ..... 87  
 Car Seat Base G2 ..... 87

**Portable Child/Infant Seat**

Any Model / Any Date ..... 88

**Recaro**

# 332.01.xxx ..... 90  
 # 333.01.xxx ..... 89  
 Performance RIDE ..... 89  
 ProRIDE ..... 90

**Safety 1st (Dorel)**

# IC351xxx ..... 91  
 # IC372xxx ..... 91  
 Onboard35 SecureTech ..... 91  
 SecureTech Base ..... 91

**Snugli**

See Evenflo ..... 52, 53

**WAYB**

# CSTPI-##-001 ..... 93  
 Pico ..... 93