

HIGHWAY SAFETY RESEARCH CENTER CAR SEAT RECALL LIST ARCHIVE

Last Revision: May 30, 2023

Download this list & sign up for email notification of updates: buckleupnc.org/car-seat-recall-list

About Car Seats and Recalls

It is very important to pay attention to recall notices and for parents to check if their seats are safe to use. Recalls can be issued for any failure to meet Federal Motor Vehicle Safety Standard 213. Most recalls are issued due to reasons related to the crashworthiness of the car seat, but some recalls are for deviations from the standards related to labeling requirements, flammability of the upholstery or padding, or for parts that may come loose and pose a choking hazard. All recalls should be corrected.

Car seats are required to have a label indicating the manufacturer, model information, and date of manufacture. Car seats should not be used if these labels are missing. It is important for people to register their car seat by either mailing the registration card to the manufacturer or by contacting the manufacturer directly.

In cases where the manufacturer of a recalled seat has gone out of business or discontinued replacement programs, parents are advised to discontinue use of the seat. Discarded seats should be taken apart and stripped of upholstery, padding and straps and then destroyed by having them crushed to prevent others from using them.

To report any suspected car seat defects, call the National Highway Traffic Safety Administration Auto Safety Hotline at 888-327-4236 / (TTY): 800-424-9153.

About Older Car Seats and Recalls

The older model list includes recalled seats that are now 10 or more years old. Caregivers will sometimes choose to use older car seats even though it not recommended. Knowing that a particular model is under recall should help to encourage the caregiver to destroy the older seat and obtain a new one.

About the HSRC Recall List

The UNC Highway Safety Research Center (HSRC) car seat recall list is updated as soon as possible after recall notifications are announced and after the information can be verified for completeness and accuracy. Users of this (or any other) recall list should remind parents/caregivers to contact the manufacturer to be certain whether or not a particular car seat is affected by any recalls and how to proceed with repairs or replacement.

Instructions for Using the HSRC Recall List

Find the manufacturer, model name, model number, and date of manufacture on the label of the car seat. Using this information, look to see if the manufacturer, model, and dates of manufacture match any of the listings. The list is alphabetized by manufacturer and model name. When in doubt, contact the manufacturer for clarification.

For further information, contact:

Bevan Kirley or Kristel Robison

The University of North Carolina Highway Safety Research Center

800-672-4527 x2 or cps@hsrb.unc.edu

www.buckleupnc.org/car-seat-recall-list

This Page Intentionally Left Blank

Car seats manufactured before 1981 were not required to be crash tested and must not be used. Most manufacturers stamp their car seats with an expiration date, typically six to eight years from the date of manufacture, on a label or in the shell of the seat. Many child passenger safety advocates recommend that if no expiration date can be found, car seats older than ten years should be replaced by a new one. Older models are included as a part of this recall list because care givers will sometimes choose to use older car seats even though it goes against the recommendations of most organizations and advocates. Knowing that a particular model is under recall, and if the defect cannot be corrected, should help to encourage the care giver to destroy the older seat and obtain a new one.

Following are recalls and safety notifications that were issued for models where all or most models sold are at least 10 years old as of May 30, 2023. The listing of older models with recalls will only be updated as "newer" models get to be old enough to be moved to the "older" models list.

Programs that make multiple copies of the HSRC recall list, e. g., for use at clinics or permanent checking/fitting stations, should only have to make copies of this older model section when it is revised, regardless of how often the main (newer model) section is revised. Most clinics or permanent checking/fitting stations should only need to print/copy one or two older model lists for reference. Updated versions of this list, as well as the list of models less than 10 years old, are posted on-line at www.buckleupnc.org/car-seat-recall-list.

CAR SEATS 10 YEARS OLD AND OLDER

Download this list & sign up for email notification of updates: buckleupnc.org/car-seat-recall-list

Refer to Page 24 for the Index of Recalls and Safety Notifications

List No.	Manufacturer Model Name	Model # ("X" = more numbers or letters follow)	Customer assistance Mfg Date	Problem Type and Consumer Action
----------	-------------------------	--	------------------------------	----------------------------------

Alcot (Childcare)

ALL MODELS OLDER THAN 10 YEARS - REPLACEMENT PROGRAM DISCONTINUED - DESTROY & REPLACE

201) Child Love Seat

3/84-11/84 Plastic shell may develop cracks. Destroy & replace seat.

All Our Kids

ALL MODELS OLDER THAN 10 YEARS - REPLACEMENT PROGRAM DISCONTINUED - DESTROY & REPLACE

202) Little Cargo Vest 600

4/93-3/94 Flammability of upholstery. Call mfg. for repair info.

203) Little Cargo Vest 602

3/94-9/94 Flammability of upholstery. Call mfg. for repair info.

Alpha Elite (Dorel)

**Dorel Juvenile Group: 866-623-3139 / 800-219-0509 / 866-611-3022 / 812-372-0141
www.djgusa.com**

204) Alpha Luxe 22462x

05/01/08-04/30/09 Harness locking and release button does not always return to its locked position and could result in a loose harness, increasing the risk of being injured a crash. Contact mfg. for repair kit.

205) Alpha Omega All-N-1 22459x
Alpha Omega Elite 22148x, 22149x, 22158x

05/01/08-04/30/09 Harness locking and release button does not always return to its locked position and could result in a loose harness, increasing the risk of being injured a crash. Contact mfg. for repair kit.

Car Seat Recalls and Safety Notifications: MODELS 10 YEARS OLD AND OLDER

For the model numbers "x" = more numbers or letters follow

List No.	Manufacturer Model # ("X" = more numbers or letters follow)	Customer assistance
	Model Name	Mfg Date Problem Type and Consumer Action

Alpha Elite (Dorel) (continued)

206)	Comfort Infant Seat	22331 BLA, 22332 RLA	07/26/05- 02/28/06	Trim screws on handle can loosen resulting in a potential choking hazard. Contact mfg. at 877-229-1374 for free repair kit. Make sure the handle trim screws are tight and continue to use the existing seat while waiting to receive and install the repair kit.
207)	Comfort Infant Seat	22331 BLA, 22332 RLA	07/26/05- 02/28/06	Some consumers have experienced difficulty installing the base in certain vehicles. Dorel will replace the original version of the base at no charge to the customer. Contact mfg. at 877-229-1374 to determine eligibility for a replacement base.

Alpha Sport (Dorel)

Dorel Juvenile Group: 866-623-3139 / 800-219-0509 / 866-611-3022 / 812-372-0141
www.djgusa.com

208)	Enspira	22452x, 22458x	05/01/08- 04/30/09	Harness locking and release button does not always return to its locked position and could result in a loose harness, increasing the risk of being injured a crash. Contact mfg. for repair kit.
209)	Vantage	22546x, 22547x	05/01/08- 04/30/09	Harness locking and release button does not always return to its locked position and could result in a loose harness, increasing the risk of being injured a crash. Contact mfg. for repair kit.

American Motors

ALL MODELS OLDER THAN 10 YEARS - REPLACEMENT PROGRAM
DISCONTINUED - DESTROY & REPLACE

210)	Infant Love Seat	All	1/81-12/82	Plastic shell may develop cracks. Destroy & replace seat.
211)	Child Love Seat	All	3/84-11/84	Plastic shell may develop cracks. Destroy & replace seat.

Baby Trend

800-328-7363 - www.babytrend.com

212)	Rigid Latch-Loc	6439, 6448, 6481	05/14/07- 04/01/08	Incorrect steel used on the latch connector can crack and allow the child seat base to detach from the vehicle's latch anchors during a severe crash. Contact mfg. for a replacement base. Install with vehicle seat belt until base is replaced.
213)	Rigid Latch-Loc Base	6400	05/14/07- 04/01/08	Incorrect steel used on the latch connector can crack and allow the child seat base to detach from the vehicle's latch anchors during a severe crash. Contact mfg. for a replacement base. Install with vehicle seat belt until base is replaced.

Babyhood Industries

ALL MODELS OLDER THAN 10 YEARS - REPLACEMENT PROGRAM
DISCONTINUED - DESTROY & REPLACE

214)	Wonda Chair	810	Pre 12/82	Harness may be misrouted. Call mfg. for instructions.
215)	Baby-Sitter	8200	1/92-6/93	Buckle. Call mfg. for repair info.

Basic Comfort

ALL MODELS OLDER THAN 10 YEARS - REPLACEMENT PROGRAM
DISCONTINUED - DESTROY & REPLACE

216)	Galaxy 2000	960, 961	ALL	Crash test failure. Call mfg. for repair info.
217)	Galaxy 2000	960, 961	11/98-1/99	Faulty molding of foam backs and cushions may allow separation of part of the booster seat. Call mfg. for repair info.

Car Seat Recalls and Safety Notifications: MODELS 10 YEARS OLD AND OLDER

For the model numbers "x" = more numbers or letters follow

List No.	Manufacturer Model Name	Model # ("X" = more numbers or letters follow)	Customer assistance Mfg Date	Problem Type and Consumer Action
Beatrix Potter (Dorel)			Dorel Juvenile Group: 800-219-0509 / 866-611-3022 / 812-372-0141 www.djgusa.com	
218)	Designer 22	02-621-SAL, 02-620-xxx	01/03/02-02/13/02	Plastic handle can unexpectedly release from the carrying position when used as a carrier. Does not affect safety as a child restraint. Contact mfg. for repair kit.
Bertini (Dorel)			Dorel Juvenile Group: 866-623-3139 / 800-219-0509 / 866-611-3022 / 812-372-0141 www.djgusa.com	
219)	SureFit (Travel system)	22346x	05/01/08-04/30/09	Harness locking and release button does not always return to its locked position and could result in a loose harness, increasing the risk of being injured a crash. Contact mfg. for repair kit.
Bolform Corp.			ALL MODELS OLDER THAN 10 YEARS - NO LONGER IN BUSINESS - DESTROY & REPLACE	
220)	Buckle-Up Harness	84E-019	ALL	Crash test failure. Destroy & replace.
Britax			888-427-4829 / 704-409-1700 www.britaxusa.com	
221)	Advantage	E902228	03/05/01-07/26/01	One of the tether brackets of affected seats may separate from the tether attachment point. Contact mfg. for repair kit.
222)	Advocate 70-G3	E9LG81A, E9LG83x, E9LL21A, E9LL23P, E9LL23Y	06/01/12-08/31/12	Children who bite or chew on the shoulder strap HUGS pads could bite off small pieces, presenting a choking hazard. Contact mfg. for replacement HUGS pads and instructions.
223)	Boulevard	E9L57	03/01/06-08/01/06	Top tether hook can open during a crash allowing the restraint to change from an upright to a reclined position. Owners are being advised to discontinue use of the top tether when the child reaches 50 lbs. Contact mfg. for replacement labels.
224)	Boulevard 70-G3	E9LJ91x, E9LJ92E, E9LJ93P, E9LJ93S, E9LK91A	06/01/12-08/31/12	Children who bite or chew on the shoulder strap HUGS pads could bite off small pieces, presenting a choking hazard. Contact mfg. for replacement HUGS pads and instructions.
225)	Chaperone	E9L69N9, E9L69P2, E9L69P3, E9L69P5	04/01/09-05/31/10	The chest clip may break when it is engaged as the infant is secured into the infant car seat creating a safety hazard. Contact mfg. for repair kit.
226)	Chaperone	E9L692J, E9L692K, E9L692L, E9L692M	09/01/10-04/30/11	Voluntary Recall - The harness adjuster may detach from the shell due to an improperly installed rivet. Contact mfg. for repair kit.
227)	Companion	E9L14	10/31/03-06/06/04	One or both of two tabs on the bottom of the carrier may not be properly seated and may allow the carrier to rotate in the base too far in a crash. Correct/incorrect assembly can be determined by visual examination. Call mfg. for replacement info. Affected units may be installed without the base until receiving a replacement.
228)	Companion	E9L14, E9L20, E9L80	Pre-11/01/07	User Guide Update - NOT A RECALL: Britax has updated instructions regarding adjustment of the buckle strap position and maximum height for infant carrier use. The inner buckle strap position should be used for infants weighing less than 11 pounds. A child has exceeded the height limit for the Companion when the top of the head is less than one inch from the top of the child restraint or the child's height exceeds 30 inches (76 cm). Contact mfg for updated user guide and labels

Car Seat Recalls and Safety Notifications: MODELS 10 YEARS OLD AND OLDER

For the model numbers "x" = more numbers or letters follow

List No.	Manufacturer Model # ("X" = more numbers or letters follow)	Customer assistance Mfg Date	Problem Type and Consumer Action
Britax (continued)			
229)	Decathlon E9L47	02/12/05-07/31/07	Under certain circumstances the harness adjuster housing may separate from the child restraint shell and allow the adjuster to move out of position. If this happens caregivers may experience difficulty adjusting the harness. Call mfg. for repair info.
230)	Freeway 101	6/96-4/97	Buckle. Call mfg. for repair info.
231)	Frontier E9L54E7, E9L54H6, E9L54H7, E9L54M6	04/01/08-09/14/08	Harness straps may become detached from the metal yoke on the back of the seat If they are loosened one strap at a time with excessive force. Contact mfg. for repair kit.
232)	Frontier E9L5490	04/01/08-09/17/08	Harness straps may become detached from the metal yoke on the back of the seat If they are loosened one strap at a time with excessive force. Contact mfg. for repair kit.
233)	Husky E9L30	08/01/02-12/31/03	Head excursions higher than allowed by FMVSS 213 could result when installed as instructed with a long/serpentine belt path. Contact mfg. for replacement labels advising the use of an alternative short belt path.
234)	Husky E9L30	Pre-07/24/04	The adjuster strap may slip within the metal buckle that controls the tightness of the shoulder harness and may allow the harness to loosen. Contact mfg. for repair kit.
235)	Marathon E9L06	Pre-07/24/04	The adjuster strap may slip within the metal buckle that controls the tightness of the shoulder harness and may allow the harness to loosen. Contact mfg. for repair kit.
236)	Marathon E9L06, E9W06, E906 with top tether lot # KGR 01 A	05/23/06-07/28/06	The top tether hook may open and have the potential to release from the tether anchor if the child exceeds 50 pounds. Contact mfg. for repair kit.
237)	Pavilion 70-G3 E9LK31x, E9LK32x, E9LK33Q, E9LL11x, E9LL12x	06/01/12-08/31/12	Children who bite or chew on the shoulder strap HUGS pads could bite off small pieces, presenting a choking hazard. Contact mfg. for replacement HUGS pads and instructions.
238)	Regent E9L39x	11/10/05-06/18/07	Consumer Advisory/Product Update - NOT A RECALL: Britax has modified the Regent and revised the installation instructions. Contact mfg. to receive a free product update kit that includes a revised user guide, replacement belt-routing label, a longer LATCH connector strap, and adhesive slip resistant strips.
239)	Regent Classic E9L3998	12/18/06-01/18/07	Affected seats were produced with an incorrect airbag warning label attached to the cover. Contact mfg. to receive a free replacement cover.
240)	Roundabout 161	1/99-3/99	Possible faulty molding of shell can allow excessive head excursion. Call mfg. for repair info.
241)	Super Elite E9031	04/25/01-02/15/02	Harness may allow too much forward head movement. Contact mfg. to receive a free replacement harness system.
242)	Super Elite E9031	04/01/01-08/31/02	Harness adjuster tab may begin to stick after prolonged use. Harness may loosen if it sticks in the open position. Contact mfg. for repair kit and installation instructions.
243)	Traveller Plus E9L32 (Mfg. by Britax for Snug Seat)	Pre-07/24/04	The adjuster strap may slip within the metal buckle that controls the tightness of the shoulder harness and may allow the harness to loosen. Contact mfg. for repair kit.
244)	Wizard E9L07	Pre-07/24/04	The adjuster strap may slip within the metal buckle that controls the tightness of the shoulder harness and may allow the harness to loosen. Contact mfg. for repair kit.
Century Products		800-837-4044 / 216-468-2000	
245)	100 4100	1/81-4/81	Upholstery buttons. Call mfg. for repair info.

Car Seat Recalls and Safety Notifications: MODELS 10 YEARS OLD AND OLDER

Produced by: UNC Highway Safety Research Center - 800-672-4527 x2
 Funded by: NC Governor's Highway Safety Program

Download this list & sign up for email notification of updates:
buckleupnc.org/car-seat-recall-list

For the model numbers "x" = more numbers or letters follow

List No.	Manufacturer Model # ("X" = more numbers or letters follow)	Customer assistance Mfg Date	Problem Type and Consumer Action
----------	---	------------------------------	----------------------------------

Century Products (continued)

246)	100	4100	4/85-2/86	Plastic shell may crack in crash. Call mfg. for repair info.
247)	1000 STE	4153, 4163, 4180	12/90-10/91	Incorrect labels on seat. Call mfg. for corrections
248)	200	4200, 4210, 4235, 4214, 4223	1/81-4/81	Upholstery buttons. Call mfg. for repair info.
249)	200	4200, 4210, 4235, 4214, 4223	June 81	Washers on frame. Call mfg. for repair info.
250)	200	4200, 4210, 4235, 4214, 4223	1/81-1/83	Buckle. Call mfg. for repair info.
251)	200	4200, 4210, 4235, 4214, 4223	4/85-2/86	Plastic shell may crack in crash. Call mfg. for repair info.
252)	2000 STE	4253, 4263, 4265	4/84-6/89	Harness. Call mfg. for repair info.
253)	2000 STE	4253, 4261, 4263, 4265, 4266	12/90-10/91	Incorrect labels on seat. Call mfg. for corrections
254)	2000 STE	4253, 4261, 4263, 4265, 4266	12/91-4/92	Buckle. Call mfg. for repair info.
255)	300	4300, 4302, 4303, 4323, 4310, 4334, 4335	4/85-2/86	Plastic shell may crack in crash. Call mfg. for repair info.
256)	3000 STE	4365DT, 4366	3/89-10/89	Upholstery. Call mfg. for repair info.
257)	3000 STE	4353, 4365, 4366, 4368	5/90-6/90	Crash test failure of buckle. Call mfg. for repair info.
258)	3000 STE	4353, 4365, 4366, 4368	Pre 91	Buckle instructions. Call mfg. for corrections
259)	3000 STE	4365, 4366, 4367, 4368, 4369, 4380, 4381	12/90-10/91	Incorrect labels on seat. Call mfg. for corrections
260)	3000 STE	4353, 4365, 4366, 4367, 4368, 4369	10/89-4/92	Buckle. Call mfg. for repair info.
261)	3500 STE	4380	12/90-4/92	Buckle. Call mfg. for repair info.
262)	4-In-1 Travel System	11-570, 11-597, 11-600, 11-650	9/95-5/96	Buckle. Call mfg. for repair info.
263)	4-In-1 Travel System	11-564, 11-565, 11-570, 11-575, 11-576, 11-578, 11-595, 11-597, 11-598, 11-599, 11-600	01/01/91-07/31/97	Handle can break when the seat is used as an infant carrier causing the infant to fall to the ground be injured. Does not affect safety as car seat. Call 800-865-1419 for replacement handle.
264)	400XL	4400, 4434, 4436, 4446	4/85-2/86	Plastic shell may crack in crash. Call mfg. for repair info.
265)	400XL	4400, 4434, 4436, 4446	11/84-4/86	Shield. Call mfg. for repair info.
266)	5000 STE	4450, 4460, 4475	12/88-11/89	Buckle. Call mfg. for repair info.
267)	5000 STE	4450, 4460, 4470, 4475	5/90-6/90	Crash test failure of buckle. Call mfg. for repair info.
268)	5000 STE	4460, 4470, 4475, 4476, 4480, 4490	12/90-10/91	Incorrect labels on seat. Call mfg. for corrections
269)	5000 STE	4450, 4460, 4470, 4475, 4476	09/89-4/92	Buckle. Call mfg. for repair info.

Car Seat Recalls and Safety Notifications: MODELS 10 YEARS OLD AND OLDER

For the model numbers "x" = more numbers or letters follow

List No.	Manufacturer Model # ("X" = more numbers or letters follow)	Customer assistance Mfg Date	Problem Type and Consumer Action
----------	---	------------------------------	----------------------------------

Century Products (continued)

270)	5000 STE	4450, 4460, 4470, 4475,	Pre 91	Buckle instructions. Call mfg. for corrections.
271)	5500 STE	4480, 4490	01/91-4/92	Buckle. Call mfg. for repair info.
272)	580	4581, 4583, 4585	6/86-10/89	Screws for carry handle. Call mfg. for repair info.
273)	580	4580, 4581, 4583, 4585	7/86-12/89	Incorrect instructions. Call mfg. for corrections.
274)	Accel	45100, 45200, 45600, 45700	04/09/01-05/10/01	Harness adjustment lock may allow webbing to slip during a serious crash when used in the forward facing mode for some models and lot codes. Call Century at 1-800-575-6097 for replacement info.
275)	Affinity Infant Seat	4575	9/95-5/96	Buckle. Call mfg. for repair info.
276)	Bravo	44622, 44630, 44631, 44662	04/09/01-05/10/01	Harness adjustment lock may allow webbing to slip during a serious crash when used in the forward facing mode for some models and lot codes. Call Century at 1-800-575-6097 for replacement info.
277)	Brevera Contour	4875	2/95-7/98	Product improvement campaign: Buckle for the harness can crack or break. Call mfg. for replacement information.
278)	Brevera Premiere	4885	2/95-7/98	Product improvement campaign: Buckle for the harness can crack or break. Call mfg. for replacement information.
279)	Child Love Seat	4600	3/84-11/84	Plastic shell may develop cracks. Destroy & replace seat.
280)	Encore	44612, 4662	04/09/01-05/10/01	Harness adjustment lock may allow webbing to slip during a serious crash when used in the forward facing mode for some models and lot codes. Call Century at 1-800-575-6097 for replacement info.
281)	Infant Car Seat	4535, 4560, 4565, 4590	9/95-5/96	Buckle. Call mfg. for repair info.
282)	Infant Car Seat	12-565, 4513, 4515, 4516, 4518, 4551, 4557, 4558, 4559, 4564, 4565, 4566, 4568, 4569, 4575, 4576, 4589, 4591, 4593, 4594, 4595, 4597	01/01/91-07/31/97	Handle can break when the seat is used as an infant carrier causing the infant to fall to the ground be injured. Does not affect safety as car seat. Call 800-865-1419 for replacement handle.
283)	Infant Love seat	4500, 4510, 4520	1/81-12/82	Plastic shell may develop cracks. Destroy & replace seat.
284)	Smart Fit	4525	9/95-5/96	Buckle. Call mfg. for repair info.
285)	Smart Move	4750	11/95-2/96	Buckle. Call mfg. for repair info.
286)	Smart Move	44709	04/09/01-05/10/01	Harness adjustment lock may allow webbing to slip during a serious crash when used in the forward facing mode for some models and lot codes. Call Century at 1-800-575-6097 for replacement info.

Chicco**800-807-8817 / 877-424-4226 - www.chiccousa.com**

287)	Key Fit Key Fit 30 Cortina Travel Systems BASES ONLY	All	02/26/08-03/17/08	Recall applies only to <u>bases</u> manufactured between 2/26/2008 and 3/17/2008. When installed with LATCH, the webbing used to tighten the base can slip through the adjustment lock. Bases with serial number is between 08 02 26 (February 26, 2008) and 08 03 17 (March 17, 2008) are covered by this recall. Contact mfg. for replacement base. Install the base with the vehicle seat belts until replacement base is obtained.
------	--	-----	-------------------	--

Car Seat Recalls and Safety Notifications: MODELS 10 YEARS OLD AND OLDER

For the model numbers "x" = more numbers or letters follow

List No.	Manufacturer Model # ("X" = more numbers or letters follow)	Customer assistance
	Model Name	Mfg Date Problem Type and Consumer Action

Chrysler**ALL MODELS OLDER THAN 10 YEARS - REPLACEMENT PROGRAM
DISCONTINUED - DESTROY & REPLACE**

288) Child Love Seat All 3/84-11/84 Plastic shell may develop cracks. Destroy & replace seat.

Collier-Keyworth**800-544-1108**

289) Co-Pilot All 82-83 Shield. Call mfg. for repair info.
 290) Safe & Sound II All 12/84-4/85 Buckle. Call mfg. for repair info.
 291) Commuter All 10/87-02/88 Padding. Call mfg. for repair info.

Combi USA**800-992-6624 / 803-548-6633 - www.combi-intl.com**

292) Avatar 8100 11/12/03- Lower latch anchorage does not meet dynamic test requirements of FMVSS 213.
 05/07/04 Contact mfg. for free in-home repair kit and instructions. Affected models should be installed with the vehicle seat belt. Do not use the seat with the latch until repairs are made.

293) Centre ST 8065 10/19/05- The car seat could potentially become separated from its base in a crash. Mfg.
 Centre DX 8074 12/15/07 recommends that the car seat be used without the base until it has been fixed.
 Centre EX 8086 Contact mfg. for free retrofit kit. Also affected are travel systems (# 4400, 4515, and
 Centre ARB 8520 4520) that contain the Centre and Shuttle car seats.

294) Coccoro 8220 01/06/09 - Harness webbing fails to meet FMVSS-213 minimum breaking strength
 12/05/12 requirements. Contact mfg. for free harness replacement kit and instructions. The
 seats can continue to be used until the kits are made available and repairs are made.

295) Shuttle 8087 10/19/05- The car seat could potentially become separated from its base in a crash. Mfg.
 12/15/07 recommends that the car seat be used without the base until it has been fixed.
 Contact mfg. for free retrofit kit. Also affected are travel systems (# 4400, 4515, and
 4520) that contain the Centre and Shuttle car seats.

296) Zeus 360 8836 02/25/09 - Harness webbing fails to meet FMVSS 213 minimum breaking strength
 05/24/12 requirements. Contact mfg. for free harness replacement kit and instructions. The
 seats can continue to be used until the kits are made available and repairs are made.

297) Zeus Turn 8815 07/15/07 - Harness webbing fails to meet FMVSS 213 minimum breaking strength
 03/25/09 requirements. Contact mfg. for free harness replacement kit and instructions. The
 seats can continue to be used until the kits are made available and repairs are made.

Compass Baby**888-899-2229 - www.compassbaby.com**

298) Infant Car Seat I420 ARD 05/07/06, The metal slide crotch anchor can become dislodged allowing excessive movement
 I420 FUO 05/13/06, of the child and cracking of the plastic shell. This problem was discovered during
 I420 MAR and testing by the manufacturer. There have been no reports of injuries and no calls
 05/15/06 from consumers regarding problems. Contact mfg. for free repair kit.

Car Seat Recalls and Safety Notifications: MODELS 10 YEARS OLD AND OLDER

For the model numbers "x" = more numbers or letters follow

List No.	Manufacturer Model # ("X" = more numbers or letters follow)	Customer assistance Mfg Date	Problem Type and Consumer Action
Cosco (Dorel)		Dorel Juvenile Group: 800-219-0509 / 866-611-3022 / 812-372-0141	
299)	Alpha Omega 02-331, 02-332, 02-531, 02-533, 02-537, 02-555.	11/17/00-01/10/01	Tether webbing could be cut and separate in a crash allowing excessive movement of the child. Contact mfg. for free repair kit.
300)	Alpha Omega 02332, 02531, 02533, 02537, 02555	01/01/00-09/30/01	Tether webbing does not conform to abrasion requirements of FMVSS 213. Contact mfg. for free repair kit.
301)	Alpha Omega 22150, 22180, 22269 Alpha Omega 22155 Elite	11/01/03-12/31/05	There is a potential for the harness adjustment strap to loosen during use. Contact mfg. for free repair kit.
302)	Alpha Omega 22154x, 22155x, 22158x Elite	05/01/08-04/30/09	Harness locking and release button does not always return to its locked position and could result in a loose harness, increasing the risk of being injured a crash. Contact mfg. for repair kit.
303)	Alpha Omega 22150x All-N-1	05/01/08-04/30/09	Harness locking and release button does not always return to its locked position and could result in a loose harness, increasing the risk of being injured a crash. Contact mfg. for repair kit.
304)	Arriva 02-751	03/95-05/95	Buckle. Call mfg. for repair info.
305)	Arriva 02-729 TED	03/31/99-04/07/99	Airbag warning label is missing on seat pad. Fabric color noted by "TED" is only one affected. Call mfg. for replacement pad.
306)	Arriva 02-665, 02-727, 02-728, 02-729, 02-731, 02-732, 02-733, 02-750, 02-751, 02-755, 02-756, 02-757, 02-774	03/01/95-01/31/00	Handle locks can unexpectedly release when used as a carrier, causing the seat to flip forward. Does not affect safety as car seat. Call mfg. for repair info. [Note: a recall campaign initiated 06/25/03 added models made through 01/31/00 to a previous recall of those made through 09/97.]
307)	Infant Car Seat 22-300 CSF, 22-300 FZN, 22-300 JJV, 22-300 OSF, 22-300 THD, 22-300 TWD	01/06/08-04/06/09	The child restraint carry handle can loosen and come off posing a fall hazard to infants. The safety as a child restraint is not affected. Do not use handle until repaired. Contact mfg. for free repair kit. NOTE: Only those models sold as a part of the Spirit and Sprint Travel Systems are affected.
308)	Comfy Carry IC123 FSM	05/01/11-04/25/12	Some models were sold without a base and therefore did not provide lower LATCH attachments as required by FMVSS 213. Carriers can safely be installed without the base using the seat belt. Contact mfg. to obtain a base.
309)	Commuter 02-086	11/87-2/88	Upholstery/padding. Call mfg. for repair info.
310)	Designer 22 22-300-JOS GB1B	08/19/03-10/20/04	Harness can loosen if not properly tightened. Contact mfg. for free repair kit. Parents should continue to use the seat while waiting to receive/install the repair kit but are advised to make sure that the seat is properly adjusted while in use. NOTE: Models involved were sold only as travel systems (with a stroller) and any line code other than GB1B in the model # is not included in the recall.
311)	Dream Ride 02-719 ARQ	01/89-01/94	Upholstery flammability. Call mfg. for repair info.
312)	DreamRide 22-001FSM	12/01/03-04/28/04	Failed to meet back support angle requirements of FMVSS 213. Discontinue rear-facing use and use only as a car bed or request free replacement rear-facing child restraint from DJG. Contact mfg. for warning label and information.
313)	Hi Back Booster 02409, 02442, 02443, 02445, 02448, 02449, 02450, 02480, 02495	01/01/00-09/30/01	Tether webbing does not conform to abrasion requirements of FMVSS 213. Contact mfg. for free repair kit.

Car Seat Recalls and Safety Notifications: MODELS 10 YEARS OLD AND OLDER

Produced by: UNC Highway Safety Research Center - 800-672-4527 x2
 Funded by: NC Governor's Highway Safety Program

Download this list & sign up for email notification of updates:
buckleupnc.org/car-seat-recall-list

For the model numbers "x" = more numbers or letters follow

List No.	Manufacturer Model # ("X" = more numbers or letters follow)	Customer assistance
	Model Name	Mfg Date Problem Type and Consumer Action

Cosco (Dorel) (continued)

314)	Hi Back Booster	02442, 02443, 02448, 93443, 93514	03/15/02-08/01/02	UV stabilizer in harness webbing does not conform to requirements of FMVSS 213. Contact mfg. for free repair kit.
315)	High Rise Booster	22-297, 22-298, 22-299	10/01/03-10/31/03	Incorrect warning label stating it is for use forward facing for children under one year of age rather than OVER one year of age. Contact mfg. for free replacement label and instructions.
316)	Luxury Soft Shield Auto Trac	02-790, 02-890	10/89-6/90	Crash test failure. Call mfg. for repair info.
317)	Regal Ride	22139MON	09/28/04-09/20/07	Elastic straps on padding can come loose and become accessible to the child allowing the child to loop the elastic strap around portions of his/her body. Contact mfg. for repair kit.
318)	Safe-T-Shield	81A or B, 181A or B	10/80-6/83	Shield. Call mfg. to replace seat.
319)	Safe-T-Mate		1984	Wrong instructions. Call mfg. for repair info.
320)	Safe and Easy	313	1/84-6/85	Plastic shell. Call mfg. for repair info.
321)	Safe and Snug	323, 423	1/84-6/85	Plastic shell. Call mfg. for repair info.
322)	Sidekick Booster	244x	04/96-5/97	Crash test failure of shield. Use only as belt-positioning booster. Call mfg. for refund info.
323)	Soft Shield	02-090	10/89-6/90	Crash test failure. Call mfg. for repair info.
324)	Soft Shield Auto Trac	02-290	10/89-6/90	Crash test failure. Call mfg. for repair info.
325)	Soft Shield Deluxe	02-190	10/89-6/90	Crash test failure. Call mfg. for repair info.
326)	Touriva	02-084	5/94-8/94	Buckle. Call mfg. for repair info.
327)	Touriva Shield	02-014-EMF, 02-014-GDM, 02-015-PDL	8/97 (Mold #3)	Crash test failure of shell in front-facing recline position. Call mfg. for repair info.
328)	Touriva 5-point	02-514-BWE, 02-584-OXF, 02-518-NDF	8/97 (Mold #3)	Crash test failure of shell in front-facing recline position. Call mfg. for repair info.
329)	Touriva T-Shield	02-084, 02-094, 02-096, 02-404, 02-821	5/96-11/97	Crash test failure of post-test release pressure standard for the buckle. Call mfg. for repair info.
330)	Touriva	02014, 02015, 02019, 02084, 02094, 02114, 02504, 02514, 02518, 02519, 02524, 02584, 02803, 02806, 02821, 02825, 02935, 93084, 93094, 93514	01/01/00-09/30/01	Tether webbing does not conform to abrasion requirements of FMVSS 213. Contact mfg. for free repair kit.
331)	Touriva	02514, 02519, 02524, 22100, 93446, 93504	03/15/02-08/01/02	UV stabilizer in harness webbing does not conform to requirements of FMVSS 213. Contact mfg. for free repair kit.

Car Seat Recalls and Safety Notifications: MODELS 10 YEARS OLD AND OLDER

For the model numbers "x" = more numbers or letters follow

List No.	Manufacturer Model # ("X" = more numbers or letters follow)	Customer assistance Mfg Date	Problem Type and Consumer Action
----------	---	------------------------------	----------------------------------

Cosco (Dorel) (continued)

332)	Touriva	22100x, 22111x, 22130x, 93100x, 93111x	09/28/04-09/20/07	Elastic straps on padding can come loose and become accessible to the child allowing the child to loop the elastic strap around portions of his/her body. Contact mfg. for repair kit.
333)	Trooper	219x, 224x, 225x, 229x	10/96-2/97	Crash test failure. Call mfg. for repair info.
334)	Turnabout	02-667, 02-753, 02-756, 02-758, 02-759, 02-760, 02-761, 02-762, 02-763, 02-764, 02-765, 02-770, 02-771, 02-772	03/01/95-01/31/00	Handle locks can unexpectedly release when used as a carrier, causing the seat to flip forward. Does not affect safety as car seat. Call mfg. for repair info. [Note: a recall campaign initiated 06/25/03 added models made through 01/31/00 to a previous recall of those made through 09/97.]
335)	Voyager Infant Seat/Stroller	All	9/97-10/97	Potential dislodgement from stroller. Does not affect safety as car seat. Call mfg. for repair info.

Cybex**Distributed by Regal Lager: 800-593-5522 - www.regallager.com**

336)	Solution X-fix	0500200xx, 0500760xx	02/01/10-02/28/10	Booster seats have an incorrect warning statement about restraining unoccupied seats. Contact mfg. for replacement sticker and owner's manual.
------	----------------	----------------------	-------------------	--

Disney (Dorel)**Dorel Juvenile Group: 866-623-3139 / 800-219-0509 / 866-611-3022 / 812-372-0141 www.djgusa.com**

337)	Infant Car Seat	22-305 NAB, 22-305 PPH, 22-355 LBF, 22-355 PWK, 22-627 AWF	01/06/08-04/06/09	The child restraint carry handle can loosen and come off posing a fall hazard to infants. The safety as a child restraint is not affected. Do not use handle until repaired. Contact mfg. for free repair kit. NOTE: Only those models sold as a part of the Propack Travel System are affected.
------	-----------------	--	-------------------	--

Downunder**ALL MODELS OLDER THAN 10 YEARS - NO LONGER IN BUSINESS - DESTROY & REPLACE**

338)	Kangaroo Booster Seat	All (Pre- 1/98)		Safety improvement campaign: The shoulder belts may not be properly located when the child is placed in the restraint. The shoulder belt guides may not help achieve correct seat belt placement. Do not use this booster if the shoulder belt does not touch the child's chest.
------	-----------------------	-----------------	--	--

Eddie Bauer (Dorel)**Dorel Juvenile Group: 800-219-0509 / 866-611-3022 / 812-372-0141 www.djgusa.com**

339)	3-in-1	02-331, 02-332, 02-531, 02-533, 02-537, 02-555	11/17/00-01/10/01	Tether webbing could be cut and separate in a crash allowing excessive movement of the child. Contact mfg. for free repair kit.
340)	3-in-1 Deluxe 3-in-1 Deluxe Convrt.	22740, 22750, 22755, 22756, 22757, 22770	11/01/03-12/31/05	There is a potential for the harness adjustment strap to loosen during use. Contact mfg. for free repair kit.
341)	Alpha Omega Alpha Omega Elite	22750, 22755, 22756, 22757, 22770	11/01/03-12/31/05	There is a potential for the harness adjustment strap to loosen during use. Contact mfg. for free repair kit.

Car Seat Recalls and Safety Notifications: MODELS 10 YEARS OLD AND OLDER

For the model numbers "x" = more numbers or letters follow

List No.	Manufacturer Model # ("X" = more numbers or letters follow)	Customer assistance Mfg Date	Problem Type and Consumer Action
----------	---	------------------------------	----------------------------------

Eddie Bauer (Dorel) (continued)

342)	Comfort Infant Seat	22630xxx, 22631xxx	07/26/05-02/28/06	Trim screws on handle can loosen resulting in a potential choking hazard. Contact mfg. at 877-229-1374 for free repair kit. Make sure the handle trim screws are tight and continue to use the existing seat while waiting to receive and install the repair kit. (The 22630 models are part of the 01726 Eddie Bauer Integrated Travel System.)
343)	Comfort Infant Seat	22630xxx, 22631xxx	07/26/05-02/28/06	Some consumers have experienced difficulty installing the base in certain vehicles. Dorel will replace the original version of the base at no charge to the customer. Contact mfg. at 877-229-1374 to determine eligibility for a replacement base.
344)	Deluxe 3-in-1	22755x, 22758x, 22759x, 22790x, 22799x	05/01/08-04/30/09	Harness locking and release button does not always return to its locked position and could result in a loose harness, increasing the risk of being injured a crash. Contact mfg. for repair kit.
345)	Deluxe 3-in-1	22790xxx, CC046xxx	07/20/10-05/18/11	The rear-facing belt path installation arrows are incorrect, possibly appearing to point toward the forward-facing vehicle belt path location. Contact mfg. for replacement label kit.
346)	Designer 22	22-625 xxx GB1B	08/19/03-10/20/04	Harness can loosen if not properly tightened. Contact mfg. for free repair kit. Parents should continue to use the seat while waiting to receive/install the repair kit but are advised to make sure that the seat is properly adjusted while in use. NOTE: Models involved were sold only as travel systems (with a stroller) and any line code other than GB1B in the model # is not included in the recall.
347)	Enspira	22740	11/01/03-12/31/05	There is a potential for the harness adjustment strap to loosen during use. Contact mfg. for free repair kit.
348)	Enspira	22740x, 22741x	05/01/08-04/30/09	Harness locking and release button does not always return to its locked position and could result in a loose harness, increasing the risk of being injured a crash. Contact mfg. for repair kit.
349)	Hi Back Booster	02409, 02442, 02443, 02445, 02448, 02449, 02450, 02480, 02495	01/01/00-09/30/01	Tether webbing does not conform to abrasion requirements of FMVSS 213. Contact mfg. for free repair kit.
350)	Infant Car Seat	22-627 CGT, 22-627 FRK, 22-627 KGS, 22-627 SNW, 22-627 WPR, 22-655 BYTE	01/06/08-04/06/09	The child restraint carry handle can loosen and come off posing a fall hazard to infants. The safety as a child restraint is not affected. Do not use handle until repaired. Contact mfg. for free repair kit. NOTE: Only those models sold as a part of the Adventurer and Endeavor Travel Systems are affected.
351)	Prospect Adjustable Hiback Booster	22880x	05/01/08-04/30/09	Harness locking and release button does not always return to its locked position and could result in a loose harness, increasing the risk of being injured a crash. Contact mfg. for repair kit.
352)	SureFit	22657x, IC072x	05/01/08-04/30/09	Harness locking and release button does not always return to its locked position and could result in a loose harness, increasing the risk of being injured a crash. Contact mfg. for repair kit.
353)	Touriva	02870, 02871, 02875	01/01/00-09/30/01	Tether webbing does not conform to abrasion requirements of FMVSS 213. Contact mfg. for free repair kit.

Car Seat Recalls and Safety Notifications: MODELS 10 YEARS OLD AND OLDER

For the model numbers "x" = more numbers or letters follow

List No.	Manufacturer Model Name	Model # ("X" = more numbers or letters follow)	Customer assistance	
			Mfg Date	Problem Type and Consumer Action
Evenflo			800-525-2472 / 800-233-5921	
354)	410	410	6/88-4/89	Harness/shield. Call mfg. for repair info.
355)	Bobby Mac Champion	411	4/85-4/90	Buckle. Call mfg. for repair info.
356)	Bobby Mac Deluxe	412, 414, 415, 416	4/85-4/90	Buckle. Call mfg. for repair info.
357)	Booster Seat	470, 471	2/87-8/88	Upholstery buttons. Call mfg. for repair info.
358)	Booster Seat	242, 470, 471	4/85-4/90	Buckle. Call mfg. for repair info.
359)	Champion	224x	06/93-11/96	Crash test failure. Call mfg. for repair info.
360)	Champion	224x	06/93-11/96	Crash test failure. Call mfg. for repair info.
361)	Champion	219x, 224x, 225x, 229x	10/96-2/97	Crash test failure. Call mfg. for repair info.
362)	Cozy Carry	272x, 273x, 468x, 469x, 476x, 477x, 478x, 480x, 481x	ALL (11/01/01-08/31/02)	Upgrade Kit - Not a Recall: For owners of Cozy Carry infant car seats to improve the performance of the detachable base in certain types of collisions. The kit is only for detachable bases with the words "Cozy Carry" on them. Visit www.cozycarry.com or call 800-582-6698 for free kit.
363)	Discovery	390, 391, 534, 552	Pre-02/01/08	Voluntary Safety Recall - Testing showed that the car seat could potentially become separated from its base in high impact side collisions. Contact mfg. for free supplemental dual-hook fastener for enhanced safety performance.
364)	Discovery	3021769Z, 3021854Z	02/04/08	A small number of Discovery car seats may have shipped without complete assembly of the red release handle located on the back of the seat making it possible for the seat to separate from its base. Contact mfg. for replacement seat and base. Affected models can be used without the base while waiting for replacement.
365)	Dyn-O-Mite	441 thru 448	1/85-1/89	Crash test failure. Call mfg. for repair info.
366)	Dyn-O-Mite	202, 441 thru 448	4/85-4/90	Buckle. Call mfg. for repair info.
367)	Embrace	Begins with 317, 320, 397, 398, 540, 548, 549, 550, 556, 597, 598, 599	Pre-04/08/06	When used as an infant carrier, the handle can unexpectedly release, causing the seat to rotate forward. Handle should not be used until the repair kit has been installed. Affected restraints can continue to be used as a car seat properly installed in a vehicle. Contact mfg. for a free repair kit.
368)	Embrace 35	3151198, 3151953, 31511xxx, 31521138, 46811xxx, 48111xxx, 48411xxx, 52911307A, 55311xxx, 52921040	12/01/11-05/31/13*	The harness buckle may become resistant to unlatching over time so that it cannot be opened by pushing the release button, thus making it difficult to remove the child from the restraint in an emergency. *NOTE: Not all Embrace 35 models in the 12/01/11-05/31/13 date range are impacted. Contact mfg. for specific dates and replacement buckle if needed.
369)	First Choice	3604098	01/16/09-09/29/09	A label containing certain contact and certification information was inadvertently left off these car seats. Contact mfg. for a set of replacement labels.
370)	Infant Car Seat	456, 458	Pre 04/89	Crash test failure. Call mfg. for repair info.
371)	Infant Car Seat	201, 202, 441 thru 446, 448, 456, 458	04/85-04/90	Buckle. Call mfg. for repair info.

Car Seat Recalls and Safety Notifications: MODELS 10 YEARS OLD AND OLDER

For the model numbers "x" = more numbers or letters follow

List No.	Manufacturer Model # ("X" = more numbers or letters follow)	Customer assistance Mfg Date	Problem Type and Consumer Action
----------	---	------------------------------	----------------------------------

Evenflo (continued)

372)	Joyride	Begins with 203, 205, 210, 435, 493	01/88-12/98	When used as an infant carrier, the carry handle can unexpectedly release, cause the seat to flip forward, and cause infant to fall to the ground. Call mfg. for repair info.
373)	Maestro	3101198, 3101980, 31011048, 31011049, 31011059, 31011057C*	11/24/09-04/09/10*	A crack may form at the front of the seat adjacent to the harness adjuster in a crash. Evenflo recommends that the seat not be used with children < 40 pounds until repaired. Use as a booster for children > 40 pounds is OK. Call mfg. for free reinforcement kit. *Canadian seat 31011057C mfg dates: 12/17/09-04/26/10
374)	On My Way	Begins with 207, 492	12/95-07/97	When used as a carrier, the locking mechanism on the handle can slip, flipping the seat forward and tossing the baby on the ground. Call mfg. for repair info.
375)	On My Way	Begins with 200, 211, 447, 499	Pre-02/10/00	Safety Notification: Alignment posts in base can become bent after repeated use. Contact mfg. for free upgrade kit.
376)	On My Way base	639001, 639002	Pre-02/10/00	Safety Notification: Alignment posts in base can become bent after repeated use. Contact mfg. for free upgrade kit.
377)	One-Step	221, 401 thru 409	04/85-04/90	Buckle. Call mfg. for repair info.
378)	One-Step Deluxe	222, 223, 4176	04/85-04/90	Buckle. Call mfg. for repair info.
379)	Scout	229x	06/93-12/96	Crash test failure. Call mfg. for repair info.
380)	Scout	219x, 224x, 225x, 229x	10/96-02/97	Crash test failure. Call mfg. for repair info.
381)	Seven Year Seat	453, 454	02/87-08/88	Upholstery buttons. Call mfg. for repair info.
382)	Seven Year Seat	228, 453, 454	04/85-04/90	Buckle. Call mfg. for repair info.
383)	Snugli Embrace 35	30711365	06/01/12-11/30/12	The harness buckle may become resistant to unlatching over time so that it cannot be opened by pushing the release button, thus making it difficult to remove the child from the restraint in an emergency. Contact mfg. for a free repair kit.
384)	Travel Tandem (Joyride + base)	205x	01/88-03/96	Test failure with base. Use without base and call mfg. for repair info.
385)	Travel Tandem (Joyride + base)	205x, 210x	01/88-12/98	When used as an infant carrier, the carry handle can unexpectedly release, cause the seat to flip forward, and cause infant to fall to the ground. Call mfg. for repair info.
386)	Tribute	378x, 379x	09/08/05-09/22/05	Certain areas of the plastic shell may be prone to stress fractures. Call mfg. to receive a replacement seat.
387)	Triumph	264x	10/20/01-01/31/02	Slide loop connectors in the harness may not be strong enough to fully secure the child in a crash. Call mfg. for repair kit.
388)	Triumph	264x, 359x, 389x	09/06/01-10/31/05	Portions of the cloth cover can be pulled back exposing the foam liner in an area that is reachable by a child occupant. A child inside the seat may break off and potentially choke on a piece of the foam liner. Contact mfg. for repair kit.
389)	Trooper (shield)	21940, 219164, 219180, 219186, 219188	11/95-1/96	Instructions. Call mfg. for new instructions

Car Seat Recalls and Safety Notifications: MODELS 10 YEARS OLD AND OLDER

For the model numbers "x" = more numbers or letters follow

List No.	Manufacturer Model # ("X" = more numbers or letters follow)	Customer assistance Mfg Date	Problem Type and Consumer Action
----------	---	------------------------------	----------------------------------

Evenflo (continued)

390)	Two-in-One	636x, 637x	1/98-3/98	In crash tests, the seat's backrest and base have separated when 5-point harness was being used. Call mfg. for information and replacement seat.
391)	Ultara 1	420	9/88-7/89	Buckle. Call mfg. for repair info.
392)	Ultara 1	231	2/93-8/93	Plastic sleeve on harness. Call mfg. for repair info.
393)	Ultara II	227	1/90-6/90	Crash test failure. Call mfg. for repair info.
394)	Ultara II	232	2/93-8/93	Plastic sleeve on harness. Call mfg. for repair info.

Fisher Price**ALL MODELS OLDER THAN 10 YEARS - DESTROY & REPLACE**

395)	Car Seat	9100	Pre-1987	Harness/shield. Call mfg. for repair info.
396)	Car Seat	9100, 9101	4/85-1/89	Upholstery. Call mfg. for repair info.
397)	Car Seat	9100, 9101	2/90-3/90	Buckle. Call mfg. for repair info.
398)	Car Seat	9100	4/85-8/85	Shield. Call mfg. for repair info.
399)	Car Seat	9100, 9101	5/87-1/89	Buckle. Call mfg. for repair info.
400)	Car Seat	9100, 9101	2/89-11/89	Buckle (extended 5/87-1/89). Call mfg. for repair info.
401)	Car Seat	9100, 9101	Pre 91	Loose button. Call mfg. for repair info.
402)	Car Seat	9100, 9101	2/91-1/92	Harness/shield. Call mfg. for repair info.
403)	Car Seat	9100, 9101	Pre 7/89	Label on shield. Call mfg. for repair info.
404)	Delux Car Seat	9104	6/15-9/92	Buckle. Call mfg. for repair info.
405)	Infant Seat	9149	1/91-2/91	Shield. Call mfg. for repair info.
406)	Infant Seat	9173	9/94-10-94	Air bag label. Call mfg. for repair info.
407)	Booster	9104	4/92-9/92	Buckle. Call mfg. for repair info.
408)	Booster	9104	4/92-9/92	Buckle. Call mfg. for repair info.
409)	Safe Embrace	79700	5/97-3/98	Harness adjuster. Call mfg. for repair info.

Ford**ALL MODELS OLDER THAN 10 YEARS - REPLACEMENT PROGRAM DISCONTINUED - DESTROY & REPLACE**

410)	Infant Love Seat	All	81/82	Plastic shell may develop cracks. Destroy & replace seat.
------	------------------	-----	-------	---

General Motors**ALL MODELS OLDER THAN 10 YEARS - REPLACEMENT PROGRAM DISCONTINUED - DESTROY & REPLACE**

411)	Infant Love Seat	All	81/82	Plastic shell may develop cracks. Destroy & replace seat.
412)	Child Love Seat	All	3/84-11/84	Plastic shell may develop cracks. Destroy & replace seat.

Car Seat Recalls and Safety Notifications: MODELS 10 YEARS OLD AND OLDER

For the model numbers "x" = more numbers or letters follow

List No.	Manufacturer Model # ("X" = more numbers or letters follow)	Model Name	Customer assistance	Mfg Date	Problem Type and Consumer Action
Gerry			Contact Evenflo: 800-525-2472 / 800-233-5921		
413)	Guardian	All	01/90-05/90	Buckle. Call mfg. for repair info.	
414)	Secure Ride	626	08/94-03-95	Air bag label. Call mfg. for new label	
Graco			800-345-4109 / www.gracobaby.com		
415)	Aprica A30	All Models	07/01/11-04/30/12	The harness buckle may become stuck so that it cannot be opened by pushing the release button, thus making it difficult to remove the child from the restraint in an emergency. Contact mfg. for replacement buckle.	
416)	CarGo	8487x, 8686x, 8689x, 8D01x, 8D02x, 8D03x, 8D04x, 8D05x, 8D10x	01/09/07-03/03/08	An incorrect NHTSA Hotline telephone number appears on an information label affixed to the back of the seat. Contact mfg. for a replacement label.	
417)	ComfortSport	8629x, 8630x, 8631x, 8632x, 8635x, 8639x, 8C00x, 8C01x, 8C02x, 8C03x, 8C04x, 8433x	01/02/07-07/31/07	Lower Anchorage belt may have been misrouted during assembly process. Use the vehicle seatbelt instead of LATCH to install affected models in the rear-facing position until it is inspected and, if necessary, corrected. Call mfg. or visit gracobaby.com website for additional info.	
418)	ComfortSport	8C02MRC2	10/22/07	Seats were produced with foam thicker than specified and tested 1" thick foam. It is unclear as to what impact thicker foam will have on child seat safety. Call mfg. for seat replacement information.	
419)	ComfortSport	8C04FRR, 8C04FRR2	11/01/06-10/08/07	Seats were equipped with a large supplemental "body pillow" that partially obscures the child airbag warning label on the seat pad. Graco will instruct users to discard the supplemental pillows since they are provided for comfort only. Contact mfg. for additional information.	
420)	Cozy Cline	All Models	01/01/06-04/30/10	The harness buckle may become stuck so that it cannot be opened by pushing the release button, thus making it difficult to remove the child from the restraint in an emergency. Contact mfg. for replacement buckle.	
421)	GT 1000	All	1/85-1/86	Crash test failure. Call mfg. for repair info.	
422)	SafeSeat - Step 2	All Models	01/01/06-04/30/10	The harness buckle may become stuck so that it cannot be opened by pushing the release button, thus making it difficult to remove the child from the restraint in an emergency. Contact mfg. for replacement buckle.	
423)	SnugRide	7493, 7497, 7499, 841101, 841102, 841103, 841203, 8412T02, 8457, 8458, 8459, 8460, 8462, 8471, 8472, 8473, 8474, 8476, 8477, 8478	08/31/99-02/28/02	May be missing 1 or 2 metal hooks and their retainer pins on the base of the carrier shell or the "U" shaped bars on the carrier shell that are used to attach the carrier to the base. If the hooks, pins or "U" bars are missing, the carrier may not be securely attached to the base and the carrier could detach from the base in the event of a sudden stop or crash. Call Graco to receive a free replacement seat or base. NOTE: All affected model numbers may also begin with the letter "A" and/or also be followed by letters.	

Car Seat Recalls and Safety Notifications: MODELS 10 YEARS OLD AND OLDER

For the model numbers "x" = more numbers or letters follow

List No.	Manufacturer Model # ("X" = more numbers or letters follow)	Customer assistance Mfg Date	Problem Type and Consumer Action
----------	---	------------------------------	----------------------------------

Graco (continued)

424)	SnugRide	8402, 8402L, 8403x, 8412, 8442x, 8443, 8443L, 8444, 8444L, 8446, 8446L, 8447, 8447L, 8448, 8448L, 8457, 8458, 8459, 8463x, 8464, 8470, 8471, 8478, 8601, 8602x, 8603M, 8605x, 8607x, 8608D, C844342	03/01/02-03/08/03	May have missing hardware used to attach the carrier to the base. Contact mfg. at 866-473-0163 or www.gracobaby.com for inspection and repair information. All models can safely be installed without the base. [NOTE: The initial 03/12/03 recall campaign for this problem included models manufactured through 03/06/03. A recall extension announced 08/13/03 added models manufactured through 03/08/03.]
425)	SnugRide	8609x, 8616x, 8643x, 8645x, 8646x	08/01/06-06/30/07	The backing of the seat pad may pull away from the seams in an area reachable to the child occupant, exposing the pad filling and posing a potential choking hazard. Contact mfg. For repair kit.
426)	SnugRide, SnugRide Classic Connect	All Models	03/01/11-05/31/13	The harness buckle may become stuck so that it cannot be opened by pushing the release button, thus making it difficult to remove the child from the restraint in an emergency. Contact mfg. for replacement buckle.
427)	SnugRide 30 SnugRide Classic Connect 30	All Models	07/01/10-01/31/13	The harness buckle may become stuck so that it cannot be opened by pushing the release button, thus making it difficult to remove the child from the restraint in an emergency. Contact mfg. for replacement buckle.
428)	SnugRide 35 SnugRide Classic Connect 35	All Models	05/01/11-01/31/13	The harness buckle may become stuck so that it cannot be opened by pushing the release button, thus making it difficult to remove the child from the restraint in an emergency. Contact mfg. for replacement buckle.
429)	SnugRide Click Connect 40	All Models	06/01/12-12/31/12	The harness buckle may become stuck so that it cannot be opened by pushing the release button, thus making it difficult to remove the child from the restraint in an emergency. Contact mfg. for replacement buckle.

International**ALL MODELS OLDER THAN 10 YEARS - NO LONGER IN BUSINESS - DESTROY & REPLACE**

430)	Astroseat	All	12/80-7/81	Buckle. Destroy & replace seat.
------	-----------	-----	------------	---------------------------------

Kolcraft**ALL MODELS OLDER THAN 10 YEARS - NO LONGER IN BUSINESS - DESTROY & REPLACE**

431)	Automate	180-600, 180-601	Pre 4/93	Buckle. Call mfg. for repair info.
432)	Carter Travel 5	13833, 13842, 13852	5/96-9/96	Crash test failure of buckle. Call mfg. for repair info.
433)	Dial-A-Fit	180-200, 180-300	1/87-8/89	Upholstery clips. Call mfg. for repair info.
434)	Dial-A-Fit	180-200, 180-300	10/88-8/89	Crash test failure. Call mfg. for repair info.
435)	Dial-A-Fit II	180-600	11/90-8/91	Crash test failure. Call mfg. for repair info.
436)	Infant Car Seat	1383x	1/93-6/99	Carrier handle can release and allow the seat to rotate. Does not affect safety as car seat. Call mfg. for repair info.
437)	Infant Restraint	43xxx	1/93-6/99	Carrier handle can release and allow the seat to rotate. Does not affect safety as car seat. Call mfg. for repair info.

Car Seat Recalls and Safety Notifications: MODELS 10 YEARS OLD AND OLDER

For the model numbers "x" = more numbers or letters follow

List No.	Manufacturer Model # ("X" = more numbers or letters follow)	Customer assistance Mfg Date	Problem Type and Consumer Action
----------	---	------------------------------	----------------------------------

Kolcraft (continued)

438)	Infant Rider	138xx, 368xx	3/96-8/96	Crash test failure of buckle. Call mfg. for repair info.
439)	Infant Rider	1312x, 1382x, 1383x, 368xx	1/93-6/99	Carrier handle can release and allow the seat to rotate. Does not affect safety as car seat. Call mfg. for repair info.
440)	Flip 'N' Go	19127 thru 19130	1/85-3/87	Shield. Call mfg. for repair info.
441)	Flip 'N' Go II	19127	1/85-3/88	Shield. Call mfg. for repair info.
442)	Perfect Fitt	180-100, 180-150	Pre 4/90	Upholstery clips. Call mfg. for repair info.
443)	Perfect Fitt	180-150, 180-200	3/89-10/90	Crash test failure. Call mfg. for repair info.
444)	Perfect Fitt	180-200	Pre 10/90	Upholstery. Call mfg. for repair info.
445)	Performa	All	3/96-10-96	Upholstery. Call mfg. for repair info.
446)	Performa	All	1/96-7/97	Buckle release force. Call mfg. for repair info.
447)	Playskool Car Seat	140-155, 180-400	12/89-8/90	Upholstery. Call mfg. for repair info.
448)	Playskool Car Seat	77001, 77002	1/91-6/93	Buckle. Call mfg. for repair info.
449)	Playskool Infant Car Seat	77005, 77007	1/93-6/99	Carrier handle can release and allow the seat to rotate. Does not affect safety as car seat. Call mfg. for repair info.
450)	Plus 4	138xx, 368xx	3/96-8/96	Crash test failure of buckle. Call mfg. for repair info.
451)	Plus 4	1382x, 1383x, 1384x, 368xx	1/93-6/99	Carrier handle can release and allow the seat to rotate. Does not affect safety as car seat. Call mfg. for repair info.
452)	Plus 5	138xx, 368xx	3/96-8/96	Crash test failure of buckle. Call mfg. for repair info.
453)	Plus 5	13833, 13842, 13852	5/96-9/96	Crash test failure of buckle. Call mfg. for repair info.
454)	Plus 5	1382x, 1383x, 1384x, 1385x, 368xx	1/93-6/99	Carrier handle can release and allow the seat to rotate. Does not affect safety as car seat. Call mfg. for repair info.
455)	Rock 'N' Ride	13123	2/85-6/85	Plastic shell. Call mfg. to replace seat.
456)	Rock 'N' Ride	131-101	Pre 3/90	Upholstery clips. Call mfg. for repair info.
457)	Secura	43xxx	1/93-6/99	Carrier handle can release and allow the seat to rotate. Does not affect safety as car seat. Call mfg. for repair info.
458)	Secure Fit	All	1/96-7/97	Buckle release force. Call mfg. for repair info.
459)	Travel About	138xx, 368xx	3/96-8/96	Crash test failure of buckle. Call mfg. for repair info.
460)	Travel About	13833, 13842, 13852	5/96-9/96	Crash test failure of buckle. Call mfg. for repair info.
461)	Travel-About	1382x, 1383x, 1384x, 1385x	1/93-6/99	Carrier handle can release and allow the seat to rotate. Does not affect safety as car seat. Call mfg. for repair info.
462)	Traveler 700	All	11/01/94-12/31/95	Voluntary action: Buckle concerns. Call mfg. for repair info.
463)	Traveler 700	150-100	1/91-8/91	Cracks in plastic. Call mfg. to replace seat.
464)	Traveler 700	All	1/91-6/93	Rusting of buckle. Call mfg. for repair info.

Car Seat Recalls and Safety Notifications: MODELS 10 YEARS OLD AND OLDER

For the model numbers "x" = more numbers or letters follow

List No.	Manufacturer Model # ("X" = more numbers or letters follow)	Customer assistance
	Model Name	Mfg Date Problem Type and Consumer Action

Lin Lih/MCP Ent.**ALL MODELS OLDER THAN 10 YEARS - REPLACEMENT PROGRAM
DISCONTINUED - DESTROY & REPLACE**

465) Lin Lih	All	ALL	Counterfeit seat. Call NHTSA: 800-424-9393
466) Lin Lih	180-200, 180-300	10/88-8/89	Crash test failure. Call NHTSA: 800-424-9394

Maxi-Cosi (Dorel)**Dorel Juvenile Group: 866-623-3139 / 800-219-0509 / 866-611-3022 / 812-372-0141
www.djgusa.com**

467) Mico	22-371, 22-372	07/01/07-	Attachment difficulties between the infant carrier and the base may lead to the carrier being improperly mounted to the base. Contact mfg. for replacement base.
Mico (base)	22-515	02/17/08	
468) Mico	22-371 HFL, 22-371 JUC, 22-371 LMD, 22-371 ORE,	02/18/08-	Attachment difficulties between the infant carrier and the base may lead to the carrier being improperly mounted to the base. Contact mfg. for repair kit. NOTE: This is an extension of an earlier recall.
Mico (base)	22-371 PNG, 22-372 TTH 22-515 BLK	06/28/08	
469) Mico	22371x, 22372x	05/01/08-04/30/09	Harness locking and release button does not always return to its locked position and could result in a loose harness, increasing the risk of being injured a crash. Contact mfg. for repair kit.
470) Priori	22476x, 22486x	05/01/08-04/30/09	Harness locking and release button does not always return to its locked position and could result in a loose harness, increasing the risk of being injured a crash. Contact mfg. for repair kit.

Mia Moda**866-642-6632 - www.miamodainc.com**

471) Viva	5000 (seat), 5001 (base)	12/19/06-02/06/07	The lower anchor connector adjuster assembly may interfere with the connection of the infant carrier to the restraint base when installed using LATCH. Installation with seat belt is not affected. In addition, registration cards were not provided with the Viva or separately sold bases. Contact mfg. For repair kit and to register CR with mfg.
472) Viva	5000 (seat), 5001 (base), 5050 (seat), 5051 (base),	12/01/06-05/31/09	Sharp edges on the harness splitter plate can cut the harness. Also, the base could crack in a crash. Contact mfg. at 877-546-8437 for a full refund. <u>Mia Moda is urging parents/caregivers to discontinue use of the seat until it can be replaced.</u> According to Lerado/Mia Moda, there have been no injuries reported due to these problems and this is a voluntary precaution they are taking.
Viva Supreme	5070 (seat), 5071 (base) 5080 (seat), 5081 (base)		

Mercedes-Benz USA**800-367-6372 - www.mbusa.com**

473) Booster	BQ6910157, BQ6910163	02/01/97-07/31/99	BabySmart airbag deactivation device may not automatically deactivate the passenger airbag. Contact mfg. for free replacement seat and instructional video.
474) Infant Restraint	BQ6910155	02/01/97-07/31/99	BabySmart airbag deactivation device may not automatically deactivate the passenger airbag. Contact mfg. for free replacement seat and instructional video.
475) Kiddy TopSafe (mfg. by Sicartex)	B66868203 B66868204 B66868209	03/01/03-11/30/03	Lower LATCH attachment may not be strong enough to hold in the event of a crash. Immediately replace with another model and return Kiddy Top seat to Mercedes-Benz dealer for refund. Install with vehicle seat belt until replacement is obtained. Contact Mercedes-Benz for further information.

Car Seat Recalls and Safety Notifications: MODELS 10 YEARS OLD AND OLDER

For the model numbers "x" = more numbers or letters follow

List No.	Manufacturer Model # ("X" = more numbers or letters follow)	Customer assistance Mfg Date	Problem Type and Consumer Action
Peg Perego USA			
		877-737-3468 / 219-482-8191 - www.perego.com	
476)	Jacadi IMCB00JA57RJ31JU31	07/01/07-03/14/08	The plastic adjustment cover of affected models could have exposed sharp edges that could cause cuts, scratches, or abrasions on the feet or legs of bare-footed infants. Does not affect safety as car seat. Contact mfg. for a free repair kit.
477)	Primo Viaggio CS00MU1, CS00US1, CS00US8	02/01/01-06/10/01	The latch mechanism securing the seat to the base does not completely engage on a small number of seats due to improper positioning of the metal reinforcement bracket. Call mfg. for repair info. Note: Primo Viaggio infant seat sold separately and with strollers as part of Pliko and Primo Viaggio Travel Systems.
478)	Primo Viaggio CS00MU1, CS00US1, CS00US8, LV34USL, LV34USN, LN34S09, LN34S10, ST33USL, ST33USN, ST38USL, ST38USN, AL33USL, AL33USN, AL34USN, AL34USL	05/20/01-02/15/02	The harness adjustment/locking mechanism may not fully lock and allow the harness to slip. The strap tension adjuster cover of affected models have a red circle around a dark button. Contact mfg. for full identification and repair information. Note: Primo Viaggio infant seat sold separately and with strollers as a part of Pliko, Primo Viaggio, and Atlantico Travel Systems.
479)	Primo Viaggio SIP 30/30 32MD41KN41, 35CR13BU13, 35CR13PL46, 35CR24BU24, 35TL49KN53, 35TL53KN46, 61FG13ST53, 61FG53ST49, 61FG53ST64, 61ST13IC53, 61ST34IC53, 61ST48IC53	07/01/07-03/14/08	The plastic adjustment cover of affected models could have exposed sharp edges that could cause cuts, scratches, or abrasions on the feet or legs of bare-footed infants. Does not affect safety as car seat. Contact mfg. For a free repair kit. Note: Affected model numbers begin with IMUN00US.
Playskool			
		Contact Kolcraft: 800-453-7673	
480)	Car Seat 140-155, 180-400	12/89-8/90	Upholstery. Call Kolcraft
481)	Car Seat 77001, 77002	1/91-6/93	Buckle. Call Kolcraft
482)	Infant Car Seat 77005, 77007	1/93-6/99	Carrier handle can release and allow the seat to rotate. Does not affect safety as car seat. Call mfg. for repair info.
Pride Trimble/Virco			
		800-521-5198	
483)	Click-n-Go 890, 891, 892	2/86-10/87	Crash test failure. Call mfg. to replace seat.
484)	Click-n-Go 890, 891, 892	1/88-4/89	Crash test failure. Call mfg. to replace seat.
485)	Pride Ride 832	1/88-4/89	Crash test failure. Call mfg. to replace seat.
Questor			
		Contact Evenflo: 800-233-5921	
486)	Kantwet Car Seat All	5/69-3/73	May pinch child's fingers. Call mfg. for repair info.
Recaro			
		888-973-2276 / 800-873-2276 / 248-364-3818/ - www.recaropromotion.com	
487)	Como 331.00.xxx	Pre-09/17/07	Consumer Advisory - Not a Recall: Lap and shoulder belt guide (previously referred to as "lock-off") may not hold belt webbing snugly enough to prevent belt from loosening. Contact mfg. for locking clip and instructions included as a part of the consumer advisory.

Car Seat Recalls and Safety Notifications: MODELS 10 YEARS OLD AND OLDER

For the model numbers "x" = more numbers or letters follow

List No.	Manufacturer Model # ("X" = more numbers or letters follow)	Customer assistance Mfg Date	Problem Type and Consumer Action
----------	---	------------------------------	----------------------------------

Recaro (continued)

488)	Como	331.00.xxx	Pre-12/18/07	The harness may become disconnected from the harness connector when a child is placed in or removed from the child seat. Contact mfg. for repair kit.
489)	Como	331.00.xxx, 331.01.xxx	11/01/07-02/16/09	The front harness adjuster strap may slip within the adjuster/lock that controls tightness of the harness and may prevent the harness from staying properly tight. Contact mfg. for free replacement seat. NOTE: Models with a green dot above the bar code on the model # sticker are OK to use.
490)	ProSport	385.01.xxxx	06/16/10-01/31/13	When the affected child seats are installed with the LATCH lower anchors only (without the top tether), the child's head can move too much, increasing the risk of injury in a crash. Contact mfg. for replacement labels and complete set of new instructions informing owners to discontinue use of the LATCH system when the weight of the child reaches 40 pounds.
491)	Signo	331.00.xxx	Pre-12/18/07	The harness may become disconnected from the harness connector when a child is placed in or removed from the child seat. Contact mfg. for repair kit.
492)	Signo	330.00.xxx, 330.01.xxx	11/01/07-02/16/09	The front harness adjuster strap may slip within the adjuster/lock that controls tightness of the harness and may prevent the harness from staying properly tight. Contact mfg. for free replacement seat. NOTES: This date range is an expansion of the initial date range (02/01/08-09/30/08) for this recall. Models with a green dot above the bar code on the model # sticker are OK to use.

Renolux (FBS)**ALL MODELS OLDER THAN 10 YEARS - NO LONGER IN BUSINESS - DESTROY & REPLACE**

493)	GT 1000	All	8/88-10/88	Buckle/recline angle. Destroy & replace seat.
494)	GT 2000	All	8/88-10/88	Buckle/recline angle. Destroy & replace seat.
495)	GT 2000	All	1/92-1/93	Foam padding failed HIC (head injury) limits. Destroy & replace seat.
496)	GT 2000	All	5/89-6/93	Flammability of upholstery. Destroy & replace seat.
497)	GT 4000	All	1/92-1/93	Foam padding failed HIC (head injury) limits. Destroy & replace seat.
498)	GT 4000	All	5/89-6-93	Flammability of upholstery. Destroy & replace seat.
499)	GT 5000	All	1/92-1/93	Foam padding failed HIC (head injury) limits. Destroy & replace seat.
500)	GT 5000	All	5/89-6-93	Flammability of upholstery. Destroy & replace seat.
501)	GT 5000 Turn A Tot	All	2/90-4/91	Test failure/upholstery. Destroy & replace seat.
502)	GT 5000 Turn A Tot	All	1/92-1/93	Foam padding failed HIC (head injury) limits. Destroy & replace seat.
503)	GT 5000 Turn A Tot	All	5/89-6-93	Flammability of upholstery. Destroy & replace seat.
504)	GT 5500	All	1/92-1/93	Foam padding failed HIC (head injury) limits. Destroy & replace seat.
505)	GT 5500	All	5/89-6-93	Flammability of upholstery. Destroy & replace seat.
506)	GT 7000	All	All	Remote may overheat/ fire hazard. Destroy & replace seat.
507)	GT 7000	All	1/92-1/93	Foam padding failed HIC (head injury) limits. Destroy & replace seat.
508)	GT 7000	All	5/89-6-93	Flammability of upholstery. Destroy & replace seat.

Car Seat Recalls and Safety Notifications: MODELS 10 YEARS OLD AND OLDER

For the model numbers "x" = more numbers or letters follow

List No.	Manufacturer	Model # ("X" = more numbers or letters follow)	Customer assistance
	Model Name		Mfg Date Problem Type and Consumer Action
Safeline Kids			
800-829-1625 - www.tripleplayproducts.com			
509)	Sit'n'Stroll	3240	6/9/97-8/9/97 Air bag labels. The air bag warning label was omitted from the seat cover. Contact Mfg. for new seat cover that has the required air bag warning label.
510)	Sit'n'Stroll	3240	11/1/96-6/30/99 Labels recommend use rear-facing for children up to 25 pounds. Contact Mfg. for new labels to be placed over the existing labels. New labels recommend use rear-facing for children up to 22 pounds.
511)	Sit'n'Stroll	2240	04/01/01-10/01/01 The FAA certification statement on label is in yellow lettering instead of the required RED lettering. Flight attendants may not allow its use on an airplane. Contact mfg. for replacement label.
512)	Sit'n'Stroll	2003	09/01/02-10/21/03 Child's head may move too far forward in a crash when lower forward-facing belt path or shoulder and buckle pads are used. Remove and discard shoulder and buckle pads and use upper forward-facing belt path only. Contact mfg. for revised instructions and labels.
Safety 1st (Dorel)			
Dorel Juvenile Group: 866-623-3139 / 800-219-0509 / 866-611-3022 / 812-372-0141 www.djgusa.com			
513)	Alpha Elite	All Models	11/01/03-12/31/05 There is a potential for the harness adjustment strap to loosen during use. Contact mfg. for free repair kit.
514)	Alpha Omega	22151	11/01/03-12/31/05 There is a potential for the harness adjustment strap to loosen during use. Contact mfg. for free repair kit.
	Alpha Omega Elite	22455	
515)	Alpha Omega All-N-1	22152x, 22159x, 22172x, 22177x, 22178x, 22185x,	05/01/08-04/30/09 Harness locking and release button does not always return to its locked position and could result in a loose harness, increasing the risk of being injured a crash. Contact mfg. for repair kit.
	Alpha Omega Elite	22188x, 22195x, 22412x, 22456x, 22465x, 22469x	
516)	Alpha Omega Elite	22187xxx, 22465xxx, CC033xxx, CC046xxx	07/20/10-05/18/11 The rear-facing belt path installation arrows are incorrect, possibly appearing to point toward the forward-facing vehicle belt path location. Contact mfg. for replacement label kit.
517)	Alpha Sport	All Models	11/01/03-12/31/05 There is a potential for the harness adjustment strap to loosen during use. Contact mfg. for free repair kit.
518)	Avenue	22439x, 22449x	05/01/08-04/30/09 Harness locking and release button does not always return to its locked position and could result in a loose harness, increasing the risk of being injured a crash. Contact mfg. for repair kit.
519)	Complete Air LX	CC050xxx	07/20/10-5/18/11 The rear-facing belt path installation arrows are incorrect, possibly appearing to point toward the forward-facing vehicle belt path location. Contact mfg. for replacement label kit.
	Complete Air SE	CC051xxx	
520)	Designer 22	02-621-SAL, 02-620-xxx	01/03/02-02/13/02 Plastic handle can unexpectedly release from the carrying position when used as a carrier. Does not affect safety as a child restraint. Contact mfg. for repair kit.
521)	Designer 22	22-325 xxx GB1B	08/19/03-10/20/04 Harness can loosen if not properly tightened. Contact mfg. for free repair kit. Parents should continue to use the seat while waiting to receive/install the repair kit but are advised to make sure that the seat is properly adjusted while in use. NOTE: Models involved were sold only as travel systems (with a stroller) and any line code other than GB1B in the model # is not included in the recall.

Car Seat Recalls and Safety Notifications: MODELS 10 YEARS OLD AND OLDER

Produced by: UNC Highway Safety Research Center - 800-672-4527 x2
 Funded by: NC Governor's Highway Safety Program

Download this list & sign up for email notification of updates:
buckleupnc.org/car-seat-recall-list

For the model numbers "x" = more numbers or letters follow

List No.	Manufacturer Model # ("X" = more numbers or letters follow)	Customer assistance
	Model Name	Mfg Date Problem Type and Consumer Action

Safety 1st (Dorel) (continued)

522)	Enspira	22450, 22451, 22452, 22453, 22480, 22481	11/01/03-12/31/05	There is a potential for the harness adjustment strap to loosen during use. Contact mfg. for free repair kit.
523)	Enspira	22453x	05/01/08-04/30/09	Harness locking and release button does not always return to its locked position and could result in a loose harness, increasing the risk of being injured a crash. Contact mfg. for repair kit.
524)	Infant Car Seat	22-057 CLN, 22-057 DBY, 22-057 HRT, 22-057 LPH, 22-085 DWA, 22-085 LYN, 22-095 RBK, 22-322 HRR, 22-322 KDL, 22-322 LXI, 22-322 MAI, 22-322 OLY, 22-322 PRS, 22-322 PTK, 22-325 COB, 22-325 PAC, 22-380 LGA, 22-380 MSA, 22-627 WAV	01/06/08-04/06/09	The child restraint carry handle can loosen and come off posing a fall hazard to infants. The safety as a child restraint is not affected. Do not use handle until repaired. Contact mfg. for free repair kit. NOTE: Only those models sold as a part of the Eurostar, Explorer, Lite Wave, Sojourn, and Vector Travel Systems are affected.
525)	Intera	22460	11/01/03-12/31/05	There is a potential for the harness adjustment strap to loosen during use. Contact mfg. for free repair kit.
526)	OnBoard	22077x, 22078x, 22356x	05/01/08-04/30/09	Harness locking and release button does not always return to its locked position and could result in a loose harness, increasing the risk of being injured a crash. Contact mfg. for repair kit.
527)	OnBoard 35	IC124 FSM	05/01/11-04/25/12	Some models were sold without a base and therefore did not provide lower LATCH attachments as required by FMVSS 213. Carriers can safely be installed without the base using the seat belt. Contact mfg. to obtain a base.
528)	Prospect	22580x	05/01/08-04/30/09	Harness locking and release button does not always return to its locked position and could result in a loose harness, increasing the risk of being injured a crash. Contact mfg. for repair kit.
529)	Uptown	22475x	05/01/08-04/30/09	Harness locking and release button does not always return to its locked position and could result in a loose harness, increasing the risk of being injured a crash. Contact mfg. for repair kit.
530)	Vantage Vantage Point/ Surveyor Vantage Hiback	22553x, 22554x, 22560x, 22561x, 22564x, 22567x, 22574x	05/01/08-04/30/09	Harness locking and release button does not always return to its locked position and could result in a loose harness, increasing the risk of being injured a crash. Contact mfg. for repair kit.

Snug Seat**800-336-7684 - www.snugseat.com**

531)	Gorilla	200-1000	07/26/02-01/15/03	A washer in tether anchor kit does not meet corrosion requirements of FMVSS 213. Contact mfg. for replacement kit # FW-50250-12-ZY
532)	Spelcast	600-1000	07/26/02-01/15/03	A washer in tether anchor kit does not meet corrosion requirements of FMVSS 213. Contact mfg. for replacement kit # FW-50250-12-ZY
533)	Traveller Plus (Mfg. by Britax for Snug Seat)	E9L32	Pre-07/24/04	The adjuster strap may slip within the metal buckle that controls the tightness of the shoulder harness and may allow the harness to loosen. <u>Contact Britax</u> at 800-683-2045 or 704-409-1700 for repair kit.

Car Seat Recalls and Safety Notifications: MODELS 10 YEARS OLD AND OLDER

Produced by: UNC Highway Safety Research Center - 800-672-4527 x2

Funded by: NC Governor's Highway Safety Program

Download this list & sign up for email notification of updates:

buckleupnc.org/car-seat-recall-list

For the model numbers "x" = more numbers or letters follow

List No.	Manufacturer Model # ("X" = more numbers or letters follow)	Customer assistance Mfg Date	Problem Type and Consumer Action
----------	---	------------------------------	----------------------------------

Strolee**ALL MODELS OLDER THAN 10 YEARS - NO LONGER IN BUSINESS - DESTROY & REPLACE**

534)	Wee Care	All	Pre 4/80	Crash test failure. Destroy & replace seat.
535)	Wee Care	599	12/80-5/81	Upholstery. Destroy & replace seat.
536)	Wee Care	609, 610	ALL	Plastic shell. Destroy & replace seat.
537)	Quick Click	605	ALL	Plastic shell. Destroy & replace seat.
538)	GT 3000	All	87/88	Crash test failure. Destroy & replace seat.

Team-Tex America**877-912-1313**

539)	Babyride	374099	08/31/06-10/23/06	Belt routing label with "horizontal reference line" was incorrectly placed on the CR. Contact mfg. for a correct label and placement instructions. NOTE: According to Team-Tex America, all seats that were affected by this recall were caught and corrected before being purchased by consumers and thus should not be found in use.
540)	Babyride	374199	12/18/08	The belt routing label with the "horizontal reference line" for determining the correct recline angle is incorrectly placed on the child restraint. Contact mfg. for replacement label and instructions.

**TriplePlay Products
(See Safeline Kids also)****800-829-1625 - www.tripleplayproducts.com**

541)	Sit'n'Stroll	4002	05/05/08	The webbing used in the center adjuster for the harness fails to comply with the initial breaking strength requirements of FMVSS 213. Contact mfg. for repair kit and instructions. NOTE: According to TriplePlay, the only units affected were a small number of seats manufactured on May 5, 2008 and sold through their website. All purchasers are being contacted and notified of this recall.
------	--------------	------	----------	---

TRW**ALL MODELS OLDER THAN 10 YEARS - REPLACEMENT PROGRAM DISCONTINUED - DESTROY & REPLACE**

542)	Infant Love Seat	All	81/82	Plastic shell may develop cracks. Destroy & replace seat.
543)	Child Love Seat	All	3/84-11/84	Plastic shell may develop cracks. Destroy & replace seat.

Volvo**800-458-1552 / 800-221-9136 / 201-768-7300**

544)	ALL SEATS	All	Thru 12/88	Buckle. Call mfg. for refund info.
------	-----------	-----	------------	------------------------------------

XSCi**800-630-6850 / 719-593-8881**

545)	Pioneered ACIS	None*	02/01/02-03/07/02	Exceeds the maximum head excursion criteria of FMVSS 213. In a crash, the cradle can detach from the deflector base. Contact mfg for replacement information (replacements produced by an alternate mfg.) *No model number is associated, but affects serial numbers 01C-000000002 to 01C-000000108. [NHTSA No.: 02E-024] **NOTE: According to XSCi, all seats that were affected by this recall have been returned (as of May 8, 2002) and thus should not be found in use.*
------	----------------	-------	-------------------	--

Car Seat Recalls and Safety Notifications: MODELS 10 YEARS OLD AND OLDER

Index of Recalls and Safety Notifications for Older Model List

For the model numbers "x" = more numbers or letters follow.

Model numbers and model names for car seats under recall are followed by their index number which corresponds to the "List No." for each listing. If the model number is not found, check the model name also. Model numbers are not available for all model names.

Note: Dorel Juvenile Group products are indexed under each individual product line (e.g., Cosco) as well as under "Dorel."

Alcot (Childcare)			Basic Comfort			# E9L80		
Child Love Seat	201		# 960	216, 217		# E9LG81A	222	
All Our Kids			# 961	216, 217		# E9LG83x	222	
# 600	202		Galaxy 2000	216, 217		# E9LJ91x	224	
# 602	203		Beatrix Potter (Dorel)			# E9LJ92E	224	
Little Cargo Vest	202, 203		# 02-620-xxx	218		# E9LJ93P	224	
Alpha Elite (Dorel)			# 02-621-SAL	218		# E9LJ93S	224	
# 22148x	205		Designer 22	218		# E9LK31x	237	
# 22149x	205		Bertini (Dorel)			# E9LK32x	237	
# 22158x	205		# 22346x	219		# E9LK33Q	237	
# 22331-BLA	206, 207		SureFit	219		# E9LK91A	224	
# 22332 RLA	206, 207		Bolform Corp.			# E9LL11x	237	
# 22459x	205		# 84E-019	220		# E9LL12x	237	
# 22462x	204		Buckle-Up Harness	220		# E9LL21A	222	
Alpha Luxe	204		Britax			# E9LL23P	222	
Alpha Omega All-N-1	205		# 101	230		# E9LL23Y	222	
Alpha Omega Elite	205		# 161	240		# E9W06	236	
Comfort Infant Seat	206, 207		# E902228	221		Advantage	221	
Alpha Sport (Dorel)			# E9031	241, 242		Advocate 70-G3	222	
# 22452x	208		# E906	236		Boulevard	223	
# 22458x	208		# E9L06	236		Boulevard 70-G3	224	
# 22546x	209		# E9L07	244		Chaperone	225, 226	
# 22547x	209		# E9L14	227, 228		Companion	227, 228	
Enspira	208		# E9L20	228		Decathlon	229	
Vantage	209		# E9L30	233, 234, 235		Freeway	230	
American Motors			# E9L32	243		Frontier	231, 232	
Child Love Seat	211		# E9L3998	239		Husky	233, 234	
Infant Love Seat	210		# E9L39x	238		Marathon	235, 236	
Baby Trend			# E9L47	229		Pavilion 70-G3	237	
# 6400	213		# E9L5490	232		Regent	238, 239	
# 6439	212		# E9L54E7	231, 232		Roundabout	240	
# 6448	212		# E9L54H6	231		Super Elite	241, 242	
# 6481	212		# E9L54H7	231		Traveller Plus	243	
Rigid Latch-Loc	212		# E9L54M6	231		Wizard	244	
Rigid Latch-Loc Base	213		# E9L57	223		Century		
Babyhood Industries			# E9L692J	226		# 11-564	263	
# 810	214		# E9L692K	226		# 11-565	263	
# 8200	215		# E9L692L	226		# 11-570	262, 263	
Baby-Sitter	215		# E9L692M	226		# 11-575	263	
Wonda Chair	214		# E9L69P2	225		# 11-576	263	
			# E9L69P3	225		# 11-578	263	
			# E9L69P5	225		# 11-595	263	
						# 11-597	262, 263	
						# 11-598	263	
						# 11-599	263	

Car Seat Recalls and Safety Notifications: MODELS 10 YEARS OLD AND OLDER

For the model numbers "x" = more numbers or letters follow

Index number refers to "List No." for each listing

Century (continued)

# 11-600	262, 263	# 4518	282	Smart Move	285, 286
# 11-650	262	# 4520	283	Chicco	
# 12-565	282	# 45200	274	# All	287
# 4100	245, 246	# 4525	284	Cortina Travel System	287
# 4153	247	# 4535	281	Key Fit	287
# 4163	247	# 4551	282	Key Fit 30	287
# 4180	247	# 4557	282	Chrysler	
# 4200	248, 249, 250, 251	# 4558	282	Child Love Seat	288
# 4210	248, 249, 250, 251	# 4559	282	Collier-Keyworth	
# 4214	248, 249, 250, 251	# 4560	281	Co-Pilot	289
# 4223	248, 249, 250, 251	# 45600	274	Commuter	291
# 4235	248, 249, 250, 251	# 4564	282	Safe and Sound II	290
# 4253	252, 253, 254	# 4565	281, 282	Combi	
# 4261	253, 254	# 4566	282	# 8065	293
# 4263	252, 253, 254	# 4568	282	# 8074	293
# 4265	252, 253, 254	# 4569	282	# 8086	293
# 4266	253, 254	# 45700	274	# 8087	295
# 4300	255	# 4575	275, 282	# 8100	292
# 4302	255	# 4576	282	# 8220	294
# 4303	255	# 4580	273	# 8520	293
# 4310	255	# 4581	272, 273	# 8815	297
# 4323	255	# 4583	272, 273	# 8836	296
# 4334	255	# 4585	272, 273	Avatar	292
# 4335	255	# 4589	282	Centre	293
# 4353	257, 258, 260	# 4590	281	Coccoro	294
# 4365	257, 258, 259, 260	# 4591	282	Shuttle	295
# 4365DT	256	# 4593	282	Zeus 360	296
# 4366	256, 257, 258, 259, 260	# 4594	282	Zeus Turn	297
# 4367	259, 260	# 4595	282	Compass Baby	
# 4368	257, 258, 259, 260	# 4597	282	# I420 ARD	298
# 4369	259, 260	# 4600	279	# I420 FUD	298
# 4380	259, 261	# 4662	280	# I420 MAR	298
# 4381	259	# 4750	285	Infant Car Seat	298
# 4400	264, 265	# 4875	277	Cosco	
# 4434	264, 265	# 4885	278	# 02-014-EMF	327
# 4436	264, 265	100	245, 246	# 02-014-GDM	327
# 4446	264, 265	1000 STE	247	# 02-015-PDL	327
# 4450	266, 267, 269, 270	200	248, 249, 250, 251	# 02-084	326, 329
# 4460	266, 267, 268, 269, 270	2000 STE	252, 253, 254	# 02-086	309
# 44612	280	300	255	# 02-090	323
# 44622	276	3000 STE	256, 257, 258, 259, 260	# 02-094	329
# 44630	276	3500 STE	261	# 02-096	329
# 44631	276	4-In-1	262, 263	# 02-190	325
# 44662	276	400XL	264, 265	# 02-290	324
# 4470	267, 268, 269, 270	5000 STE	266, 267, 268, 269, 270	# 02-331	299
# 44709	286	5500 STE	271	# 02-332	299
# 4475	266, 267, 268, 269, 270	580	272, 273	# 02-404	329
# 4476	268, 269	Accel	274	# 02-514-BWE	328
# 4480	268, 271	Affinity	275	# 02-518-NDF	328
# 4490	268, 271	Bravo	276	# 02-531	299
# 4500	283	Breverra Contour	277	# 02-533	299
# 4510	283	Breverra Premiere	278		
# 45100	274	Child Love Seat	279		
# 4513	282	Encore	280		
# 4515	282	Infant Car Seat	281, 282		
# 4516	282	Infant Love seat	283		
		Smart Fit	284		

Car Seat Recalls and Safety Notifications: MODELS 10 YEARS OLD AND OLDER

Produced by: UNC Highway Safety Research Center - 800-672-4527 x2

Download this list & sign up for email notification of updates:

Funded by: NC Governor's Highway Safety Program

buckleupnc.org/car-seat-recall-list

For the model numbers "x" = more numbers or letters follow

Index number refers to "List No." for each listing

Cosco (continued)					
# 02-537	299	# 02537	300	Infant Car Seat	307
# 02-584-OXF	328	# 02555	300	Lxry Sft Shld Auto Trac	316
# 02-665	306	# 02584	330	Regal Ride	317
# 02-667	334	# 02803	330	Safe and Easy	320
# 02-719 ARQ	311	# 02806	330	Safe and Snug	321
# 02-727	306	# 02821	330	Safe-T Mate	319
# 02-728	306	# 02825	330	Safe-T-Shield	318
# 02-729	306	# 02935	330	Sft Shld Auto Trac	324
# 02-729 TED	305	# 181A	318	Soft Shield	323
# 02-731	306	# 181B	318	Soft Shield Deluxe	325
# 02-732	306	# 22-001FSM	312	Touriva	326, 327, 328, 329, 330, 331, 332
# 02-733	306	# 22-297	315	Turnabout	334
# 02-750	306	# 22-298	315	Voyager Inf/Stroller	335
# 02-751	304, 306	# 22-299	315		
# 02-753	334	# 22-300 CSF	307	Cosco (Dorel)	
# 02-755	306	# 22-300 FZN	307	# IC123 FSM	308
# 02-756	306, 334	# 22-300 JJV	307	Comfy Carry	308
# 02-757	306	# 22-300 OSF	307		
# 02-758	334	# 22-300 THD	307	Cybex (Regal Lager)	
# 02-759	334	# 22-300 TWD	307	# 0500200xx	336
# 02-760	334	# 22-300-JOS GB1B	310	# 0500760xx	336
# 02-761	334	# 22100	331	Solution X-fix	336
# 02-762	334	# 22100x	332		
# 02-763	334	# 22111x	332	Disney (Dorel)	
# 02-764	334	# 22130x	332	# 22-305 NAB	337
# 02-765	334	# 22139MON	317	# 22-305 PPH	337
# 02-770	334	# 22150	301	# 22-355 LBF	337
# 02-771	334	# 22150x	303	# 22-355 PWK	337
# 02-772	334	# 22154x	302	# 22-627 AWF	337
# 02-774	306	# 22155	301	Infant Car Seat	337
# 02-790	316	# 22155x	302		
# 02-821	329	# 22158x	302	Dorel	
# 02-890	316	# 22180	301	# 02-014-EMF (Cosco)	327
# 02014	330	# 22269	301	# 02-014-GDM (Cosco)	327
# 02015	330	# 313	320	# 02-015-PDL (Cosco)	327
# 02019	330	# 323	321	# 02-084 (Cosco)	326, 329
# 02084	330	# 423	321	# 02-086 (Cosco)	309
# 02094	330	# 81A	318	# 02-090 (Cosco)	323, 324
# 02114	330	# 81B	318	# 02-094 (Cosco)	329
# 02332	300	# 93084	330	# 02-096 (Cosco)	329
# 02409	313	# 93094	330	# 02-190 (Cosco)	325
# 02442	313, 314	# 93100x	332	# 02-331 (Cosco)	299
# 02443	313, 314	# 93111x	332	# 02-331 (Eddie Bauer)	339
# 02445	313	# 93443	314	# 02-332 (Cosco)	299
# 02448	313, 314	# 93446	331	# 02-332 (Eddie Bauer)	339
# 02449	313	# 93504	331	# 02-404 (Cosco)	329
# 02450	313	# 93514	314, 330	# 02-514-BWE (Cosco)	328
# 02480	313	Alpha Omega	299, 300, 301	# 02-518-NDF (Cosco)	328
# 02495	313	Alpha Omega All-N-1	303	# 02-531 (Cosco)	299
# 02504	330	Alpha Omega Elite	301, 302	# 02-531 (Eddie Bauer)	339
# 02514	330, 331	Arriva	304, 305, 306	# 02-533 (Cosco)	299
# 02518	330	Commuter	309	# 02-533 (Eddie Bauer)	339
# 02519	330, 331	Designer 22	310	# 02-537 (Cosco)	299
# 02524	330, 331	Dream Ride	311	# 02-537 (Eddie Bauer)	339
# 02531	300	DreamRide	312	# 02-555 (Cosco)	299
# 02533	300	Hi Back Booster	313	# 02-555 (Eddie Bauer)	339
		High Rise Booster	315	# 02-584-OXF (Cosco)	328

Car Seat Recalls and Safety Notifications: MODELS 10 YEARS OLD AND OLDER

Produced by: UNC Highway Safety Research Center - 800-672-4527 x2

Download this list & sign up for email notification of updates:

Funded by: NC Governor's Highway Safety Program

buckleupnc.org/car-seat-recall-list

For the model numbers "x" = more numbers or letters follow

Index number refers to "List No." for each listing

Dorel (continued)			
# 02-620-xxx (Beatrix Potter)	218	# 02480 (Cosco)	313
# 02-620-xxx (Safety 1st)	520	# 02480 (Eddie Bauer)	349
# 02-621-SAL (Beatrix Potter)	218	# 02495 (Cosco)	313
# 02-621-SAL (Safety 1st)	520	# 02495 (Eddie Bauer)	349
# 02-665 (Cosco)	306	# 02504 (Cosco)	330
# 02-667 (Cosco)	334	# 02514 (Cosco)	330, 331
# 02-719 ARQ (Cosco)	311	# 02518 (Cosco)	330
# 02-727 (Cosco)	306	# 02519 (Cosco)	330, 331
# 02-728 (Cosco)	306	# 02524 (Cosco)	330, 331
# 02-729 (Cosco)	306	# 02531 (Cosco)	300
# 02-729 TED (Cosco)	305	# 02533 (Cosco)	300
# 02-731 (Cosco)	306	# 02537 (Cosco)	300
# 02-732 (Cosco)	306	# 02555 (Cosco)	300
# 02-733 (Cosco)	306	# 02584 (Cosco)	330
# 02-750 (Cosco)	306	# 02803 (Cosco)	330
# 02-751 (Cosco)	304, 306	# 02806 (Cosco)	330
# 02-753 (Cosco)	334	# 02821 (Cosco)	330
# 02-755 (Cosco)	306	# 02825 (Cosco)	330
# 02-756 (Cosco)	306, 334	# 02870 (Eddie Bauer)	353
# 02-757 (Cosco)	306	# 02871 (Eddie Bauer)	353
# 02-758 (Cosco)	334	# 02875 (Eddie Bauer)	353
# 02-759 (Cosco)	334	# 02935 (Cosco)	330
# 02-760 (Cosco)	334	# 181A (Cosco)	318
# 02-761 (Cosco)	334	# 181B (Cosco)	318
# 02-762 (Cosco)	334	# 219x (Cosco)	333
# 02-763 (Cosco)	334	# 22-001FSM (Cosco)	312
# 02-764 (Cosco)	334	# 22-057 CLN (Safety 1st)	524
# 02-765 (Cosco)	334	# 22-057 DBY (Safety 1st)	524
# 02-770 (Cosco)	334	# 22-057 HRT (Safety 1st)	524
# 02-771 (Cosco)	334	# 22-057 LPH (Safety 1st)	524
# 02-772 (Cosco)	334	# 22-085 DWA (Safety 1st)	524
# 02-774 (Cosco)	306	# 22-085 LYN (Safety 1st)	524
# 02-790 (Cosco)	316	# 22-095 RBK (Safety 1st)	524
# 02-821 (Cosco)	329	# 22-297 (Cosco)	315
# 02-890 (Cosco)	316	# 22-298 (Cosco)	315
# 02014 (Cosco)	330	# 22-299 (Cosco)	315
# 02015 (Cosco)	330	# 22-300 CSF (Cosco)	307
# 02019 (Cosco)	330	# 22-300 FZN (Cosco)	307
# 02084 (Cosco)	330	# 22-300 JJV (Cosco)	307
# 02094 (Cosco)	330	# 22-300 OSF (Cosco)	307
# 02114 (Cosco)	330	# 22-300 THD (Cosco)	307
# 02332 (Cosco)	300	# 22-300 TWD (Cosco)	307
# 02409 (Cosco)	313	# 22-300 JOS GB1B (Cosco)	310
# 02409 (Eddie Bauer)	349	# 22-305 NAB (Disney)	337
# 02442 (Cosco)	313, 314	# 22-305 PPH (Disney)	337
# 02442 (Eddie Bauer)	349	# 22-322 HRR (Safety 1st)	524
# 02443 (Cosco)	313, 314	# 22-322 KDL (Safety 1st)	524
# 02443 (Eddie Bauer)	349	# 22-322 LXI (Safety 1st)	524
# 02445 (Cosco)	313	# 22-322 MAI (Safety 1st)	524
# 02445 (Eddie Bauer)	349	# 22-322 OLY (Safety 1st)	524
# 02448 (Cosco)	313, 314	# 22-322 PRS (Safety 1st)	524
# 02448 (Eddie Bauer)	349	# 22-322 PTK (Safety 1st)	524
# 02449 (Cosco)	313	# 22-325 COB (Safety 1st)	524
# 02449 (Eddie Bauer)	349	# 22-325 PAC (Safety 1st)	524
# 02450 (Cosco)	313	# 22-325 xxx GB1B (Safety 1st)	521
# 02450 (Eddie Bauer)	349	# 22-355 LBF (Disney)	337
		# 22-355 PWK (Disney)	337
		# 22-371 (Eddie Bauer)	467
		# 22-371 HFL (Maxi-Cosi)	468
		# 22-371 JUC (Maxi-Cosi)	468
		# 22-371 LMD (Maxi-Cosi)	468
		# 22-371 ORE (Maxi-Cosi)	468
		# 22-371 PNG (Maxi-Cosi)	468
		# 22-372 (Eddie Bauer)	467
		# 22-372 TTH (Maxi-Cosi)	468
		# 22-380 LGA (Safety 1st)	524
		# 22-380 MSA (Safety 1st)	524
		# 22-515 (Eddie Bauer)	467
		# 22-515 BLK (Maxi-Cosi)	468
		# 22-625 xxx GB1B (Eddie Bauer)	346
		# 22-627 AWF (Disney)	337
		# 22-627 CGT (Eddie Bauer)	350
		# 22-627 FRK (Eddie Bauer)	350
		# 22-627 KGS (Eddie Bauer)	350
		# 22-627 SNW (Eddie Bauer)	350
		# 22-627 WAV (Safety 1st)	524
		# 22-627 WPR (Eddie Bauer)	350
		# 22-655 BYTE (Eddie Bauer)	350
		# 22077x (Safety 1st)	526
		# 22078x (Safety 1st)	526
		# 22100 (Cosco)	331
		# 22100x (Cosco)	332
		# 22111x (Cosco)	332
		# 22130x (Cosco)	332
		# 22139MON (Cosco)	317
		# 22148x (Alpha Elite)	205
		# 22149x (Alpha Elite)	205
		# 22150 (Cosco)	301
		# 22150x (Cosco)	303
		# 22151 (Safety 1st)	514
		# 22152x (Safety 1st)	515
		# 22154x (Cosco)	302
		# 22155 (Cosco)	301
		# 22155x (Cosco)	302
		# 22158x (Alpha Elite)	205
		# 22158x (Cosco)	302
		# 22159x (Safety 1st)	515
		# 22172x (Safety 1st)	515
		# 22177x (Safety 1st)	515
		# 22178x (Safety 1st)	515
		# 22180 (Cosco)	301
		# 22185x (Safety 1st)	515
		# 22187xxx (Safety 1st)	516
		# 22188x (Safety 1st)	515
		# 22195x (Safety 1st)	515
		# 22269 (Cosco)	301
		# 22331 BLA (Alpha Elite)	206, 207
		# 22332 RLA (Alpha Elite)	206, 207
		# 22346x (Bertini)	219
		# 22356x (Safety 1st)	526
		# 22371x (Maxi-Cosi)	469
		# 22372x (Maxi-Cosi)	469
		# 22412x (Safety 1st)	515
		# 22439x (Safety 1st)	518

Car Seat Recalls and Safety Notifications: MODELS 10 YEARS OLD AND OLDER

Produced by: UNC Highway Safety Research Center - 800-672-4527 x2

Download this list & sign up for email notification of updates:

Funded by: NC Governor's Highway Safety Program

buckleupnc.org/car-seat-recall-list

For the model numbers "x" = more numbers or letters follow

Index number refers to "List No." for each listing

Dorel (continued)

# 22449x (Safety 1st)	518
# 22450 (Safety 1st)	522
# 22451 (Safety 1st)	522
# 22452 (Safety 1st)	522
# 22452x (Alpha Sport)	208
# 22453 (Safety 1st)	522
# 22453x (Safety 1st)	523
# 22455 (Safety 1st)	514
# 22456x (Safety 1st)	515
# 22458x (Alpha Sport)	208
# 22459x (Alpha Elite)	205
# 22460 (Safety 1st)	525
# 22462x (Alpha Elite)	204
# 22465x (Safety 1st)	515
# 22465xxx (Safety 1st)	516
# 22469x (Safety 1st)	515
# 22475x (Safety 1st)	529
# 22476x (Maxi-Cosi)	470
# 22480 (Safety 1st)	522
# 22481 (Safety 1st)	522
# 22486x (Maxi-Cosi)	470
# 224x (Cosco)	333
# 22546x (Alpha Sport)	209
# 22547x (Alpha Sport)	209
# 22553x (Safety 1st)	530
# 22554x (Safety 1st)	530
# 22560x (Safety 1st)	530
# 22561x (Safety 1st)	530
# 22564x (Safety 1st)	530
# 22567x (Safety 1st)	530
# 22574x (Safety 1st)	530
# 22580x (Safety 1st)	528
# 225x (Cosco)	333
# 22630xxx (Eddie Bauer)	342, 343
# 22631xxx (Eddie Bauer)	342, 343
# 22657x (Eddie Bauer)	352
# 22740 (Eddie Bauer)	340, 347
# 22740x (Eddie Bauer)	348
# 22741x (Eddie Bauer)	348
# 22750 (Eddie Bauer)	340, 341
# 22755 (Eddie Bauer)	340, 341
# 22755x (Eddie Bauer)	344
# 22756 (Eddie Bauer)	340, 341
# 22757 (Eddie Bauer)	340, 341
# 22758x (Eddie Bauer)	344
# 22759x (Eddie Bauer)	344
# 22770 (Eddie Bauer)	340, 341
# 22790x (Eddie Bauer)	344
# 22790xxx (Eddie Bauer)	345
# 22799x (Eddie Bauer)	344
# 22880x (Eddie Bauer)	351
# 229x (Cosco)	333
# 244x (Cosco)	322
# 313 (Cosco)	320
# 323 (Cosco)	321
# 423 (Cosco)	321

# 81A (Cosco)	318
# 81B (Cosco)	318
# 93084 (Cosco)	330
# 93094 (Cosco)	330
# 93100x (Cosco)	332
# 93111x (Cosco)	332
# 93443 (Cosco)	314
# 93446 (Cosco)	331
# 93504 (Cosco)	331
# 93514 (Cosco)	314, 330
# CC033xxx (Safety 1st)	516
# CC046xxx	345
# CC046xxx (Eddie Bauer)	345
# CC046xxx (Safety 1st)	516
# CC050xxx (Safety 1st)	519
# CC051xxx (Safety 1st)	519
# IC072x (Eddie Bauer)	352
3-in-1 (Eddie Bauer)	339, 340
Alpha Elite (Safety 1st)	513
Alpha Luxe (Alpha Elite)	204
Alpha Omega (Cosco)	299, 300, 301
Alpha Omega (Eddie Bauer)	341
Alpha Omega (Safety 1st)	514
Alpha Omega All-N-1 (Alpha Elite)	205
Alpha Omega All-N-1 (Cosco)	303
Alpha Omega All-N-1 (Safety 1st)	515
Alpha Omega Elite (Alpha Elite)	205
Alpha Omega Elite (Cosco)	301, 302
Alpha Omega Elite (Eddie Bauer)	341
Alpha Omega Elite (Safety 1st)	514, 515
Alpha Sport (Safety 1st)	517
Arriva (Cosco)	304, 305, 306
Avenue (Safety 1st)	518
Comfort Infant Seat (Alpha Elite)	206, 207
Comfort Infant Seat (Eddie Bauer)	342, 343
Commuter (Cosco)	309
Complete Air LX	519
Deluxe 3-in-1 (Eddie Bauer)	340, 344, 345
Deluxe Convertible (Eddie Bauer)	340
Designer 22 (Beatrix Potter)	218
Designer 22 (Cosco)	310
Designer 22 (Eddie Bauer)	346
Designer 22 (Safety 1st)	520, 521
Dream Ride (Cosco)	311
DreamRide (Cosco)	312
Enspira (Alpha Sport)	208
Enspira (Eddie Bauer)	347, 348
Enspira (Safety 1st)	522, 523
Hi Back Booster (Cosco)	313
Hi Back Booster (Eddie Bauer)	349
High Rise Booster (Cosco)	315
Infant Car Seat (Cosco)	307
Infant Car Seat (Disney)	337
Infant Car Seat (Eddie Bauer)	350
Infant Car Seat (Safety 1st)	524
Intera (Safety 1st)	525

Lxry Sft Shld Auto Trac (Cosco)	316
Mico (Maxi-Cosi)	467, 468, 469
OnBoard (Safety 1st)	526
Priori (Maxi-Cosi)	470
Prospect (Safety 1st)	528
Prospect Adjustable Hiback Booster (Eddie Bauer)	351
Regal Ride (Cosco)	317
Safe and Easy (Cosco)	320
Safe and Snug (Cosco)	321
Safe-T-Mate (Cosco)	319
Safe-T-Shield (Cosco)	318
Sft Shld Auto Trac (Cosco)	324
Sidekick Booster (Cosco)	322
Soft Shield (Cosco)	323
Soft Shield Deluxe (Cosco)	325
SureFit (Bertini)	219
SureFit (Eddie Bauer)	352
Touriva (Cosco)	326, 330, 331, 332
Touriva (Eddie Bauer)	353
Touriva 5-point (Cosco)	328
Touriva Shield (Cosco)	327
Touriva T-Shield (Cosco)	329
Trooper (Cosco)	333
Turnabout (Cosco)	334
Uptown (Safety 1st)	529
Vantage (Alpha Sport)	209
Vantage (Safety 1st)	530
Vantage Highback (Safety 1st)	530
Vantage Point/Surveyor (Safety 1st)	530
Voyager Inf/Stroller (Cosco)	335

Dorel (Cosco)

# IC123 FSM	308
Comfy Carry	308

Dorel (Safety 1st)

# IC124 FSM	527
OnBoard 35	527

Downunder

Kangaroo Booster	338
------------------	-----

Eddie Bauer

# 02-331	339
# 02-332	339
# 02-531	339
# 02-533	339
# 02-537	339
# 02-555	339
# 02409	349
# 02442	349
# 02443	349
# 02445	349
# 02448	349
# 02449	349
# 02450	349

Car Seat Recalls and Safety Notifications: MODELS 10 YEARS OLD AND OLDER

Produced by: UNC Highway Safety Research Center - 800-672-4527 x2

Funded by: NC Governor's Highway Safety Program

Download this list & sign up for email notification of updates:

buckleupnc.org/car-seat-recall-list

For the model numbers "x" = more numbers or letters follow

Index number refers to "List No." for each listing

Eddie Bauer (continued)

# 02480	349	# 219180	389	# 415	356
# 02495	349	# 219186	389	# 416	356
# 02870	353	# 219188	389	# 4176	378
# 02871	353	# 21940	389	# 420	391
# 02875	353	# 219x	333, 361, 380	# 435x	372
# 22-625 xxx GB1B	346	# 221	377	# 441	365, 366, 371
# 22-627 CGT	350	# 222	378	# 442	365, 366, 371
# 22-627 FRK	350	# 223	378	# 443	365, 366, 371
# 22-627 KGS	350	# 224x	333, 359, 360, 361, 380	# 444	365, 366, 371
# 22-627 SNW	350	# 225x	333, 361, 380	# 445	365, 366, 371
# 22-627 WPR	350	# 227	393	# 446	365, 366, 371
# 22-655 BYTE	350	# 228	382	# 447	365, 366
# 22630xxx	342, 343	# 229x	333, 361, 379, 380	# 447x	375
# 22631xxx	342, 343	# 231	392	# 448	365, 366, 371
# 22657x	352	# 232	394	# 453	381, 382
# 22740	340, 347	# 242	358	# 454	381, 382
# 22740x	348	# 244x	322	# 456	370, 371
# 22741x	348	# 264x	387, 388	# 458	370, 371
# 22750	340, 341	# 272x	362	# 46811xxx	368
# 22755	340, 341	# 273x	362	# 468x	362
# 22755x	344	# 3021769Z	364	# 469x	362
# 22756	340, 341	# 3021854Z	364	# 470	357, 358
# 22757	340, 341	# 30711365	383	# 471	357, 358
# 22758x	344	# 31011048	373	# 476x	362
# 22759x	344	# 31011049	373	# 477x	362
# 22770	340, 341	# 31011057C	373	# 478x	362
# 22790x	344	# 31011059	373	# 480x	362
# 22790xxx	345	# 3101198	373	# 48111xxx	368
# 22799x	344	# 3101980	373	# 481x	362
# 22880x	351	# 3151198	368	# 48411xxx	368
# CC046xxx	345	# 31511xxx	368	# 492x	374
# IC072x	352	# 3151953	368	# 493x	372
3-in-1	339, 340	# 31521138	368	# 499x	375
Alpha Omega	341	# 317xx	367	# 52911307A	368
Alpha Omega Elite	341	# 320xx	367	# 52921040	368
Comfort Infant Seat	342, 343	# 359x	388	# 534	363
Deluxe 3-in-1	340, 344, 345	# 3604098	369	# 540xx	367
Deluxe Convertible	340	# 378x	386	# 548xx	367
Designer 22	346	# 379x	386	# 549xx	367
Enspira	347, 348	# 389x	388	# 550xx	367
Hi Back Booster	349	# 390	363	# 552	363
Infant Car Seat	350	# 391	363	# 55311xxx	368
Prospect Adjustable Hiback Booster	351	# 397xx	367	# 556xx	367
SureFit	352	# 398xx	367	# 597xx	367
Touriva	353	# 401	377	# 598xx	367
		# 402	377	# 599xx	367
		# 403	377	# 636x	390
		# 404	377	# 637x	390
		# 405	377	# 639001	376
		# 406	377	# 639002	376
		# 407	377	410	354
		# 408	377	Bobby Mac Champion	355
		# 409	377	Bobby Mac Deluxe	356
		# 410	354	Booster Seat	357, 358
		# 411	355	Champion	359, 360, 361
		# 412	356	Cozy Carry	362
		# 414	356	Discovery	363, 364

Evenflo

# 200x	375				
# 201	371				
# 202	366, 371				
# 203x	372				
# 205x	372, 384, 385				
# 207x	374				
# 210x	372, 385				
# 211x	375				
# 219164	389				

Car Seat Recalls and Safety Notifications: MODELS 10 YEARS OLD AND OLDER

Produced by: UNC Highway Safety Research Center - 800-672-4527 x2

Funded by: NC Governor's Highway Safety Program

Download this list & sign up for email notification of updates:

buckleupnc.org/car-seat-recall-list

For the model numbers "x" = more numbers or letters follow

Index number refers to "List No." for each listing

Evenflo (continued)		# 8403x	424	# 8C02x	417
Dyn-O-Mite	365, 366	# 841101	423	# 8C03x	417
Embrace	367	# 841102	423	# 8C04FRR	419
Embrace 35	368	# 841103	423	# 8C04FRR2	419
First Choice	369	# 8412	424	# 8C04x	417
Infant Car Seat	370, 371	# 841203	423	# 8D01x	416
Joyride	372	# 8412T02	423	# 8D02x	416
Maestro	373	# 8433x	417	# 8D03x	416
On My Way	374, 375	# 8442x	424	# 8D04x	416
On My Way base	376	# 8443	424	# 8D05x	416
One-Step	377	# 8443L	424	# 8D10x	416
One-Step Deluxe	378	# 8444	424	# C844342	424
Scout	379, 380	# 8444L	424	Aprica A30	415
Seven Year Seat	381, 382	# 8446	424	CarGo	416
Sidekick	322	# 8446L	424	ComfortSport	417, 418, 419
Snugli Embrace 35	383	# 8447	424	Cozy Cline	420
Travel Tandem	384, 385	# 8447L	424	GT 1000	421
Tribute	386	# 8448	424	SafeSeat - Step 2	422
Triumph	387, 388	# 8448L	424	Snug Ride	426
Trooper	333, 389	# 8457	423, 424	Snug Ride 35	428
Two-in-One	390	# 8458	423, 424	Snug Ride Classic Conct 30	427
Ultara 1	391, 392	# 8459	423, 424	Snug Ride Classic Conct 35	428
Ultara II	393, 394	# 8460	423	Snug Ride Click Conct 40	429
		# 8462	423	SnugRide	423, 424, 425
Fisher Price		# 8463x	424	SnugRide Classic Connect	426
# 79700	409	# 8464	424		
# 9100	395, 396, 397, 398, 399, 400, 401, 402, 403	# 8470	424	International	
# 9101	396, 397, 399, 400, 401, 402, 403	# 8471	423, 424	Astroseat	430
# 9104	404, 407, 408	# 8472	423		
# 9149	405	# 8473	423	Kolcraft	
# 9173	406	# 8474	423	# 131-101	456
Booster	407, 408	# 8476	423	# 13123	455
Car Seat	395, 396, 397, 398, 399, 400, 401, 402, 403	# 8477	423	# 1312x	439
Delux Car Seat	404	# 8478	423, 424	# 1382x	439, 451, 454, 461
Infant Seat	405, 406	# 8487x	416	# 13833	432, 453, 460
Safe Embrace	409	# 8601	424	# 1383x	436, 439, 451, 454, 461
		# 8602x	424	# 13842	432, 453, 460
		# 8603M	424	# 1384x	451, 454, 461
		# 8605x	424	# 13852	432, 453, 460
Ford		# 8607x	424	# 1385x	454, 461
Infant Love Seat	410	# 8608D	424	# 138xx	438, 450, 452, 459
		# 8609x	425	# 140-155	447
General Motors		# 8616x	425	# 150-100	463
Child Love Seat	412	# 8629x	417	# 180-100	442
Infant Love Seat	411	# 8630x	417	# 180-150	442, 443
		# 8631x	417	# 180-200	433, 434, 443, 444
Gerry		# 8632x	417	# 180-300	433, 434
# 626	414	# 8635x	417	# 180-400	447
Guardian	413	# 8639x	417	# 180-600	431, 435
Secure Ride	414	# 8643x	425	# 180-601	431
		# 8645x	425	# 19127	440, 441
Graco		# 8646x	425	# 19128	440
# 7493	423	# 8686x	416	# 19129	440
# 7497	423	# 8689x	416	# 19130	440
# 7499	423	# 8C00x	417	# 368xx	438, 439, 450, 451, 452, 454, 459
# 8402	424	# 8C01x	417	# 43xxx	437, 457
# 8402L	424	# 8C02MRC2	418	# 77001	448

Car Seat Recalls and Safety Notifications: MODELS 10 YEARS OLD AND OLDER

Produced by: UNC Highway Safety Research Center - 800-672-4527 x2

Download this list & sign up for email notification of updates:

Funded by: NC Governor's Highway Safety Program

buckleupnc.org/car-seat-recall-list

For the model numbers "x" = more numbers or letters follow

Index number refers to "List No." for each listing

Kolcraft (continued)

# 77002	448
# 77005	449
# 77007	449
Automate	431
Carter Travel 5	432
Dial-A-Fit	433, 434
Dial-A-Fit II	435
Flip 'N' Go	440
Flip 'N' Go II	441
Infant Car Seat	436
Infant Restraint	437
Infant Rider	438, 439
Perfect Fit	442, 443, 444
Performa	445, 446
Playskool	447, 448
Playskool Infant	449
Plus 4	450, 451
Plus 5	452, 453, 454
Rock 'N' Ride	455, 456
Secura	457
Secure Fit	458
Travel About	459, 460
Travel-About	461
Traveler 700	462, 463, 464

Lin Lih/MCP

# 180-200	466
# 180-300	466
Lin Lih	465, 466

Maxi-Cosi

# 22-371	467
# 22-371 HFL	468
# 22-371 JUC	468
# 22-371 LMD	468
# 22-371 ORE	468
# 22-371 PNG	468
# 22-372	467
# 22-372 TTH	468
# 22-515	467
# 22-515 BLK	468
# 22371x	469
# 22372x	469
# 22476x	470
# 22486x	470
Mico	467, 468, 469
Priori	470

Mercedes-Benz

# B66868203	475
# B66868204	475
# B66868209	475
# BQ6910155	474
# BQ6910157	473
# BQ691063	473
Booster Seat	473

Infant Restraint	474
Kiddy TopSafe	475

Mia Moda

# 5000	471, 472
# 5001	471, 472
# 5050	472
# 5051	472
# 5070	472
# 5071	472
# 5080	472
# 5081	472
Viva	471, 472
Viva Supreme	472

Peg Perego

# 32MD41KN41	479
# 35CR13BU13	479
# 35CR13PL46	479
# 35CR24BU24	479
# 35TL49KN53	479
# 35TL53KN46	479
# 61FG13ST53	479
# 61FG53ST49	479
# 61FG53ST64	479
# 61ST13IC53	479
# 61ST34IC53	479
# 61ST48IC53	479
# AL33USL	478
# AL33USN	478
# AL34USL	478
# AL34USN	478
# CS00MU1	477, 478, 479
# CS00US1	477, 478
# CS00US8	477, 478
# IMCB00JA57RJ31JU31	476
# LN34S09	478
# LN34S10	478
# LV34USL	478
# LV34USN	478
# ST33USL	478
# ST33USN	478
# ST38USL	478
# ST38USN	478
Jacadi	476
Primo Viaggio	477, 478
Primo Viaggio SIP 30/30	479

Playskool

# 140-155	480
# 180-400	480
# 77001	481
# 77002	481
# 77005	482
# 77007	482
Car Seat	480, 481
Infant Car Seat	482

Pride Trimble/Virco

# 832	485
# 890	483, 484
# 891	483, 484
# 892	483, 484
Click-n-Go	483, 484
Pride Ride	485

Questor

Kantwet Car Seat	486
------------------	-----

Recaro

# 330.00.xxx	492
# 330.01.xxx	492
# 331.00.xxx	487, 488, 489, 491
# 331.01.xxx	489
# 385.01.xxx	490
Como	487, 488, 489
ProSport	490
Signo	491, 492

Regal Lager (Cybex)

# 0500200xx	336
# 0500760xx	336
Solution X-fix	336

Renolux (FBS)

GT 1000	493
GT 2000	494, 495, 496
GT 4000	497, 498
GT 5000	499, 500
GT 5000 Turn A Tot.	501, 502, 503
GT 5500	504, 505
GT 7000	506, 507, 508

Safeline Kids

# 3240	509
Sit'n'Stroll	509

Safeline Kids (see Triple Play also)

# 2003	512
# 2240	511
# 3240	510
Sit'n'Stroll	510, 511, 512

Safety 1st (Dorel)

# 02-620-xxx	520
# 02-621-SAL	520
# 22-057 CLN	524
# 22-057 DBY	524
# 22-057 HRT	524
# 22-057 LPH	524
# 22-085 DWA	524
# 22-085 LYN	524
# 22-095 RBK	524
# 22-322 HRR	524
# 22-322 KDL	524

Car Seat Recalls and Safety Notifications: MODELS 10 YEARS OLD AND OLDER

Produced by: UNC Highway Safety Research Center - 800-672-4527 x2

Funded by: NC Governor's Highway Safety Program

Download this list & sign up for email notification of updates:

buckleupnc.org/car-seat-recall-list

For the model numbers "x" = more numbers or letters follow

Index number refers to "List No." for each listing

Safety 1st (Dorel) (continued)

# 22-322 LXI	524
# 22-322 MAI	524
# 22-322 OLY	524
# 22-322 PRS	524
# 22-322 PTK	524
# 22-325 COB	524
# 22-325 PAC	524
# 22-325xxxGB1B	521
# 22-380 LGA	524
# 22-380 MSA	524
# 22-627 WAV	524
# 22077x	526
# 22078x	526
# 22151	514
# 22152x	515
# 22159x	515
# 22172x	515
# 22177x	515
# 22178x	515
# 22185x	515
# 22187xxx	516
# 22188x	515
# 22195x	515
# 22356x	526
# 22412x	515
# 22449	518
# 22450	522
# 22451	522
# 22452	522
# 22453	522
# 22453x	523
# 22455	514
# 22456x	515
# 22460	525
# 22465x	515
# 22465xxx	516
# 22469x	515
# 22475x	529
# 22480	522
# 22481	522
# 22553x	530
# 22554x	530
# 22560x	530
# 22561x	530
# 22564x	530
# 22567x	530
# 22574x	530
# 22580x	528
# CC033xxx	516
# CC046xxx	516
# CC050xxx	519
# CC051xxx	519
# IC124 FSM	527
22439x	518
Alpha Elite	513
Alpha Omega	514

Alpha Omega All-N-1	515
Alpha Omega Elite	514, 515, 516
Alpha Sport	517
Avenue	518
Complete Air LX	519
Designer 22	520, 521
Enspira	522, 523
Infant Car Seat	524
Intera	525
OnBoard	526
OnBoard 35	527
Prospect	528
Uptown	529
Vantage	530
Vantage Highback	530
Vantage Point/Surveyor	530

Snug Seat

# 200-1000	531
# 600-1000	532
# E9L32	533
Gorilla	531
Spelcast	532
Traveller Plus	533

Snugli

See Evenflo	383
-------------	-----

Strolee

# 599	535
# 605	537
# 609	536
# 610	536
GT 3000	538
Quick Click	537
Wee Care	534, 535, 536

Team-Tex

# 374099	539
# 374199	540
Babyride	539, 540

Triple Play (see Safeline Kids also)

# 4002	541
Sit'n'Stroll	541

TRW

Child Love Seat	543
Infant Love Seat	542

Volvo

All	544
-----	-----

XSCI

Pioneered ACIS	545
----------------	-----

Car Seat Recalls and Safety Notifications: MODELS 10 YEARS OLD AND OLDER

Produced by: UNC Highway Safety Research Center - 800-672-4527 x2

Funded by: NC Governor's Highway Safety Program

Download this list & sign up for email notification of updates:

buckleupnc.org/car-seat-recall-list