

HIGHWAY SAFETY RESEARCH CENTER CAR SEAT RECALL LIST ARCHIVE

Last Revision: December 13, 2022

Download this list & sign up for email notification of updates: buckleupnc.org/car-seat-recall-list

About Car Seats and Recalls

It is very important to pay attention to recall notices and for parents to check if their seats are safe to use. Recalls can be issued for any failure to meet Federal Motor Vehicle Safety Standard 213. Most recalls are issued due to reasons related to the crashworthiness of the car seat, but some recalls are for deviations from the standards related to labeling requirements, flammability of the upholstery or padding, or for parts that may come loose and pose a choking hazard. All recalls should be corrected.

Car seats are required to have a label indicating the manufacturer, model information, and date of manufacture. Car seats should not be used if these labels are missing. It is important for people to register their car seat by either mailing the registration card to the manufacturer or by contacting the manufacturer directly.

In cases where the manufacturer of a recalled seat has gone out of business or discontinued replacement programs, parents are advised to discontinue use of the seat. Discarded seats should be taken apart and stripped of upholstery, padding and straps and then destroyed by having them crushed to prevent others from using them.

To report any suspected car seat defects, call the National Highway Traffic Safety Administration Auto Safety Hotline at 888-327-4236 / (TTY): 800-424-9153.

About Older Car Seats and Recalls

The older model list includes recalled seats that are now 10 or more years old. Caregivers will sometimes choose to use older car seats even though it not recommended. Knowing that a particular model is under recall should help to encourage the caregiver to destroy the older seat and obtain a new one.

About the HSRC Recall List

The UNC Highway Safety Research Center (HSRC) car seat recall list is updated as soon as possible after recall notifications are announced and after the information can be verified for completeness and accuracy. Users of this (or any other) recall list should remind parents/caregivers to contact the manufacturer to be certain whether or not a particular car seat is affected by any recalls and how to proceed with repairs or replacement.

Instructions for Using the HSRC Recall List

Find the manufacturer, model name, model number, and date of manufacture on the label of the car seat. Using this information, look to see if the manufacturer, model, and dates of manufacture match any of the listings. The list is alphabetized by manufacturer and model name. When in doubt, contact the manufacturer for clarification.

For further information, contact:

Bevan Kirley or Kristel Robison

The University of North Carolina Highway Safety Research Center

800-672-4527 x2 or cps@hsrc.unc.edu

www.buckleupnc.org/car-seat-recall-list

This Page Intentionally Left Blank

Car seats manufactured before 1981 were not required to be crash tested and must not be used. Most manufacturers stamp their car seats with an expiration date, typically six to eight years from the date of manufacture, on a label or in the shell of the seat. Many child passenger safety advocates recommend that if no expiration date can be found, car seats older than ten years should be replaced by a new one. Older models are included as a part of this recall list because care givers will sometimes choose to use older car seats even though it goes against the recommendations of most organizations and advocates. Knowing that a particular model is under recall, and if the defect cannot be corrected, should help to encourage the care giver to destroy the older seat and obtain a new one.

Following are recalls and safety notifications that were issued for models where all or most models sold are at least 10 years old as of December 13, 2022. The listing of older models with recalls will only be updated as "newer" models get to be old enough to be moved to the "older" models list.

Programs that make multiple copies of the HSRC recall list, e. g., for use at clinics or permanent checking/fitting stations, should only have to make copies of this older model section when it is revised, regardless of how often the main (newer model) section is revised. Most clinics or permanent checking/fitting stations should only need to print/copy one or two older model lists for reference. Updated versions of this list, as well as the list of models less than 10 years old, are posted on-line at www.buckleupnc.org/car-seat-recall-list.

CAR SEATS 10 YEARS OLD AND OLDER

Download this list & sign up for email notification of updates: buckleupnc.org/car-seat-recall-list

Refer to Page 24 for the Index of Recalls and Safety Notifications

<i>List No.</i>	<i>Manufacturer Model # ("X" = more numbers or letters follow)</i>	<i>Customer assistance Mfg Date</i>	<i>Problem Type and Consumer Action</i>
-----------------	--------------------------------------------------------------------	-------------------------------------	-----------------------------------------

Alcot (Childcare)

ALL MODELS OLDER THAN 10 YEARS - REPLACEMENT PROGRAM DISCONTINUED - DESTROY & REPLACE

201) Child Love Seat 3/84-11/84 Plastic shell may develop cracks. Destroy & replace seat.

All Our Kids

ALL MODELS OLDER THAN 10 YEARS - REPLACEMENT PROGRAM DISCONTINUED - DESTROY & REPLACE

202) Little Cargo Vest 600 4/93-3/94 Flammability of upholstery. Call mfg. for repair info.
 203) Little Cargo Vest 602 3/94-9/94 Flammability of upholstery. Call mfg. for repair info.

Alpha Elite (Dorel)

Dorel Juvenile Group: 866-623-3139 / 800-219-0509 / 866-611-3022 / 812-372-0141 www.djgusa.com

204) Alpha Luxe 22462x 05/01/08-04/30/09 Harness locking and release button does not always return to its locked position and could result in a loose harness, increasing the risk of being injured a crash. Contact mfg. for repair kit.
 205) Alpha Omega All-N-1 22459x 05/01/08-04/30/09 Harness locking and release button does not always return to its locked position and could result in a loose harness, increasing the risk of being injured a crash. Contact mfg. for repair kit.
 Alpha Omega Elite 22148x, 22149x, 22158x

Car Seat Recalls and Safety Notifications: MODELS 10 YEARS OLD AND OLDER

For the model numbers "x" = more numbers or letters follow

List No.	Manufacturer Model # ("X" = more numbers or letters follow)	Customer assistance Mfg Date	Problem Type and Consumer Action
----------	-------------------------------------------------------------	------------------------------	----------------------------------

Alpha Elite (Dorel) (continued)

206)	Comfort Infant Seat	22331 BLA, 22332 RLA	07/26/05- 02/28/06	Trim screws on handle can loosen resulting in a potential choking hazard. Contact mfg. at 877-229-1374 for free repair kit. Make sure the handle trim screws are tight and continue to use the existing seat while waiting to receive and install the repair kit.
207)	Comfort Infant Seat	22331 BLA, 22332 RLA	07/26/05- 02/28/06	Some consumers have experienced difficulty installing the base in certain vehicles. Dorel will replace the original version of the base at no charge to the customer. Contact mfg. at 877-229-1374 to determine eligibility for a replacement base.

Alpha Sport (Dorel)

Dorel Juvenile Group: 866-623-3139 / 800-219-0509 / 866-611-3022 / 812-372-0141
www.djgusa.com

208)	Enspira	22452x, 22458x	05/01/08- 04/30/09	Harness locking and release button does not always return to its locked position and could result in a loose harness, increasing the risk of being injured a crash. Contact mfg. for repair kit.
209)	Vantage	22546x, 22547x	05/01/08- 04/30/09	Harness locking and release button does not always return to its locked position and could result in a loose harness, increasing the risk of being injured a crash. Contact mfg. for repair kit.

American Motors

ALL MODELS OLDER THAN 10 YEARS - REPLACEMENT PROGRAM
DISCONTINUED - DESTROY & REPLACE

210)	Infant Love Seat	All	1/81-12/82	Plastic shell may develop cracks. Destroy & replace seat.
211)	Child Love Seat	All	3/84-11/84	Plastic shell may develop cracks. Destroy & replace seat.

Baby Trend

800-328-7363 - www.babytrend.com

212)	Rigid Latch-Loc	6439, 6448, 6481	05/14/07- 04/01/08	Incorrect steel used on the latch connector can crack and allow the child seat base to detach from the vehicle's latch anchors during a severe crash. Contact mfg. for a replacement base. Install with vehicle seat belt until base is replaced.
213)	Rigid Latch-Loc Base	6400	05/14/07- 04/01/08	Incorrect steel used on the latch connector can crack and allow the child seat base to detach from the vehicle's latch anchors during a severe crash. Contact mfg. for a replacement base. Install with vehicle seat belt until base is replaced.

Babyhood Industries

ALL MODELS OLDER THAN 10 YEARS - REPLACEMENT PROGRAM
DISCONTINUED - DESTROY & REPLACE

214)	Wonda Chair	810	Pre 12/82	Harness may be misrouted. Call mfg. for instructions.
215)	Baby-Sitter	8200	1/92-6/93	Buckle. Call mfg. for repair info.

Basic Comfort

ALL MODELS OLDER THAN 10 YEARS - REPLACEMENT PROGRAM
DISCONTINUED - DESTROY & REPLACE

216)	Galaxy 2000	960, 961	ALL	Crash test failure. Call mfg. for repair info.
217)	Galaxy 2000	960, 961	11/98-1/99	Faulty molding of foam backs and cushions may allow separation of part of the booster seat. Call mfg. for repair info.

Car Seat Recalls and Safety Notifications: MODELS 10 YEARS OLD AND OLDER

For the model numbers "x" = more numbers or letters follow

List No.	Manufacturer Model # ("X" = more numbers or letters follow)	Customer assistance Mfg Date	Problem Type and Consumer Action
Beatrix Potter (Dorel)		Dorel Juvenile Group: 800-219-0509 / 866-611-3022 / 812-372-0141 www.djgusa.com	
218)	Designer 22 02-621-SAL, 02-620-xxx	01/03/02-02/13/02	Plastic handle can unexpectedly release from the carrying position when used as a carrier. Does not affect safety as a child restraint. Contact mfg. for repair kit.
Bertini (Dorel)		Dorel Juvenile Group: 866-623-3139 / 800-219-0509 / 866-611-3022 / 812-372-0141 www.djgusa.com	
219)	SureFit (Travel system) 22346x	05/01/08-04/30/09	Harness locking and release button does not always return to its locked position and could result in a loose harness, increasing the risk of being injured a crash. Contact mfg. for repair kit.
Bolform Corp.		ALL MODELS OLDER THAN 10 YEARS - NO LONGER IN BUSINESS - DESTROY & REPLACE	
220)	Buckle-Up Harness 84E-019	ALL	Crash test failure. Destroy & replace.
Britax		888-427-4829 / 704-409-1700 www.britaxusa.com	
221)	Advantage E902228	03/05/01-07/26/01	One of the tether brackets of affected seats may separate from the tether attachment point. Contact mfg. for repair kit.
222)	Advocate 70-G3 E9LG81A, E9LG83x, E9LL21A, E9LL23P, E9LL23Y	06/01/12-08/31/12	Children who bite or chew on the shoulder strap HUGS pads could bite off small pieces, presenting a choking hazard. Contact mfg. for replacement HUGS pads and instructions.
223)	Boulevard E9L57	03/01/06-08/01/06	Top tether hook can open during a crash allowing the restraint to change from an upright to a reclined position. Owners are being advised to discontinue use of the top tether when the child reaches 50 lbs. Contact mfg. for replacement labels.
224)	Boulevard 70-G3 E9LJ91x, E9LJ92E, E9LJ93P, E9LJ93S, E9LK91A	06/01/12-08/31/12	Children who bite or chew on the shoulder strap HUGS pads could bite off small pieces, presenting a choking hazard. Contact mfg. for replacement HUGS pads and instructions.
225)	Chaperone E9L69N9, E9L69P2, E9L69P3, E9L69P5	04/01/09-05/31/10	The chest clip may break when it is engaged as the infant is secured into the infant car seat creating a safety hazard. Contact mfg. for repair kit.
226)	Chaperone E9L692J, E9L692K, E9L692L, E9L692M	09/01/10-04/30/11	Voluntary Recall - The harness adjuster may detach from the shell due to an improperly installed rivet. Contact mfg. for repair kit.
227)	Companion E9L14	10/31/03-06/06/04	One or both of two tabs on the bottom of the carrier may not be properly seated and may allow the carrier to rotate in the base too far in a crash. Correct/incorrect assembly can be determined by visual examination. Call mfg. for replacement info. Affected units may be installed without the base until receiving a replacement.
228)	Companion E9L14, E9L20, E9L80	Pre-11/01/07	User Guide Update - NOT A RECALL: Britax has updated instructions regarding adjustment of the buckle strap position and maximum height for infant carrier use. The inner buckle strap position should be used for infants weighing less than 11 pounds. A child has exceeded the height limit for the Companion when the top of the head is less than one inch from the top of the child restraint or the child's height exceeds 30 inches (76 cm). Contact mfg for updated user guide and labels

Car Seat Recalls and Safety Notifications: MODELS 10 YEARS OLD AND OLDER

For the model numbers "x" = more numbers or letters follow

List No.	Manufacturer Model Name	Model # ("X" = more numbers or letters follow)	Mfg Date	Customer assistance Problem Type and Consumer Action
Britax (continued)				
229)	Decathlon	E9L47	02/12/05-07/31/07	Under certain circumstances the harness adjuster housing may separate from the child restraint shell and allow the adjuster to move out of position. If this happens caregivers may experience difficulty adjusting the harness. Call mfg. for repair info.
230)	Freeway	101	6/96-4/97	Buckle. Call mfg. for repair info.
231)	Frontier	E9L54E7, E9L54H6, E9L54H7, E9L54M6	04/01/08-09/14/08	Harness straps may become detached from the metal yoke on the back of the seat If they are loosened one strap at a time with excessive force. Contact mfg. for repair kit.
232)	Frontier	E9L5490	04/01/08-09/17/08	Harness straps may become detached from the metal yoke on the back of the seat If they are loosened one strap at a time with excessive force. Contact mfg. for repair kit.
233)	Husky	E9L30	08/01/02-12/31/03	Head excursions higher than allowed by FMVSS 213 could result when installed as instructed with a long/serpentine belt path. Contact mfg. for replacement labels advising the use of an alternative short belt path.
234)	Husky	E9L30	Pre-07/24/04	The adjuster strap may slip within the metal buckle that controls the tightness of the shoulder harness and may allow the harness to loosen. Contact mfg. for repair kit.
235)	Marathon	E9L06	Pre-07/24/04	The adjuster strap may slip within the metal buckle that controls the tightness of the shoulder harness and may allow the harness to loosen. Contact mfg. for repair kit.
236)	Marathon	E9L06, E9W06, E906 with top tether lot # KGR 01 A	05/23/06-07/28/06	The top tether hook may open and have the potential to release from the tether anchor if the child exceeds 50 pounds. Contact mfg. for repair kit.
237)	Pavilion 70-G3	E9LK31x, E9LK32x, E9LK33Q, E9LL11x, E9LL12x	06/01/12-08/31/12	Children who bite or chew on the shoulder strap HUGS pads could bite off small pieces, presenting a choking hazard. Contact mfg. for replacement HUGS pads and instructions.
238)	Regent	E9L39x	11/10/05-06/18/07	Consumer Advisory/Product Update - NOT A RECALL: Britax has modified the Regent and revised the installation instructions. Contact mfg. to receive a free product update kit that includes a revised user guide, replacement belt-routing label, a longer LATCH connector strap, and adhesive slip resistant strips.
239)	Regent Classic	E9L3998	12/18/06-01/18/07	Affected seats were produced with an incorrect airbag warning label attached to the cover. Contact mfg. to receive a free replacement cover.
240)	Roundabout	161	1/99-3/99	Possible faulty molding of shell can allow excessive head excursion. Call mfg. for repair info.
241)	Super Elite	E9031	04/25/01-02/15/02	Harness may allow too much forward head movement. Contact mfg. to receive a free replacement harness system.
242)	Super Elite	E9031	04/01/01-08/31/02	Harness adjuster tab may begin to stick after prolonged use. Harness may loosen if it sticks in the open position. Contact mfg. for repair kit and installation instructions.
243)	Traveller Plus	E9L32 (Mfg. by Britax for Snug Seat)	Pre-07/24/04	The adjuster strap may slip within the metal buckle that controls the tightness of the shoulder harness and may allow the harness to loosen. Contact mfg. for repair kit.
244)	Wizard	E9L07	Pre-07/24/04	The adjuster strap may slip within the metal buckle that controls the tightness of the shoulder harness and may allow the harness to loosen. Contact mfg. for repair kit.
Century Products			800-837-4044 / 216-468-2000	
245)	100	4100	1/81-4/81	Upholstery buttons. Call mfg. for repair info.

Car Seat Recalls and Safety Notifications: MODELS 10 YEARS OLD AND OLDER

For the model numbers "x" = more numbers or letters follow

List No.	Manufacturer Model Name	Model # ("X" = more numbers or letters follow)	Mfg Date	Customer assistance Problem Type and Consumer Action
----------	-------------------------	------------------------------------------------	----------	------------------------------------------------------

Century Products (continued)

246)	100	4100	4/85-2/86	Plastic shell may crack in crash. Call mfg. for repair info.
247)	1000 STE	4153, 4163, 4180	12/90-10/91	Incorrect labels on seat. Call mfg. for corrections
248)	200	4200, 4210, 4235, 4214, 4223	1/81-4/81	Upholstery buttons. Call mfg. for repair info.
249)	200	4200, 4210, 4235, 4214, 4223	June 81	Washers on frame. Call mfg. for repair info.
250)	200	4200, 4210, 4235, 4214, 4223	1/81-1/83	Buckle. Call mfg. for repair info.
251)	200	4200, 4210, 4235, 4214, 4223	4/85-2/86	Plastic shell may crack in crash. Call mfg. for repair info.
252)	2000 STE	4253, 4263, 4265	4/84-6/89	Harness. Call mfg. for repair info.
253)	2000 STE	4253, 4261, 4263, 4265, 4266	12/90-10/91	Incorrect labels on seat. Call mfg. for corrections
254)	2000 STE	4253, 4261, 4263, 4265, 4266	12/91-4/92	Buckle. Call mfg. for repair info.
255)	300	4300, 4302, 4303, 4323, 4310, 4334, 4335	4/85-2/86	Plastic shell may crack in crash. Call mfg. for repair info.
256)	3000 STE	4365DT, 4366	3/89-10/89	Upholstery. Call mfg. for repair info.
257)	3000 STE	4353, 4365, 4366, 4368	5/90-6/90	Crash test failure of buckle. Call mfg. for repair info.
258)	3000 STE	4353, 4365, 4366, 4368	Pre 91	Buckle instructions. Call mfg. for corrections
259)	3000 STE	4365, 4366, 4367, 4368, 4369, 4380, 4381	12/90-10/91	Incorrect labels on seat. Call mfg. for corrections
260)	3000 STE	4353, 4365, 4366, 4367, 4368, 4369	10/89-4/92	Buckle. Call mfg. for repair info.
261)	3500 STE	4380	12/90-4/92	Buckle. Call mfg. for repair info.
262)	4-In-1 Travel System	11-570, 11-597, 11-600, 11-650	9/95-5/96	Buckle. Call mfg. for repair info.
263)	4-In-1 Travel System	11-564, 11-565, 11-570, 11-575, 11-576, 11-578, 11-595, 11-597, 11-598, 11-599, 11-600	01/01/91-07/31/97	Handle can break when the seat is used as an infant carrier causing the infant to fall to the ground be injured. Does not affect safety as car seat. Call 800-865-1419 for replacement handle.
264)	400XL	4400, 4434, 4436, 4446	4/85-2/86	Plastic shell may crack in crash. Call mfg. for repair info.
265)	400XL	4400, 4434, 4436, 4446	11/84-4/86	Shield. Call mfg. for repair info.
266)	5000 STE	4450, 4460, 4475	12/88-11/89	Buckle. Call mfg. for repair info.
267)	5000 STE	4450, 4460, 4470, 4475	5/90-6/90	Crash test failure of buckle. Call mfg. for repair info.
268)	5000 STE	4460, 4470, 4475, 4476, 4480, 4490	12/90-10/91	Incorrect labels on seat. Call mfg. for corrections
269)	5000 STE	4450, 4460, 4470, 4475, 4476	09/89-4/92	Buckle. Call mfg. for repair info.

Car Seat Recalls and Safety Notifications: MODELS 10 YEARS OLD AND OLDER

For the model numbers "x" = more numbers or letters follow

List No.	Manufacturer Model Name	Model # ("X" = more numbers or letters follow)	Mfg Date	Customer assistance Problem Type and Consumer Action
----------	-------------------------	------------------------------------------------	----------	------------------------------------------------------

Century Products (continued)

270)	5000 STE	4450, 4460, 4470, 4475,	Pre 91	Buckle instructions. Call mfg. for corrections.
271)	5500 STE	4480, 4490	01/91-4/92	Buckle. Call mfg. for repair info.
272)	580	4581, 4583, 4585	6/86-10/89	Screws for carry handle. Call mfg. for repair info.
273)	580	4580, 4581, 4583, 4585	7/86-12/89	Incorrect instructions. Call mfg. for corrections.
274)	Accel	45100, 45200, 45600, 45700	04/09/01- 05/10/01	Harness adjustment lock may allow webbing to slip during a serious crash when used in the forward facing mode for some models and lot codes. Call Century at 1-800-575-6097 for replacement info.
275)	Affinity Infant Seat	4575	9/95-5/96	Buckle. Call mfg. for repair info.
276)	Bravo	44622, 44630, 44631, 44662	04/09/01- 05/10/01	Harness adjustment lock may allow webbing to slip during a serious crash when used in the forward facing mode for some models and lot codes. Call Century at 1-800-575-6097 for replacement info.
277)	Bvererra Contour	4875	2/95-7/98	Product improvement campaign: Buckle for the harness can crack or break. Call mfg. for replacement information.
278)	Bvererra Premiere	4885	2/95-7/98	Product improvement campaign: Buckle for the harness can crack or break. Call mfg. for replacement information.
279)	Child Love Seat	4600	3/84-11/84	Plastic shell may develop cracks. Destroy & replace seat.
280)	Encore	44612, 4662	04/09/01- 05/10/01	Harness adjustment lock may allow webbing to slip during a serious crash when used in the forward facing mode for some models and lot codes. Call Century at 1-800-575-6097 for replacement info.
281)	Infant Car Seat	4535, 4560, 4565, 4590	9/95-5/96	Buckle. Call mfg. for repair info.
282)	Infant Car Seat	12-565, 4513, 4515, 4516, 4518, 4551, 4557, 4558, 4559, 4564, 4565, 4566, 4568, 4569, 4575, 4576, 4589, 4591, 4593, 4594, 4595, 4597	01/01/91- 07/31/97	Handle can break when the seat is used as an infant carrier causing the infant to fall to the ground be injured. Does not affect safety as car seat. Call 800-865-1419 for replacement handle.
283)	Infant Love seat	4500, 4510, 4520	1/81-12/82	Plastic shell may develop cracks. Destroy & replace seat.
284)	Smart Fit	4525	9/95-5/96	Buckle. Call mfg. for repair info.
285)	Smart Move	4750	11/95-2/96	Buckle. Call mfg. for repair info.
286)	Smart Move	44709	04/09/01- 05/10/01	Harness adjustment lock may allow webbing to slip during a serious crash when used in the forward facing mode for some models and lot codes. Call Century at 1-800-575-6097 for replacement info.

Chicco**800-807-8817 / 877-424-4226 - www.chiccousa.com**

287)	Key Fit Key Fit 30 Cortina Travel Systems BASES ONLY	All	02/26/08- 03/17/08	Recall applies only to <u>bases</u> manufactured between 2/26/2008 and 3/17/2008. When installed with LATCH, the webbing used to tighten the base can slip through the adjustment lock. Bases with serial number is between 08 02 26 (February 26, 2008) and 08 03 17 (March 17, 2008) are covered by this recall. Contact mfg. for replacement base. Install the base with the vehicle seat belts until replacement base is obtained.
------	------------------------------------------------------------------	-----	-----------------------	----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------

Car Seat Recalls and Safety Notifications: MODELS 10 YEARS OLD AND OLDER

For the model numbers "x" = more numbers or letters follow

List No.	Manufacturer Model # ("X" = more numbers or letters follow)	Customer assistance Mfg Date	Problem Type and Consumer Action
----------	-------------------------------------------------------------	------------------------------	----------------------------------

Chrysler**ALL MODELS OLDER THAN 10 YEARS - REPLACEMENT PROGRAM DISCONTINUED - DESTROY & REPLACE**

288)	Child Love Seat All	3/84-11/84	Plastic shell may develop cracks. Destroy & replace seat.
------	---------------------	------------	-----------------------------------------------------------

Collier-Keyworth**800-544-1108**

289)	Co-Pilot All	82-83	Shield. Call mfg. for repair info.
290)	Safe & Sound II All	12/84-4/85	Buckle. Call mfg. for repair info.
291)	Commuter All	10/87-02/88	Padding. Call mfg. for repair info.

Combi USA**800-992-6624 / 803-548-6633 - www.combi-intl.com**

292)	Avatar 8100	11/12/03-05/07/04	Lower latch anchorage does not meet dynamic test requirements of FMVSS 213. Contact mfg. for free in-home repair kit and instructions. Affected models should be installed with the vehicle seat belt. Do not use the seat with the latch until repairs are made.
293)	Centre ST 8065 Centre DX 8074 Centre EX 8086 Centre ARB 8520	10/19/05-12/15/07	The car seat could potentially become separated from its base in a crash. Mfg. recommends that the car seat be used without the base until it has been fixed. Contact mfg for free retrofit kit. Also affected are travel systems (# 4400, 4515, and 4520) that contain the Centre and Shuttle car seats.
294)	Coccoro 8220	01/06/09 - 12/05/12	Harness webbing fails to meet FMVSS-213 minimum breaking strength requirements. Contact mfg. for free harness replacement kit and instructions. The seats can continue to be used until the kits are made available and repairs are made.
295)	Shuttle 8087	10/19/05-12/15/07	The car seat could potentially become separated from its base in a crash. Mfg. recommends that the car seat be used without the base until it has been fixed. Contact mfg for free retrofit kit. Also affected are travel systems (# 4400, 4515, and 4520) that contain the Centre and Shuttle car seats.
296)	Zeus 360 8836	02/25/09 - 05/24/12	Harness webbing fails to meet FMVSS 213 minimum breaking strength requirements. Contact mfg. for free harness replacement kit and instructions. The seats can continue to be used until the kits are made available and repairs are made.
297)	Zeus Turn 8815	07/15/07 - 03/25/09	Harness webbing fails to meet FMVSS 213 minimum breaking strength requirements. Contact mfg. for free harness replacement kit and instructions. The seats can continue to be used until the kits are made available and repairs are made.

Compass Baby**888-899-2229 - www.compassbaby.com**

298)	Infant Car Seat I420 ARD I420 FUO I420 MAR	05/07/06, 05/13/06, and 05/15/06	The metal slide crotch anchor can become dislodged allowing excessive movement of the child and cracking of the plastic shell. This problem was discovered during testing by the manufacturer. There have been no reports of injuries and no calls from consumers regarding problems. Contact mfg. for free repair kit.
------	--------------------------------------------------	-------------------------------------------	-------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------

Cosco (Dorel)**Dorel Juvenile Group: 800-219-0509 / 866-611-3022 / 812-372-0141****Car Seat Recalls and Safety Notifications: MODELS 10 YEARS OLD AND OLDER**

For the model numbers "x" = more numbers or letters follow

List No.	Manufacturer Model Name	Model # ("X" = more numbers or letters follow)	Mfg Date	Customer assistance Problem Type and Consumer Action
299)	Alpha Omega	02-331, 02-332, 02-531, 02-533, 02-537, 02-555.	11/17/00-01/10/01	Tether webbing could be cut and separate in a crash allowing excessive movement of the child. Contact mfg. for free repair kit.
300)	Alpha Omega	02332, 02531, 02533, 02537, 02555	01/01/00-09/30/01	Tether webbing does not conform to abrasion requirements of FMVSS 213. Contact mfg. for free repair kit.
301)	Alpha Omega Alpha Omega Elite	22150, 22180, 22269 22155	11/01/03-12/31/05	There is a potential for the harness adjustment strap to loosen during use. Contact mfg. for free repair kit.
302)	Alpha Omega Elite	22154x, 22155x, 22158x	05/01/08-04/30/09	Harness locking and release button does not always return to its locked position and could result in a loose harness, increasing the risk of being injured a crash. Contact mfg. for repair kit.
303)	Alpha Omega All-N-1	22150x	05/01/08-04/30/09	Harness locking and release button does not always return to its locked position and could result in a loose harness, increasing the risk of being injured a crash. Contact mfg. for repair kit.
304)	Arriva	02-751	03/95-05/95	Buckle. Call mfg. for repair info.
305)	Arriva	02-729 TED	03/31/99-04/07/99	Airbag warning label is missing on seat pad. Fabric color noted by "TED" is only one affected. Call mfg. for replacement pad.
306)	Arriva	02-665, 02-727, 02-728, 02-729, 02-731, 02-732, 02-733, 02-750, 02-751, 02-755, 02-756, 02-757, 02-774	03/01/95-01/31/00	Handle locks can unexpectedly release when used as a carrier, causing the seat to flip forward. Does not affect safety as car seat. Call mfg. for repair info. [Note: a recall campaign initiated 06/25/03 added models made through 01/31/00 to a previous recall of those made through 09/97.]
307)	Infant Car Seat	22-300 CSF, 22-300 FZN, 22-300 JJV, 22-300 OSF, 22-300 THD, 22-300 TWD	01/06/08-04/06/09	The child restraint carry handle can loosen and come off posing a fall hazard to infants. The safety as a child restraint is not affected. Do not use handle until repaired. Contact mfg. for free repair kit. NOTE: Only those models sold as a part of the Spirit and Sprint Travel Systems are affected.
308)	Comfy Carry	IC123 FSM	05/01/11-04/25/12	Some models were sold without a base and therefore did not provide lower LATCH attachments as required by FMVSS 213. Carriers can safely be installed without the base using the seat belt. Contact mfg. to obtain a base.
309)	Commuter	02-086	11/87-2/88	Upholstery/padding. Call mfg. for repair info.
310)	Designer 22	22-300-JOS GB1B	08/19/03-10/20/04	Harness can loosen if not properly tightened. Contact mfg. for free repair kit. Parents should continue to use the seat while waiting to receive/install the repair kit but are advised to make sure that the seat is properly adjusted while in use. NOTE: Models involved were sold only as travel systems (with a stroller) and any line code other than GB1B in the model # is not included in the recall.
311)	Dream Ride	02-719 ARQ	01/89-01/94	Upholstery flammability. Call mfg. for repair info.
312)	DreamRide	22-001FSM	12/01/03-04/28/04	Failed to meet back support angle requirements of FMVSS 213. Discontinue rear-facing use and use only as a car bed or request free replacement rear-facing child restraint from DJG. Contact mfg. for warning label and information.
313)	Hi Back Booster	02409, 02442, 02443, 02445, 02448, 02449, 02450, 02480, 02495	01/01/00-09/30/01	Tether webbing does not conform to abrasion requirements of FMVSS 213. Contact mfg. for free repair kit.

Car Seat Recalls and Safety Notifications: MODELS 10 YEARS OLD AND OLDER

For the model numbers "x" = more numbers or letters follow

List No.	Manufacturer Model # ("X" = more numbers or letters follow)	Customer assistance Mfg Date	Problem Type and Consumer Action
----------	-------------------------------------------------------------	------------------------------	----------------------------------

Cosco (Dorel) (continued)

314)	Hi Back Booster	02442, 02443, 02448, 93443, 93514	03/15/02-08/01/02	UV stabilizer in harness webbing does not conform to requirements of FMVSS 213. Contact mfg. for free repair kit.
315)	High Rise Booster	22-297, 22-298, 22-299	10/01/03-10/31/03	Incorrect warning label stating it is for use forward facing for children under one year of age rather than OVER one year of age. Contact mfg. for free replacement label and instructions.
316)	Luxury Soft Shield Auto Trac	02-790, 02-890	10/89-6/90	Crash test failure. Call mfg. for repair info.
317)	Regal Ride	22139MON	09/28/04-09/20/07	Elastic straps on padding can come loose and become accessible to the child allowing the child to loop the elastic strap around portions of his/her body. Contact mfg. for repair kit.
318)	Safe-T-Shield	81A or B, 181A or B	10/80-6/83	Shield. Call mfg. to replace seat.
319)	Safe-T-Mate		1984	Wrong instructions. Call mfg. for repair info.
320)	Safe and Easy	313	1/84-6/85	Plastic shell. Call mfg. for repair info.
321)	Safe and Snug	323, 423	1/84-6/85	Plastic shell. Call mfg. for repair info.
322)	Sidekick Booster	244x	04/96-5/97	Crash test failure of shield. Use only as belt-positioning booster. Call mfg. for refund info.
323)	Soft Shield	02-090	10/89-6/90	Crash test failure. Call mfg. for repair info.
324)	Soft Shield Auto Trac	02-290	10/89-6/90	Crash test failure. Call mfg. for repair info.
325)	Soft Shield Deluxe	02-190	10/89-6/90	Crash test failure. Call mfg. for repair info.
326)	Touriva	02-084	5/94-8/94	Buckle. Call mfg. for repair info.
327)	Touriva Shield	02-014-EMF, 02-014-GDM, 02-015-PDL	8/97 (Mold #3)	Crash test failure of shell in front-facing recline position. Call mfg. for repair info.
328)	Touriva 5-point	02-514-BWE, 02-584-OXF, 02-518-NDF	8/97 (Mold #3)	Crash test failure of shell in front-facing recline position. Call mfg. for repair info.
329)	Touriva T-Shield	02-084, 02-094, 02-096, 02-404, 02-821	5/96-11/97	Crash test failure of post-test release pressure standard for the buckle. Call mfg. for repair info.
330)	Touriva	02014, 02015, 02019, 02084, 02094, 02114, 02504, 02514, 02518, 02519, 02524, 02584, 02803, 02806, 02821, 02825, 02935, 93084, 93094, 93514	01/01/00-09/30/01	Tether webbing does not conform to abrasion requirements of FMVSS 213. Contact mfg. for free repair kit.
331)	Touriva	02514, 02519, 02524, 22100, 93446, 93504	03/15/02-08/01/02	UV stabilizer in harness webbing does not conform to requirements of FMVSS 213. Contact mfg. for free repair kit.

Car Seat Recalls and Safety Notifications: MODELS 10 YEARS OLD AND OLDER

For the model numbers "x" = more numbers or letters follow

List No.	Manufacturer Model Name	Model # ("X" = more numbers or letters follow)	Mfg Date	Customer assistance Problem Type and Consumer Action
----------	-------------------------	------------------------------------------------	----------	------------------------------------------------------

Cosco (Dorel) (continued)

332)	Touriva	22100x, 22111x, 22130x, 93100x, 93111x	09/28/04-0 9/20/07	Elastic straps on padding can come loose and become accessible to the child allowing the child to loop the elastic strap around portions of his/her body. Contact mfg. for repair kit.
333)	Trooper	219x, 224x, 225x, 229x	10/96-2/97	Crash test failure. Call mfg. for repair info.
334)	Turnabout	02-667, 02-753, 02-756, 02-758, 02-759, 02-760, 02-761, 02-762, 02-763, 02-764, 02-765, 02-770, 02-771, 02-772	03/01/95- 01/31/00	Handle locks can unexpectedly release when used as a carrier, causing the seat to flip forward. Does not affect safety as car seat. Call mfg. for repair info. [Note: a recall campaign initiated 06/25/03 added models made through 01/31/00 to a previous recall of those made through 09/97.]
335)	Voyager Infant Seat/Stroller	All	9/97-10/97	Potential dislodgement from stroller. Does not affect safety as car seat. Call mfg. for repair info.

Cyber**Distributed by Regal Lager: 800-593-5522 - www.regallager.com**

336)	Solution X-fix	0500200xx, 0500760xx	02/01/10- 02/28/10	Booster seats have an incorrect warning statement about restraining unoccupied seats. Contact mfg. for replacement sticker and owner's manual.
------	----------------	----------------------	-----------------------	------------------------------------------------------------------------------------------------------------------------------------------------

Disney (Dorel)**Dorel Juvenile Group: 866-623-3139 / 800-219-0509 / 866-611-3022 / 812-372-0141
www.djgusa.com**

337)	Infant Car Seat	22-305 NAB, 22-305 PPH, 22-355 LBF, 22-355 PWK, 22-627 AWF	01/06/08-0 4/06/09	The child restraint carry handle can loosen and come off posing a fall hazard to infants. The safety as a child restraint is not affected. Do not use handle until repaired. Contact mfg. for free repair kit. NOTE: Only those models sold as a part of the Propack Travel System are affected.
------	-----------------	------------------------------------------------------------------	-----------------------	--------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------

Downunder**ALL MODELS OLDER THAN 10 YEARS - NO LONGER IN BUSINESS -
DESTROY & REPLACE**

338)	Kangaroo Booster Seat	All (Pre- 1/98)		Safety improvement campaign: The shoulder belts may not be properly located when the child is placed in the restraint. The shoulder belt guides may not help achieve correct seat belt placement. Do not use this booster if the shoulder belt does not touch the child's chest.
------	-----------------------	-----------------	--	----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------

Eddie Bauer (Dorel)**Dorel Juvenile Group: 800-219-0509 / 866-611-3022 / 812-372-0141
www.djgusa.com**

339)	3-in-1	02-331, 02-332, 02-531, 02-533, 02-537, 02-555	11/17/00- 01/10/01	Tether webbing could be cut and separate in a crash allowing excessive movement of the child. Contact mfg. for free repair kit.
340)	3-in-1 Deluxe 3-in-1 Deluxe Convrt.	22740, 22750, 22755, 22756, 22757, 22770	11/01/03- 12/31/05	There is a potential for the harness adjustment strap to loosen during use. Contact mfg. for free repair kit.
341)	Alpha Omega Alpha Omega Elite	22750, 22755, 22756, 22757, 22770	11/01/03- 12/31/05	There is a potential for the harness adjustment strap to loosen during use. Contact mfg. for free repair kit.

Car Seat Recalls and Safety Notifications: MODELS 10 YEARS OLD AND OLDER

For the model numbers "x" = more numbers or letters follow

List No.	Manufacturer Model Name	Model # ("X" = more numbers or letters follow)	Mfg Date	Customer assistance Problem Type and Consumer Action
Eddie Bauer (Dorel) (continued)				
342)	Comfort Infant Seat	22630xxx, 22631xxx	07/26/05-02/28/06	Trim screws on handle can loosen resulting in a potential choking hazard. Contact mfg. at 877-229-1374 for free repair kit. Make sure the handle trim screws are tight and continue to use the existing seat while waiting to receive and install the repair kit. (The 22630 models are part of the 01726 Eddie Bauer Integrated Travel System.)
343)	Comfort Infant Seat	22630xxx, 22631xxx	07/26/05-02/28/06	Some consumers have experienced difficulty installing the base in certain vehicles. Dorel will replace the original version of the base at no charge to the customer. Contact mfg. at 877-229-1374 to determine eligibility for a replacement base.
344)	Deluxe 3-in-1	22755x, 22758x, 22759x, 22790x, 22799x	05/01/08-04/30/09	Harness locking and release button does not always return to its locked position and could result in a loose harness, increasing the risk of being injured a crash. Contact mfg. for repair kit.
345)	Deluxe 3-in-1	22790xxx, CC046xxx	07/20/10-05/18/11	The rear-facing belt path installation arrows are incorrect, possibly appearing to point toward the forward-facing vehicle belt path location. Contact mfg. for replacement label kit.
346)	Designer 22	22-625 xxx GB1B	08/19/03-10/20/04	Harness can loosen if not properly tightened. Contact mfg. for free repair kit. Parents should continue to use the seat while waiting to receive/install the repair kit but are advised to make sure that the seat is properly adjusted while in use. NOTE: Models involved were sold only as travel systems (with a stroller) and any line code other than GB1B in the model # is not included in the recall.
347)	Enspira	22740	11/01/03-12/31/05	There is a potential for the harness adjustment strap to loosen during use. Contact mfg. for free repair kit.
348)	Enspira	22740x, 22741x	05/01/08-04/30/09	Harness locking and release button does not always return to its locked position and could result in a loose harness, increasing the risk of being injured a crash. Contact mfg. for repair kit.
349)	Hi Back Booster	02409, 02442, 02443, 02445, 02448, 02449, 02450, 02480, 02495	01/01/00-09/30/01	Tether webbing does not conform to abrasion requirements of FMVSS 213. Contact mfg. for free repair kit.
350)	Infant Car Seat	22-627 CGT, 22-627 FRK, 22-627 KGS, 22-627 SNW, 22-627 WPR, 22-655 BYTE	01/06/08-04/06/09	The child restraint carry handle can loosen and come off posing a fall hazard to infants. The safety as a child restraint is not affected. Do not use handle until repaired. Contact mfg. for free repair kit. NOTE: Only those models sold as a part of the Adventurer and Endeavor Travel Systems are affected.
351)	Prospect Adjustable Hiback Booster	22880x	05/01/08-04/30/09	Harness locking and release button does not always return to its locked position and could result in a loose harness, increasing the risk of being injured a crash. Contact mfg. for repair kit.
352)	SureFit	22657x, IC072x	05/01/08-04/30/09	Harness locking and release button does not always return to its locked position and could result in a loose harness, increasing the risk of being injured a crash. Contact mfg. for repair kit.
353)	Touriva	02870, 02871, 02875	01/01/00-09/30/01	Tether webbing does not conform to abrasion requirements of FMVSS 213. Contact mfg. for free repair kit.

OLDER MODEL LIST

Car Seat Recalls and Safety Notifications: MODELS 10 YEARS OLD AND OLDER

For the model numbers "x" = more numbers or letters follow

List No.	Manufacturer Model # ("X" = more numbers or letters follow)	Customer assistance Mfg Date	Problem Type and Consumer Action
Evenflo		800-525-2472 / 800-233-5921	
354)	410	6/88-4/89	Harness/shield. Call mfg. for repair info.
355)	Bobby Mac Champion	4/85-4/90	Buckle. Call mfg. for repair info.
356)	Bobby Mac Deluxe	4/85-4/90	Buckle. Call mfg. for repair info.
357)	Booster Seat	2/87-8/88	Upholstery buttons. Call mfg. for repair info.
358)	Booster Seat	4/85-4/90	Buckle. Call mfg. for repair info.
359)	Champion	06/93- 11/96	Crash test failure. Call mfg. for repair info.
360)	Champion	06/93- 11/96	Crash test failure. Call mfg. for repair info.
361)	Champion	10/96-2/97	Crash test failure. Call mfg. for repair info.
362)	Cozy Carry	ALL (11/01/01- 08/31/02)	Upgrade Kit - Not a Recall: For owners of Cozy Carry infant car seats to improve the performance of the detachable base in certain types of collisions. The kit is only for detachable bases with the words "Cozy Carry" on them. Visit www.cozycarry.com or call 800-582-6698 for free kit.
363)	Discovery	Pre- 02/01/08	Voluntary Safety Recall - Testing showed that the car seat could potentially become separated from its base in high impact side collisions. Contact mfg. for free supplemental dual-hook fastener for enhanced safety performance.
364)	Discovery	02/04/08	A small number of Discovery car seats may have shipped without complete assembly of the red release handle located on the back of the seat making it possible for the seat to separate from its base. Contact mfg. for replacement seat and base. Affected models can be used without the base while waiting for replacement.
365)	Dyn-O-Mite	1/85-1/89	Crash test failure. Call mfg. for repair info.
366)	Dyn-O-Mite	4/85-4/90	Buckle. Call mfg. for repair info.
367)	Embrace	Pre- 04/08/06	When used as an infant carrier, the handle can unexpectedly release, causing the seat to rotate forward. Handle should not be used until the repair kit has been installed. Affected restraints can continue to be used as a car seat properly installed in a vehicle. Contact mfg. for a free repair kit.
368)	First Choice	01/16/09- 09/29/09	A label containing certain contact and certification information was inadvertently left off these car seats. Contact mfg. for a set of replacement labels.
369)	Infant Car Seat	Pre 04/89	Crash test failure. Call mfg. for repair info.
370)	Infant Car Seat	04/85- 04/90	Buckle. Call mfg. for repair info.
371)	Joyride	01/88- 12/98	When used as an infant carrier, the carry handle can unexpectedly release, cause the seat to flip forward, and cause infant to fall to the ground. Call mfg. for repair info.
372)	Maestro	11/24/09- 04/09/10*	A crack may form at the front of the seat adjacent to the harness adjuster in a crash. Evenflo recommends that the seat not be used with children < 40 pounds until repaired. Use as a booster for children > 40 pounds is OK. Call mfg. for free reinforcement kit. *Canadian seat 31011057C mfg dates: 12/17/09-04/26/10

Car Seat Recalls and Safety Notifications: MODELS 10 YEARS OLD AND OLDER

For the model numbers "x" = more numbers or letters follow

List No.	Manufacturer Model Name	Model # ("X" = more numbers or letters follow)	Mfg Date	Customer assistance Problem Type and Consumer Action
Evenflo (continued)				
373)	On My Way	Begins with 207, 492	12/95-07/97	When used as a carrier, the locking mechanism on the handle can slip, flipping the seat forward and tossing the baby on the ground. Call mfg. for repair info.
374)	On My Way	Begins with 200, 211, 447, 499	Pre-02/10/00	Safety Notification: Alignment posts in base can become bent after repeated use. Contact mfg. for free upgrade kit.
375)	On My Way base	639001, 639002	Pre-02/10/00	Safety Notification: Alignment posts in base can become bent after repeated use. Contact mfg. for free upgrade kit.
376)	One-Step	221, 401 thru 409	04/85-04/90	Buckle. Call mfg. for repair info.
377)	One-Step Deluxe	222, 223, 4176	04/85-04/90	Buckle. Call mfg. for repair info.
378)	Scout	229x	06/93-12/96	Crash test failure. Call mfg. for repair info.
379)	Scout	219x, 224x, 225x, 229x	10/96-02/97	Crash test failure. Call mfg. for repair info.
380)	Seven Year Seat	453, 454	02/87-08/88	Upholstery buttons. Call mfg. for repair info.
381)	Seven Year Seat	228, 453, 454	04/85-04/90	Buckle. Call mfg. for repair info.
382)	Snugli Embrace 35	30711365	06/01/12-11/30/12	The harness buckle may become resistant to unlatching over time so that it cannot be opened by pushing the release button, thus making it difficult to remove the child from the restraint in an emergency. Contact mfg. for a free repair kit.
383)	Travel Tandem (Joyride + base)	205x	01/88-03/96	Test failure with base. Use without base and call mfg. for repair info.
384)	Travel Tandem (Joyride + base)	205x, 210x	01/88-12/98	When used as an infant carrier, the carry handle can unexpectedly release, cause the seat to flip forward, and cause infant to fall to the ground. Call mfg. for repair info.
385)	Tribute	378x, 379x	09/08/05-09/22/05	Certain areas of the plastic shell may be prone to stress fractures. Call mfg. to receive a replacement seat.
386)	Triumph	264x	10/20/01-01/31/02	Slide loop connectors in the harness may not be strong enough to fully secure the child in a crash. Call mfg. for repair kit.
387)	Triumph	264x, 359x, 389x	09/06/01-10/31/05	Portions of the cloth cover can be pulled back exposing the foam liner in an area that is reachable by a child occupant. A child inside the seat may break off and potentially choke on a piece of the foam liner. Contact mfg. for repair kit.
388)	Trooper (shield)	21940, 219164, 219180, 219186, 219188	11/95-1/96	Instructions. Call mfg. for new instructions
389)	Two-in-One	636x, 637x	1/98-3/98	In crash tests, the seat's backrest and base have separated when 5-point harness was being used. Call mfg. for information and replacement seat.
390)	Ultara 1	420	9/88-7/89	Buckle. Call mfg. for repair info.
391)	Ultara 1	231	2/93-8/93	Plastic sleeve on harness. Call mfg. for repair info.
392)	Ultara II	227	1/90-6/90	Crash test failure. Call mfg. for repair info.

Car Seat Recalls and Safety Notifications: MODELS 10 YEARS OLD AND OLDER

For the model numbers "x" = more numbers or letters follow

List No.	Manufacturer Model # ("X" = more numbers or letters follow)	Customer assistance Mfg Date	Problem Type and Consumer Action
----------	-------------------------------------------------------------	------------------------------	----------------------------------

Evenflo (continued)

393)	Ultara II 232	2/93-8/93	Plastic sleeve on harness. Call mfg. for repair info.
------	---------------	-----------	-------------------------------------------------------

Fisher Price**ALL MODELS OLDER THAN 10 YEARS - DESTROY & REPLACE**

394)	Car Seat 9100	Pre-1987	Harness/shield. Call mfg. for repair info.
395)	Car Seat 9100, 9101	4/85-1/89	Upholstery. Call mfg. for repair info.
396)	Car Seat 9100, 9101	2/90-3/90	Buckle. Call mfg. for repair info.
397)	Car Seat 9100	4/85-8/85	Shield. Call mfg. for repair info.
398)	Car Seat 9100, 9101	5/87-1/89	Buckle. Call mfg. for repair info.
399)	Car Seat 9100, 9101	2/89-11/89	Buckle (extended 5/87-1/89). Call mfg. for repair info.
400)	Car Seat 9100, 9101	Pre 91	Loose button. Call mfg. for repair info.
401)	Car Seat 9100, 9101	2/91-1/92	Harness/shield. Call mfg. for repair info.
402)	Car Seat 9100, 9101	Pre 7/89	Label on shield. Call mfg. for repair info.
403)	Delux Car Seat 9104	6/15-9/92	Buckle. Call mfg. for repair info.

Fisher Price (continued)

404)	Infant Seat 9149	1/91-2/91	Shield. Call mfg. for repair info.
405)	Infant Seat 9173	9/94-10-94	Air bag label. Call mfg. for repair info.
406)	Booster 9104	4/92-9/92	Buckle. Call mfg. for repair info.
407)	Booster 9104	4/92-9/92	Buckle. Call mfg. for repair info.
408)	Safe Embrace 79700	5/97-3/98	Harness adjuster. Call mfg. for repair info.

Ford**ALL MODELS OLDER THAN 10 YEARS - REPLACEMENT PROGRAM DISCONTINUED - DESTROY & REPLACE**

409)	Infant Love Seat All	81/82	Plastic shell may develop cracks. Destroy & replace seat.
------	----------------------	-------	-----------------------------------------------------------

General Motors**ALL MODELS OLDER THAN 10 YEARS - REPLACEMENT PROGRAM DISCONTINUED - DESTROY & REPLACE**

410)	Infant Love Seat All	81/82	Plastic shell may develop cracks. Destroy & replace seat.
411)	Child Love Seat All	3/84-11/84	Plastic shell may develop cracks. Destroy & replace seat.

Gerry**Contact Evenflo: 800-525-2472 / 800-233-5921**

412)	Guardian All	01/90-05/90	Buckle. Call mfg. for repair info.
413)	Secure Ride 626	08/94-03-95	Air bag label. Call mfg. for new label

Car Seat Recalls and Safety Notifications: MODELS 10 YEARS OLD AND OLDER

For the model numbers "x" = more numbers or letters follow

List No.	Manufacturer Model Name	Model # ("X" = more numbers or letters follow)	Mfg Date	Customer assistance Problem Type and Consumer Action
Graco		800-345-4109 / www.gracobaby.com		
414)	Aprica A30	All Models	07/01/11-04/30/12	The harness buckle may become stuck so that it cannot be opened by pushing the release button, thus making it difficult to remove the child from the restraint in an emergency. Contact mfg. for replacement buckle.
415)	CarGo	8487x, 8686x, 8689x, 8D01x, 8D02x, 8D03x, 8D04x, 8D05x, 8D10x	01/09/07-03/03/08	An incorrect NHTSA Hotline telephone number appears on an information label affixed to the back of the seat. Contact mfg. for a replacement label.
416)	ComfortSport	8629x, 8630x, 8631x, 8632x, 8635x, 8639x, 8C00x, 8C01x, 8C02x, 8C03x, 8C04x, 8433x	01/02/07-07/31/07	Lower Anchorage belt may have been misrouted during assembly process. Use the vehicle seatbelt instead of LATCH to install affected models in the rear-facing position until it is inspected and, if necessary, corrected. Call mfg. or visit gracobaby.com website for additional info.
417)	ComfortSport	8C02MRC2	10/22/07	Seats were produced with foam thicker than specified and tested 1" thick foam. It is unclear as to what impact thicker foam will have on child seat safety. Call mfg. for seat replacement information.
418)	ComfortSport	8C04FRR, 8C04FRR2	11/01/06-10/08/07	Seats were equipped with a large supplemental "body pillow" that partially obscures the child airbag warning label on the seat pad. Graco will instruct users to discard the supplemental pillows since they are provided for comfort only. Contact mfg. for additional information.
419)	Cozy Cline	All Models	01/01/06-04/30/10	The harness buckle may become stuck so that it cannot be opened by pushing the release button, thus making it difficult to remove the child from the restraint in an emergency. Contact mfg. for replacement buckle.
420)	GT 1000	All	1/85-1/86	Crash test failure. Call mfg. for repair info.
421)	SafeSeat - Step 2	All Models	01/01/06-04/30/10	The harness buckle may become stuck so that it cannot be opened by pushing the release button, thus making it difficult to remove the child from the restraint in an emergency. Contact mfg. for replacement buckle.
422)	SnugRide	7493, 7497, 7499, 841101, 841102, 841103, 841203, 8412T02, 8457, 8458, 8459, 8460, 8462, 8471, 8472, 8473, 8474, 8476, 8477, 8478	08/31/99-02/28/02	May be missing 1 or 2 metal hooks and their retainer pins on the base of the carrier shell or the "U" shaped bars on the carrier shell that are used to attach the carrier to the base. If the hooks, pins or "U" bars are missing, the carrier may not be securely attached to the base and the carrier could detach from the base in the event of a sudden stop or crash. Call Graco to receive a free replacement seat or base. NOTE: All affected model numbers may also begin with the letter "A" and/or also be followed by letters.
423)	SnugRide	8402, 8402L, 8403x, 8412, 8442x, 8443, 8443L, 8444, 8444L, 8446, 8446L, 8447, 8447L, 8448, 8448L, 8457, 8458, 8459, 8463x, 8464, 8470, 8471, 8478, 8601, 8602x, 8603M, 8605x, 8607x, 8608D, C844342	03/01/02-03/08/03	May have missing hardware used to attach the carrier to the base. Contact mfg. at 866-473-0163 or www.gracobaby.com for inspection and repair information. All models can safely be installed without the base. [NOTE: The initial 03/12/03 recall campaign for this problem included models manufactured through 03/06/03. A recall extension announced 08/13/03 added models manufactured through 03/08/03.]
424)	SnugRide	8609x, 8616x, 8643x, 8645x, 8646x	08/01/06-06/30/07	The backing of the seat pad may pull away from the seams in an area reachable to the child occupant, exposing the pad filling and posing a potential choking hazard. Contact mfg. For repair kit.

Car Seat Recalls and Safety Notifications: MODELS 10 YEARS OLD AND OLDER

For the model numbers "x" = more numbers or letters follow

List No.	Manufacturer Model Name	Model # ("X" = more numbers or letters follow)	Mfg Date	Customer assistance Problem Type and Consumer Action
----------	-------------------------	------------------------------------------------	----------	------------------------------------------------------

Graco (continued)

425)	SnugRide 30 SnugRide Classic Connect 30	All Models	07/01/10- 01/31/13	The harness buckle may become stuck so that it cannot be opened by pushing the release button, thus making it difficult to remove the child from the restraint in an emergency. Contact mfg. for replacement buckle.
426)	SnugRide 35 SnugRide Classic Connect 35	All Models	05/01/11- 01/31/13	The harness buckle may become stuck so that it cannot be opened by pushing the release button, thus making it difficult to remove the child from the restraint in an emergency. Contact mfg. for replacement buckle.
427)	SnugRide Click Connect 40	All Models	06/01/12- 12/31/12	The harness buckle may become stuck so that it cannot be opened by pushing the release button, thus making it difficult to remove the child from the restraint in an emergency. Contact mfg. for replacement buckle.

International**ALL MODELS OLDER THAN 10 YEARS - NO LONGER IN BUSINESS - DESTROY & REPLACE**

428)	Astroseat	All	12/80-7/81	Buckle. Destroy & replace seat.
------	-----------	-----	------------	---------------------------------

Kolcraft**ALL MODELS OLDER THAN 10 YEARS - NO LONGER IN BUSINESS - DESTROY & REPLACE**

429)	Automate	180-600, 180-601	Pre 4/93	Buckle. Call mfg. for repair info.
430)	Carter Travel 5	13833, 13842, 13852	5/96-9/96	Crash test failure of buckle. Call mfg. for repair info.
431)	Dial-A-Fit	180-200, 180-300	1/87-8/89	Upholstery clips. Call mfg. for repair info.
432)	Dial-A-Fit	180-200, 180-300	10/88-8/89	Crash test failure. Call mfg. for repair info.
433)	Dial-A-Fit II	180-600	11/90-8/91	Crash test failure. Call mfg. for repair info.
434)	Infant Car Seat	1383x	1/93-6/99	Carrier handle can release and allow the seat to rotate. Does not affect safety as car seat. Call mfg. for repair info.
435)	Infant Restraint	43xxx	1/93-6/99	Carrier handle can release and allow the seat to rotate. Does not affect safety as car seat. Call mfg. for repair info.
436)	Infant Rider	138xx, 368xx	3/96-8/96	Crash test failure of buckle. Call mfg. for repair info.
437)	Infant Rider	1312x, 1382x, 1383x, 368xx	1/93-6/99	Carrier handle can release and allow the seat to rotate. Does not affect safety as car seat. Call mfg. for repair info.
438)	Flip 'N' Go	19127 thru 19130	1/85-3/87	Shield. Call mfg. for repair info.
439)	Flip 'N' Go II	19127	1/85-3/88	Shield. Call mfg. for repair info.
440)	Perfect Fitt	180-100, 180-150	Pre 4/90	Upholstery clips. Call mfg. for repair info.
441)	Perfect Fitt	180-150, 180-200	3/89-10/90	Crash test failure. Call mfg. for repair info.
442)	Perfect Fitt	180-200	Pre 10/90	Upholstery. Call mfg. for repair info.
443)	Performa	All	3/96-10-96	Upholstery. Call mfg. for repair info.
444)	Performa	All	1/96-7/97	Buckle release force. Call mfg. for repair info.
445)	Playskool Car Seat	140-155, 180-400	12/89-8/90	Upholstery. Call mfg. for repair info.
446)	Playskool Car Seat	77001, 77002	1/91-6/93	Buckle. Call mfg. for repair info.

Car Seat Recalls and Safety Notifications: MODELS 10 YEARS OLD AND OLDER

For the model numbers "x" = more numbers or letters follow

List No.	Manufacturer Model # ("X" = more numbers or letters follow)	Customer assistance Mfg Date	Problem Type and Consumer Action
----------	-------------------------------------------------------------	------------------------------	----------------------------------

Kolcraft (continued)

447)	Playskool Infant Car Seat	77005, 77007	1/93-6/99	Carrier handle can release and allow the seat to rotate. Does not affect safety as car seat. Call mfg. for repair info.
448)	Plus 4	138xx, 368xx	3/96-8/96	Crash test failure of buckle. Call mfg. for repair info.
449)	Plus 4	1382x, 1383x, 1384x, 368xx	1/93-6/99	Carrier handle can release and allow the seat to rotate. Does not affect safety as car seat. Call mfg. for repair info.
450)	Plus 5	138xx, 368xx	3/96-8/96	Crash test failure of buckle. Call mfg. for repair info.
451)	Plus 5	13833, 13842, 13852	5/96-9/96	Crash test failure of buckle. Call mfg. for repair info.
452)	Plus 5	1382x, 1383x, 1384x, 1385x, 368xx	1/93-6/99	Carrier handle can release and allow the seat to rotate. Does not affect safety as car seat. Call mfg. for repair info.
453)	Rock 'N' Ride	13123	2/85-6/85	Plastic shell. Call mfg. to replace seat.
454)	Rock 'N' Ride	131-101	Pre 3/90	Upholstery clips. Call mfg. for repair info.
455)	Secura	43xxx	1/93-6/99	Carrier handle can release and allow the seat to rotate. Does not affect safety as car seat. Call mfg. for repair info.
456)	Secure Fit	All	1/96-7/97	Buckle release force. Call mfg. for repair info.
457)	Travel About	138xx, 368xx	3/96-8/96	Crash test failure of buckle. Call mfg. for repair info.
458)	Travel About	13833, 13842, 13852	5/96-9/96	Crash test failure of buckle. Call mfg. for repair info.
459)	Travel-About	1382x, 1383x, 1384x, 1385x	1/93-6/99	Carrier handle can release and allow the seat to rotate. Does not affect safety as car seat. Call mfg. for repair info.
460)	Traveler 700	All	11/01/94-12/31/95	Voluntary action: Buckle concerns. Call mfg. for repair info.
461)	Traveler 700	150-100	1/91-8/91	Cracks in plastic. Call mfg. to replace seat.
462)	Traveler 700	All	1/91-6/93	Rusting of buckle. Call mfg. for repair info.

Lin Lih/MCP Ent.**ALL MODELS OLDER THAN 10 YEARS - REPLACEMENT PROGRAM DISCONTINUED - DESTROY & REPLACE**

463)	Lin Lih	All	ALL	Counterfeit seat. Call NHTSA: 800-424-9393
464)	Lin Lih	180-200, 180-300	10/88-8/89	Crash test failure. Call NHTSA: 800-424-9394

Maxi-Cosi (Dorel)**Dorel Juvenile Group: 866-623-3139 / 800-219-0509 / 866-611-3022 / 812-372-0141 www.djgusa.com**

465)	Mico	22-371, 22-372	07/01/07-	Attachment difficulties between the infant carrier and the base may lead to the carrier being improperly mounted to the base. Contact mfg. for replacement base.
	Mico (base)	22-515	02/17/08	
466)	Mico	22-371 HFL, 22-371 JUC, 22-371 LMD, 22-371 ORE,	02/18/08-	Attachment difficulties between the infant carrier and the base may lead to the carrier being improperly mounted to the base. Contact mfg. for repair kit. NOTE: This is an extension of an earlier recall.
	Mico (base)	22-371 PNG, 22-372 TTH 22-515 BLK	06/28/08	
467)	Mico	22371x, 22372x	05/01/08-04/30/09	Harness locking and release button does not always return to its locked position and could result in a loose harness, increasing the risk of being injured a crash. Contact mfg. for repair kit.

Car Seat Recalls and Safety Notifications: MODELS 10 YEARS OLD AND OLDER

For the model numbers "x" = more numbers or letters follow

List No.	Manufacturer Model # ("X" = more numbers or letters follow)	Mfg Date	Customer assistance Problem Type and Consumer Action
Maxi-Cosi (Dorel) (continued)			
468)	Priori 22476x, 22486x	05/01/08-04/30/09	Harness locking and release button does not always return to its locked position and could result in a loose harness, increasing the risk of being injured a crash. Contact mfg. for repair kit.
Mia Moda		866-642-6632 - www.miamodainc.com	
469)	Viva 5000 (seat), 5001 (base)	12/19/06-02/06/07	The lower anchor connector adjuster assembly may interfere with the connection of the infant carrier to the restraint base when installed using LATCH. Installation with seat belt is not affected. In addition, registration cards were not provided with the Viva or separately sold bases. Contact mfg. For repair kit and to register CR with mfg.
470)	Viva 5000 (seat), 5001 (base), 5050 (seat), 5051 (base), Viva Supreme 5070 (seat), 5071 (base), 5080 (seat), 5081 (base)	12/01/06-05/31/09	Sharp edges on the harness splitter plate can cut the harness. Also, the base could crack in a crash. Contact mfg. at 877-546-8437 for a full refund. <u>Mia Moda is urging parents/caregivers to discontinue use of the seat until it can be replaced.</u> According to Lerado/Mia Moda, there have been no injuries reported due to these problems and this is a voluntary precaution they are taking.
Mercedes-Benz USA		800-367-6372 - www.mbusa.com	
471)	Booster BQ6910157, BQ6910163	02/01/97-07/31/99	BabySmart airbag deactivation device may not automatically deactivate the passenger airbag. Contact mfg. for free replacement seat and instructional video.
472)	Infant Restraint BQ6910155	02/01/97-07/31/99	BabySmart airbag deactivation device may not automatically deactivate the passenger airbag. Contact mfg. for free replacement seat and instructional video.
473)	Kiddy TopSafe (mfg. by Sicartex) B66868203 B66868204 B66868209	03/01/03-11/30/03	Lower LATCH attachment may not be strong enough to hold in the event of a crash. Immediately replace with another model and return Kiddy Top seat to Mercedes-Benz dealer for refund. Install with vehicle seat belt until replacement is obtained. Contact Mercedes-Benz for further information.
Peg Perego USA		877-737-3468 / 219-482-8191 - www.perego.com	
474)	Jacadi IMCB00JA57RJ31JU31	07/01/07-03/14/08	The plastic adjustment cover of affected models could have exposed sharp edges that could cause cuts, scratches, or abrasions on the feet or legs of bare-footed infants. Does not affect safety as car seat. Contact mfg. for a free repair kit.
475)	Primo Viaggio CS00MU1, CS00US1, CS00US8	02/01/01-06/10/01	The latch mechanism securing the seat to the base does not completely engage on a small number of seats due to improper positioning of the metal reinforcement bracket. Call mfg. for repair info. Note: Primo Viaggio infant seat sold separately and with strollers as part of Pliiko and Primo Viaggio Travel Systems.
476)	Primo Viaggio CS00MU1, CS00US1, CS00US8, LV34USL, LV34USN, LN34S09, LN34S10, ST33USL, ST33USN, ST38USL, ST38USN, AL33USL, AL33USN, AL34USN, AL34USL	05/20/01-02/15/02	The harness adjustment/locking mechanism may not fully lock and allow the harness to slip. The strap tension adjuster cover of affected models have a red circle around a dark button. Contact mfg. for full identification and repair information. Note: Primo Viaggio infant seat sold separately and with strollers as a part of Pliiko, Primo Viaggio, and Atlantico Travel Systems.

Car Seat Recalls and Safety Notifications: MODELS 10 YEARS OLD AND OLDER

For the model numbers "x" = more numbers or letters follow

List No.	Manufacturer Model Name	Model # ("X" = more numbers or letters follow)	Mfg Date	Customer assistance Problem Type and Consumer Action
----------	-------------------------	------------------------------------------------	----------	------------------------------------------------------

Peg Perego USA (continued)

477)	Primo Viaggio SIP 30/30	32MD41KN41, 35CR13BU13, 35CR13PL46, 35CR24BU24, 35TL49KN53, 35TL53KN46, 61FG13ST53, 61FG53ST49, 61FG53ST64, 61ST13IC53, 61ST34IC53, 61ST48IC53	07/01/07-0 3/14/08	The plastic adjustment cover of affected models could have exposed sharp edges that could cause cuts, scratches, or abrasions on the feet or legs of bare-footed infants. Does not affect safety as car seat. Contact mfg. For a free repair kit. Note: Affected model numbers begin with IMUN00US.
------	-------------------------	------------------------------------------------------------------------------------------------------------------------------------------------	-----------------------	-----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------

Playskool**Contact Kolcraft: 800-453-7673**

478)	Car Seat	140-155, 180-400	12/89-8/90	Upholstery. Call Kolcraft
479)	Car Seat	77001, 77002	1/91-6/93	Buckle. Call Kolcraft
480)	Infant Car Seat	77005, 77007	1/93-6/99	Carrier handle can release and allow the seat to rotate. Does not affect safety as car seat. Call mfg. for repair info.

Pride Trimble/Virco**800-521-5198**

481)	Click-n-Go	890, 891, 892	2/86-10/87	Crash test failure. Call mfg. to replace seat.
482)	Click-n-Go	890, 891, 892	1/88-4/89	Crash test failure. Call mfg. to replace seat.
483)	Pride Ride	832	1/88-4/89	Crash test failure. Call mfg. to replace seat.

Questor**Contact Evenflo: 800-233-5921**

484)	Kantwet Car Seat	All	5/69-3/73	May pinch child's fingers. Call mfg. for repair info.
------	------------------	-----	-----------	-------------------------------------------------------

Recaro**888-973-2276 / 800-873-2276 / 248-364-3818/ - www.recaropromotion.com**

485)	Como	331.00.xxx	Pre-09/17/07	Consumer Advisory - Not a Recall: Lap and shoulder belt guide (previously referred to as "lock-off") may not hold belt webbing snugly enough to prevent belt from loosening. Contact mfg. for locking clip and instructions included as a part of the consumer advisory.
486)	Como	331.00.xxx	Pre-12/18/07	The harness may become disconnected from the harness connector when a child is placed in or removed from the child seat. Contact mfg. for repair kit.
487)	Como	331.00.xxx, 331.01.xxx	11/01/07-02/16/09	The front harness adjuster strap may slip within the adjuster/lock that controls tightness of the harness and may prevent the harness from staying properly tight. Contact mfg. for free replacement seat. NOTE: Models with a green dot above the bar code on the model # sticker are OK to use.
488)	ProSport	385.01.xxxx	06/16/10-01/31/13	When the affected child seats are installed with the LATCH lower anchors only (without the top tether), the child's head can move too much, increasing the risk of injury in a crash. Contact mfg. for replacement labels and complete set of new instructions informing owners to discontinue use of the LATCH system when the weight of the child reaches 40 pounds.
489)	Signo	331.00.xxx	Pre-12/18/07	The harness may become disconnected from the harness connector when a child is placed in or removed from the child seat. Contact mfg. for repair kit.

Car Seat Recalls and Safety Notifications: MODELS 10 YEARS OLD AND OLDER

For the model numbers "x" = more numbers or letters follow

List No.	Manufacturer Model # ("X" = more numbers or letters follow)	Mfg Date	Customer assistance Problem Type and Consumer Action
----------	-------------------------------------------------------------	----------	------------------------------------------------------

Recaro (continued)

490)	Signo	330.00.xxx, 330.01.xxx	11/01/07-02/16/09	The front harness adjuster strap may slip within the adjuster/lock that controls tightness of the harness and may prevent the harness from staying properly tight. Contact mfg. for free replacement seat. NOTES: This date range is an expansion of the initial date range (02/01/08-09/30/08) for this recall. Models with a green dot above the bar code on the model # sticker are OK to use.
------	-------	------------------------	-------------------	---------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------

Renolux (FBS)**ALL MODELS OLDER THAN 10 YEARS - NO LONGER IN BUSINESS - DESTROY & REPLACE**

491)	GT 1000	All	8/88-10/88	Buckle/recline angle. Destroy & replace seat.
492)	GT 2000	All	8/88-10/88	Buckle/recline angle. Destroy & replace seat.
493)	GT 2000	All	1/92-1/93	Foam padding failed HIC (head injury) limits. Destroy & replace seat.
494)	GT 2000	All	5/89-6/93	Flammability of upholstery. Destroy & replace seat.
495)	GT 4000	All	1/92-1/93	Foam padding failed HIC (head injury) limits. Destroy & replace seat.
496)	GT 4000	All	5/89-6-93	Flammability of upholstery. Destroy & replace seat.
497)	GT 5000	All	1/92-1/93	Foam padding failed HIC (head injury) limits. Destroy & replace seat.
498)	GT 5000	All	5/89-6-93	Flammability of upholstery. Destroy & replace seat.
499)	GT 5000 Turn A Tot	All	2/90-4/91	Test failure/upholstery. Destroy & replace seat.
500)	GT 5000 Turn A Tot	All	1/92-1/93	Foam padding failed HIC (head injury) limits. Destroy & replace seat.
501)	GT 5000 Turn A Tot	All	5/89-6-93	Flammability of upholstery. Destroy & replace seat.
502)	GT 5500	All	1/92-1/93	Foam padding failed HIC (head injury) limits. Destroy & replace seat.
503)	GT 5500	All	5/89-6-93	Flammability of upholstery. Destroy & replace seat.
504)	GT 7000	All	All	Remote may overheat/ fire hazard. Destroy & replace seat.
505)	GT 7000	All	1/92-1/93	Foam padding failed HIC (head injury) limits. Destroy & replace seat.
506)	GT 7000	All	5/89-6-93	Flammability of upholstery. Destroy & replace seat.

Safeline Kids**800-829-1625 - www.tripleplayproducts.com**

507)	Sit'n'Stroll	3240	6/9/97-8/9/97	Air bag labels. The air bag warning label was omitted from the seat cover. Contact Mfg. for new seat cover that has the required air bag warning label.
508)	Sit'n'Stroll	3240	11/1/96-6/30/99	Labels recommend use rear-facing for children up to 25 pounds. Contact Mfg. for new labels to be placed over the existing labels. New labels recommend use rear-facing for children up to 22 pounds.
509)	Sit'n'Stroll	2240	04/01/01-10/01/01	The FAA certification statement on label is in yellow lettering instead of the required RED lettering. Flight attendants may not allow its use on an airplane. Contact mfg. for replacement label.
510)	Sit'n'Stroll	2003	09/01/02-10/21/03	Child's head may move too far forward in a crash when lower forward-facing belt path or shoulder and buckle pads are used. Remove and discard shoulder and buckle pads and use upper forward-facing belt path only. Contact mfg. for revised instructions and labels.

Car Seat Recalls and Safety Notifications: MODELS 10 YEARS OLD AND OLDER

For the model numbers "x" = more numbers or letters follow

List No.	Manufacturer Model Name	Model # ("X" = more numbers or letters follow)	Mfg Date	Customer assistance Problem Type and Consumer Action
----------	-------------------------	------------------------------------------------	----------	------------------------------------------------------

Safety 1st (Dorel)

Dorel Juvenile Group: 866-623-3139 / 800-219-0509 / 866-611-3022 / 812-372-0141
www.djgusa.com

511)	Alpha Elite	All Models	11/01/03-12/31/05	There is a potential for the harness adjustment strap to loosen during use. Contact mfg. for free repair kit.
512)	Alpha Omega Alpha Omega Elite	22151 22455	11/01/03-12/31/05	There is a potential for the harness adjustment strap to loosen during use. Contact mfg. for free repair kit.
513)	Alpha Omega All-N-1 Alpha Omega Elite	22152x, 22159x, 22172x, 22177x, 22178x, 22185x, 22188x, 22195x, 22412x, 22456x, 22465x, 22469x	05/01/08-04/30/09	Harness locking and release button does not always return to its locked position and could result in a loose harness, increasing the risk of being injured a crash. Contact mfg. for repair kit.
514)	Alpha Omega Elite	22187xxx, 22465xxx, CC033xxx, CC046xxx	07/20/10-05/18/11	The rear-facing belt path installation arrows are incorrect, possibly appearing to point toward the forward-facing vehicle belt path location. Contact mfg. for replacement label kit.
515)	Alpha Sport	All Models	11/01/03-12/31/05	There is a potential for the harness adjustment strap to loosen during use. Contact mfg. for free repair kit.
516)	Avenue	22439x, 22449x	05/01/08-04/30/09	Harness locking and release button does not always return to its locked position and could result in a loose harness, increasing the risk of being injured a crash. Contact mfg. for repair kit.
517)	Complete Air LX Complete Air SE	CC050xxx CC051xxx	07/20/10-05/18/11	The rear-facing belt path installation arrows are incorrect, possibly appearing to point toward the forward-facing vehicle belt path location. Contact mfg. for replacement label kit.
518)	Designer 22	02-621-SAL, 02-620-xxx	01/03/02-02/13/02	Plastic handle can unexpectedly release from the carrying position when used as a carrier. Does not affect safety as a child restraint. Contact mfg. for repair kit.
519)	Designer 22	22-325 xxx GB1B	08/19/03-10/20/04	Harness can loosen if not properly tightened. Contact mfg. for free repair kit. Parents should continue to use the seat while waiting to receive/install the repair kit but are advised to make sure that the seat is properly adjusted while in use. NOTE: Models involved were sold only as travel systems (with a stroller) and any line code other than GB1B in the model # is not included in the recall.
520)	Enspira	22450, 22451, 22452, 22453, 22480, 22481	11/01/03-12/31/05	There is a potential for the harness adjustment strap to loosen during use. Contact mfg. for free repair kit.
521)	Enspira	22453x	05/01/08-04/30/09	Harness locking and release button does not always return to its locked position and could result in a loose harness, increasing the risk of being injured a crash. Contact mfg. for repair kit.
522)	Infant Car Seat	22-057 CLN, 22-057 DBY, 22-057 HRT, 22-057 LPH, 22-085 DWA, 22-085 LYN, 22-095 RBK, 22-322 HRR, 22-322 KDL, 22-322 LXI, 22-322 MAI, 22-322 OLY, 22-322 PRS, 22-322 PTK, 22-325 COB, 22-325 PAC, 22-380 LGA, 22-380 MSA, 22-627 WAV	01/06/08-04/06/09	The child restraint carry handle can loosen and come off posing a fall hazard to infants. The safety as a child restraint is not affected. Do not use handle until repaired. Contact mfg. for free repair kit. NOTE: Only those models sold as a part of the Eurostar, Explorer, Life Wave, Sojourn, and Vector Travel Systems are affected.

Car Seat Recalls and Safety Notifications: MODELS 10 YEARS OLD AND OLDER

For the model numbers "x" = more numbers or letters follow

List No.	Manufacturer Model Name	Model # ("X" = more numbers or letters follow)	Mfg Date	Customer assistance Problem Type and Consumer Action
----------	-------------------------	------------------------------------------------	----------	------------------------------------------------------

Safety 1st (Dorel) (continued)

523)	Intera	22460	11/01/03-12/31/05	There is a potential for the harness adjustment strap to loosen during use. Contact mfg. for free repair kit.
524)	OnBoard	22077x, 22078x, 22356x	05/01/08-04/30/09	Harness locking and release button does not always return to its locked position and could result in a loose harness, increasing the risk of being injured a crash. Contact mfg. for repair kit.
525)	OnBoard 35	IC124 FSM	05/01/11-04/25/12	Some models were sold without a base and therefore did not provide lower LATCH attachments as required by FMVSS 213. Carriers can safely be installed without the base using the seat belt. Contact mfg. to obtain a base.
526)	Prospect	22580x	05/01/08-04/30/09	Harness locking and release button does not always return to its locked position and could result in a loose harness, increasing the risk of being injured a crash. Contact mfg. for repair kit.
527)	Uptown	22475x	05/01/08-04/30/09	Harness locking and release button does not always return to its locked position and could result in a loose harness, increasing the risk of being injured a crash. Contact mfg. for repair kit.
528)	Vantage Vantage Point/Surveyor Vantage Hiback	22553x, 22554x, 22560x, 22561x, 22564x, 22567x, 22574x	05/01/08-04/30/09	Harness locking and release button does not always return to its locked position and could result in a loose harness, increasing the risk of being injured a crash. Contact mfg. for repair kit.

Snug Seat**800-336-7684 - www.snugseat.com**

529)	Gorilla	200-1000	07/26/02-01/15/03	A washer in tether anchor kit does not meet corrosion requirements of FMVSS 213. Contact mfg. for replacement kit # FW-50250-12-ZY
530)	Spelcast	600-1000	07/26/02-01/15/03	A washer in tether anchor kit does not meet corrosion requirements of FMVSS 213. Contact mfg. for replacement kit # FW-50250-12-ZY
531)	Traveller Plus (Mfg. by Britax for Snug Seat)	E9L32	Pre-07/24/04	The adjuster strap may slip within the metal buckle that controls the tightness of the shoulder harness and may allow the harness to loosen. <u>Contact Britax</u> at 800-683-2045 or 704-409-1700 for repair kit.

Strolee**ALL MODELS OLDER THAN 10 YEARS - NO LONGER IN BUSINESS - DESTROY & REPLACE**

532)	Wee Care	All	Pre 4/80	Crash test failure. Destroy & replace seat.
533)	Wee Care	599	12/80-5/81	Upholstery. Destroy & replace seat.
534)	Wee Care	609, 610	ALL	Plastic shell. Destroy & replace seat.
535)	Quick Click	605	ALL	Plastic shell. Destroy & replace seat.
536)	GT 3000	All	87/88	Crash test failure. Destroy & replace seat.

Car Seat Recalls and Safety Notifications: MODELS 10 YEARS OLD AND OLDER

For the model numbers "x" = more numbers or letters follow

List No.	Manufacturer Model # ("X" = more numbers or letters follow)	Customer assistance Mfg Date	Problem Type and Consumer Action
----------	-------------------------------------------------------------	------------------------------	----------------------------------

Team-TEX America**877-912-1313**

537)	Babyride 374099	08/31/06-10/23/06	Belt routing label with "horizontal reference line" was incorrectly placed on the CR. Contact mfg. for a correct label and placement instructions. NOTE: According to Team-TEX America, all seats that were affected by this recall were caught and corrected before being purchased by consumers and thus should not be found in use.
538)	Babyride 374199	12/18/08	The belt routing label with the "horizontal reference line" for determining the correct recline angle is incorrectly placed on the child restraint. Contact mfg. for replacement label and instructions.

**TriplePlay Products
(See Safeline Kids also)****800-829-1625 - www.tripleplayproducts.com**

539)	Sit'n'Stroll 4002	05/05/08	The webbing used in the center adjuster for the harness fails to comply with the initial breaking strength requirements of FMVSS 213. Contact mfg. for repair kit and instructions. NOTE: According to TriplePlay, the only units affected were a small number of seats manufactured on May 5, 2008 and sold through their website. All purchasers are being contacted and notified of this recall.
------	-------------------	----------	-----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------

TRW**ALL MODELS OLDER THAN 10 YEARS - REPLACEMENT PROGRAM
DISCONTINUED - DESTROY & REPLACE**

540)	Infant Love Seat All	81/82	Plastic shell may develop cracks. Destroy & replace seat.
541)	Child Love Seat All	3/84-11/84	Plastic shell may develop cracks. Destroy & replace seat.

Volvo**800-458-1552 / 800-221-9136 / 201-768-7300**

542)	ALL SEATS All	Thru 12/88	Buckle. Call mfg. for refund info.
------	---------------	------------	------------------------------------

XSCi**800-630-6850 / 719-593-8881**

543)	Pioneered ACIS None*	02/01/02-03/07/02	Exceeds the maximum head excursion criteria of FMVSS 213. In a crash, the cradle can detach from the deflector base. Contact mfg for replacement information (replacements produced by an alternate mfg.) *No model number is associated, but affects serial numbers 01C-000000002 to 01C-000000108. [NHTSA No.: 02E-024] **NOTE: According to XSCi, all seats that were affected by this recall have been returned (as of May 8, 2002) and thus should not be found in use.*
------	----------------------	-------------------	----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------

Car Seat Recalls and Safety Notifications: MODELS 10 YEARS OLD AND OLDER

OLDER MODEL LIST

Index of Recalls and Safety Notifications for Older odel List

For the model numbers "x" = more numbers or letters follow.

Model numbers and model names for car seats under recall are followed by their index number which corresponds to the "List No." for each listing. If the model number is not found, check the model name also. Model numbers are not available for all model names.

Note: Dorel Juvenile Group products are indexed under each individual product line (e.g., Cosco) as well as under "Dorel."

Alcot (Childcare)	Basic Comfort	# E9L80	228
Child Love Seat	# 960	# E9LG81A	222
	# 961	# E9LG83x	222
All Our Kids	Galaxy 2000	# E9LJ91x	224
# 600		# E9LJ92E	224
# 602	Beatrix Potter (Dorel)	# E9LJ93P	224
Little Cargo Vest	# 02-620-xxx	# E9LJ93S	224
	# 02-621-SAL	# E9LK31x	237
Alpha Elite (Dorel)	Designer 22	# E9LK32x	237
# 22148x		# E9LK33Q	237
# 22149x	Bertini (Dorel)	# E9LK91A	224
# 22158x	# 22346x	# E9LL11x	237
# 22331-BLA	SureFit	# E9LL12x	237
# 22332 RLA		# E9LL21A	222
# 22459x	Bolform Corp.	# E9LL23P	222
# 22462x	# 84E-019	# E9LL23Y	222
Alpha Luxe	Buckle-Up Harness	# E9W06	236
Alpha Omega All-N-1		Advantage	221
Alpha Omega Elite	Britax	Advocate 70-G3	222
Comfort Infant Seat	# 101	Boulevard	223
	# 161	Boulevard 70-G3	224
Alpha Sport (Dorel)	# E902228	Chaperone	225, 226
# 22452x	# E9031	Companion	227, 228
# 22458x	# E906	Decathlon	229
# 22546x	# E9L06	Freeway	230
# 22547x	# E9L07	Frontier	231, 232
Enspira	# E9L14	Husky	233, 234
Vantage	# E9L20	Marathon	235, 236
	# E9L30	Pavilion 70-G3	237
American Motors	# E9L32	Regent	238, 239
Child Love Seat	# E9L3998	Roundabout	240
Infant Love Seat	# E9L39x	Super Elite	241, 242
	# E9L47	Traveller Plus	243
Baby Trend	# E9L5490	Wizard	244
# 6400	# E9L54E7		
# 6439	# E9L54H6	Century	
# 6448	# E9L54H7	# 11-564	263
# 6481	# E9L54M6	# 11-565	263
Rigid Latch-Loc	# E9L57	# 11-570	262, 263
Rigid Latch-Loc Base	# E9L692J	# 11-575	263
	# E9L692K	# 11-576	263
Babyhood Industries	# E9L692L	# 11-578	263
# 810	# E9L692M	# 11-595	263
# 8200	# E9L69P2	# 11-597	262, 263
Baby-Sitter	# E9L69P3	# 11-598	263
Wonda Chair	# E9L69P5	# 11-599	263

Car Seat Recalls and Safety Notifications: MODELS 10 YEARS OLD AND OLDER

For the model numbers "x" = more numbers or letters follow

Index number refers to "List No." for each listing

Century (continued)			
# 11-600	262, 263	# 4518	282
# 11-650	262	# 4520	283
# 12-565	282	# 45200	274
# 4100	245, 246	# 4525	284
# 4153	247	# 4535	281
# 4163	247	# 4551	282
# 4180	247	# 4557	282
# 4200	248, 249, 250, 251	# 4558	282
# 4210	248, 249, 250, 251	# 4559	282
# 4214	248, 249, 250, 251	# 4560	281
# 4223	248, 249, 250, 251	# 45600	274
# 4235	248, 249, 250, 251	# 4564	282
# 4253	252, 253, 254	# 4565	281, 282
# 4261	253, 254	# 4566	282
# 4263	252, 253, 254	# 4568	282
# 4265	252, 253, 254	# 4569	282
# 4266	253, 254	# 45700	274
# 4300	255	# 4575	275, 282
# 4302	255	# 4576	282
# 4303	255	# 4580	273
# 4310	255	# 4581	272, 273
# 4323	255	# 4583	272, 273
# 4334	255	# 4585	272, 273
# 4335	255	# 4589	282
# 4353	257, 258, 260	# 4590	281
# 4365	257, 258, 259, 260	# 4591	282
# 4365DT	256	# 4593	282
# 4366	256, 257, 258, 259, 260	# 4594	282
# 4367	259, 260	# 4595	282
# 4368	257, 258, 259, 260	# 4597	282
# 4369	259, 260	# 4600	279
# 4380	259, 261	# 4662	280
# 4381	259	# 4750	285
# 4400	264, 265	# 4875	277
# 4434	264, 265	# 4885	278
# 4436	264, 265	100	245, 246
# 4446	264, 265	1000 STE.	247
# 4450	266, 267, 269, 270	200	248, 249, 250, 251
# 4460	266, 267, 268, 269, 270	2000 STE.	252, 253, 254
# 44612	280	300	255
# 44622	276	3000 STE.	256, 257, 258, 259, 260
# 44630	276	3500 STE.	261
# 44631	276	4-In-1	262, 263
# 44662	276	400XL	264, 265
# 4470	267, 268, 269, 270	5000 STE.	266, 267, 268, 269, 270
# 44709	286	5000 STE.	271
# 4475	266, 267, 268, 269, 270	580	272, 273
# 4476	268, 269	Accel	274
# 4480	268, 271	Affinity	275
# 4490	268, 271	Bravo	276
# 4500	283	Breverra Contour	277
# 4510	283	Breverra Premiere	278
# 45100	274	Child Love Seat	279
# 4513	282	Encore	280
# 4515	282	Infant Car Seat	281, 282
# 4516	282	Infant Love seat	283
		Smart Fit	284
		Smart Move	285, 286
		Chicco	
		# All	287
		Cortina Travel System	287
		Key Fit	287
		Key Fit 30	287
		Chrysler	
		Child Love Seat	288
		Collier-Keyworth	
		Co-Pilot	289
		Commuter	291
		Safe and Sound II	290
		Combi	
		# 8065	293
		# 8074	293
		# 8086	293
		# 8087	295
		# 8100	292
		# 8220	294
		# 8520	293
		# 8815	297
		# 8836	296
		Avatar	292
		Centre	293
		Coccoro	294
		Shuttle	295
		Zeus 360	296
		Zeus Turn	297
		Compass Baby	
		# I420 ARD	298
		# I420 FUC	298
		# I420 MAR	298
		Infant Car Seat	298
		Cosco	
		# 02-014-EMF	327
		# 02-014-GDM	327
		# 02-015-PDL	327
		# 02-084	326, 329
		# 02-086	309
		# 02-090	323
		# 02-094	329
		# 02-096	329
		# 02-190	325
		# 02-290	324
		# 02-331	299
		# 02-332	299
		# 02-404	329
		# 02-514-BWE	328
		# 02-518-NDF	328
		# 02-531	299
		# 02-533	299

Car Seat Recalls and Safety Notifications: MODELS 10 YEARS OLD AND OLDER

For the model numbers "x" = more numbers or letters follow

Index number refers to "List No." for each listing

Cosco (continued)		# 02537	300	Infant Car Seat	307
# 02-537	299	# 02555	300	Lxry Sft Shld Auto Trac	316
# 02-584-OXF	328	# 02584	330	Regal Ride	317
# 02-665	306	# 02803	330	Safe and Easy	320
# 02-667	334	# 02806	330	Safe and Snug	321
# 02-719 ARQ	311	# 02821	330	Safe-T Mate	319
# 02-727	306	# 02825	330	Safe-T-Shield	318
# 02-728	306	# 02935	330	Sft Shld Auto Trac	324
# 02-729	306	# 181A	318	Soft Shield	323
# 02-729 TED	305	# 181B	318	Soft Shield Deluxe	325
# 02-731	306	# 22-001FSM	312	Touriva	326, 327, 328, 329, 330, 331, 332
# 02-732	306	# 22-297	315	Turnabout	334
# 02-733	306	# 22-298	315	Voyager Inf/Stroller	335
# 02-750	306	# 22-299	315		
# 02-751	304, 306	# 22-300 CSF	307	Cosco (Dorel)	
# 02-753	334	# 22-300 FZN	307	# IC123 FSM	308
# 02-755	306	# 22-300 JJV	307	Comfy Carry	308
# 02-756	306, 334	# 22-300 OSF	307		
# 02-757	306	# 22-300 THD	307	Cybox (Regal Lager)	
# 02-758	334	# 22-300 TWD	307	# 0500200xx	336
# 02-759	334	# 22-300-JOS GB1B	310	# 0500760xx	336
# 02-760	334	# 22100	331	Solution X-fix	336
# 02-761	334	# 22100x	332		
# 02-762	334	# 22111x	332	Disney (Dorel)	
# 02-763	334	# 22130x	332	# 22-305 NAB	337
# 02-764	334	# 22139MON	317	# 22-305 PPH	337
# 02-765	334	# 22150	301	# 22-355 LBF	337
# 02-770	334	# 22150x	303	# 22-355 PWK	337
# 02-771	334	# 22154x	302	# 22-627 AWF	337
# 02-772	334	# 22155	301	Infant Car Seat	337
# 02-774	306	# 22155x	302		
# 02-790	316	# 22158x	302	Dorel	
# 02-821	329	# 22180	301	# 02-014-EMF (Cosco)	327
# 02-890	316	# 22269	301	# 02-014-GDM (Cosco)	327
# 02014	330	# 313	320	# 02-015-PDL (Cosco)	327
# 02015	330	# 323	321	# 02-084 (Cosco)	326, 329
# 02019	330	# 423	321	# 02-086 (Cosco)	309
# 02084	330	# 81A	318	# 02-090 (Cosco)	323, 324
# 02094	330	# 81B	318	# 02-094 (Cosco)	329
# 02114	330	# 93084	330	# 02-096 (Cosco)	329
# 02332	300	# 93094	330	# 02-190 (Cosco)	325
# 02409	313	# 93100x	332	# 02-331 (Cosco)	299
# 02442	313, 314	# 93111x	332	# 02-331 (Eddie Bauer)	339
# 02443	313, 314	# 93443	314	# 02-332 (Cosco)	299
# 02445	313	# 93446	331	# 02-332 (Eddie Bauer)	339
# 02448	313, 314	# 93504	331	# 02-404 (Cosco)	329
# 02449	313	# 93514	314, 330	# 02-514-BWE (Cosco)	328
# 02450	313	Alpha Omega	299, 300, 301	# 02-518-NDF (Cosco)	328
# 02480	313	Alpha Omega All-N-1	303	# 02-531 (Cosco)	299
# 02495	313	Alpha Omega Elite	301, 302	# 02-531 (Eddie Bauer)	339
# 02504	330	Arriva	304, 305, 306	# 02-533 (Cosco)	299
# 02514	330, 331	Commuter	309	# 02-533 (Eddie Bauer)	339
# 02518	330	Designer 22	310	# 02-537 (Cosco)	299
# 02519	330, 331	Dream Ride	311	# 02-537 (Eddie Bauer)	339
# 02524	330, 331	DreamRide	312	# 02-555 (Cosco)	299
# 02531	300	Hi Back Booster	313	# 02-555 (Eddie Bauer)	339
# 02533	300	High Rise Booster	315	# 02-584-OXF (Cosco)	328

Car Seat Recalls and Safety Notifications: MODELS 10 YEARS OLD AND OLDER

For the model numbers "x" = more numbers or letters follow

Index number refers to "List No." for each listing

Dorel (continued)	# 02480 (Cosco)	313	# 22-371 (Eddie Bauer)	465
# 02-620-xxx (Beatrix Potter)	# 02480 (Eddie Bauer)	349	# 22-371 HFL (Maxi-Cosi)	466
# 02-620-xxx (Safety 1st)	# 02495 (Cosco)	313	# 22-371 JUC (Maxi-Cosi)	466
# 02-621-SAL (Beatrix Potter)	# 02495 (Eddie Bauer)	349	# 22-371 LMD (Maxi-Cosi)	466
# 02-621-SAL (Safety 1st)	# 02504 (Cosco)	330	# 22-371 ORE (Maxi-Cosi)	466
# 02-665 (Cosco)	# 02514 (Cosco)	330, 331	# 22-371 PNG (Maxi-Cosi)	466
# 02-667 (Cosco)	# 02518 (Cosco)	330	# 22-372 (Eddie Bauer)	465
# 02-719 ARQ (Cosco)	# 02519 (Cosco)	330, 331	# 22-372 TTH (Maxi-Cosi)	466
# 02-727 (Cosco)	# 02524 (Cosco)	330, 331	# 22-380 LGA (Safety 1st)	522
# 02-728 (Cosco)	# 02531 (Cosco)	300	# 22-380 MSA (Safety 1st)	522
# 02-729 (Cosco)	# 02533 (Cosco)	300	# 22-515 (Eddie Bauer)	465
# 02-729 TED (Cosco)	# 02537 (Cosco)	300	# 22-515 BLK (Maxi-Cosi)	466
# 02-731 (Cosco)	# 02555 (Cosco)	300	# 22-625 xxx GB1B (Eddie Bauer)	346
# 02-732 (Cosco)	# 02584 (Cosco)	330	# 22-627 AWF (Disney)	337
# 02-733 (Cosco)	# 02803 (Cosco)	330	# 22-627 CGT (Eddie Bauer)	350
# 02-750 (Cosco)	# 02806 (Cosco)	330	# 22-627 FRK (Eddie Bauer)	350
# 02-751 (Cosco)	# 02821 (Cosco)	330	# 22-627 KGS (Eddie Bauer)	350
# 02-753 (Cosco)	# 02825 (Cosco)	330	# 22-627 SNW (Eddie Bauer)	350
# 02-755 (Cosco)	# 02870 (Eddie Bauer)	353	# 22-627 WAV (Safety 1st)	522
# 02-756 (Cosco)	# 02871 (Eddie Bauer)	353	# 22-627 WPR (Eddie Bauer)	350
# 02-757 (Cosco)	# 02875 (Eddie Bauer)	353	# 22-655 BYTE (Eddie Bauer)	350
# 02-758 (Cosco)	# 02935 (Cosco)	330	# 22077x (Safety 1st)	524
# 02-759 (Cosco)	# 181A (Cosco)	318	# 22078x (Safety 1st)	524
# 02-760 (Cosco)	# 181B (Cosco)	318	# 22100 (Cosco)	331
# 02-761 (Cosco)	# 219x (Cosco)	333	# 22100x (Cosco)	332
# 02-762 (Cosco)	# 22-001FSM (Cosco)	312	# 22111x (Cosco)	332
# 02-763 (Cosco)	# 22-057 CLN (Safety 1st)	522	# 22130x (Cosco)	332
# 02-764 (Cosco)	# 22-057 DBY (Safety 1st)	522	# 22139MON (Cosco)	317
# 02-765 (Cosco)	# 22-057 HRT (Safety 1st)	522	# 22148x (Alpha Elite)	205
# 02-770 (Cosco)	# 22-057 LPH (Safety 1st)	522	# 22149x (Alpha Elite)	205
# 02-771 (Cosco)	# 22-085 DWA (Safety 1st)	522	# 22150 (Cosco)	301
# 02-772 (Cosco)	# 22-085 LYN (Safety 1st)	522	# 22150x (Cosco)	303
# 02-774 (Cosco)	# 22-095 RBK (Safety 1st)	522	# 22151 (Safety 1st)	512
# 02-790 (Cosco)	# 22-297 (Cosco)	315	# 22152x (Safety 1st)	513
# 02-821 (Cosco)	# 22-298 (Cosco)	315	# 22154x (Cosco)	302
# 02-890 (Cosco)	# 22-299 (Cosco)	315	# 22155 (Cosco)	301
# 02014 (Cosco)	# 22-300 CSF (Cosco)	307	# 22155x (Cosco)	302
# 02015 (Cosco)	# 22-300 FZN (Cosco)	307	# 22158x (Alpha Elite)	205
# 02019 (Cosco)	# 22-300 JJV (Cosco)	307	# 22158x (Cosco)	302
# 02084 (Cosco)	# 22-300 OSF (Cosco)	307	# 22159x (Safety 1st)	513
# 02094 (Cosco)	# 22-300 THD (Cosco)	307	# 22172x (Safety 1st)	513
# 02114 (Cosco)	# 22-300 TWD (Cosco)	307	# 22177x (Safety 1st)	513
# 02332 (Cosco)	# 22-300 JOS GB1B (Cosco)	310	# 22178x (Safety 1st)	513
# 02409 (Cosco)	# 22-305 NAB (Disney)	337	# 22180 (Cosco)	301
# 02409 (Eddie Bauer)	# 22-305 PPH (Disney)	337	# 22185x (Safety 1st)	513
# 02442 (Cosco)	# 22-322 HRR (Safety 1st)	522	# 22187xxx (Safety 1st)	514
# 02442 (Eddie Bauer)	# 22-322 KDL (Safety 1st)	522	# 22188x (Safety 1st)	513
# 02443 (Cosco)	# 22-322 LXI (Safety 1st)	522	# 22195x (Safety 1st)	513
# 02443 (Eddie Bauer)	# 22-322 MAI (Safety 1st)	522	# 22269 (Cosco)	301
# 02445 (Cosco)	# 22-322 OLY (Safety 1st)	522	# 22331 BLA (Alpha Elite)	206, 207
# 02445 (Eddie Bauer)	# 22-322 PRS (Safety 1st)	522	# 22332 RLA (Alpha Elite)	206, 207
# 02448 (Cosco)	# 22-322 PTK (Safety 1st)	522	# 22346x (Bertini)	219
# 02448 (Eddie Bauer)	# 22-325 COB (Safety 1st)	522	# 22356x (Safety 1st)	524
# 02449 (Cosco)	# 22-325 PAC (Safety 1st)	522	# 22371x (Maxi-Cosi)	467
# 02449 (Eddie Bauer)	# 22-325 xxx GB1B (Safety 1st)	519	# 22372x (Maxi-Cosi)	467
# 02450 (Cosco)	# 22-355 LBF (Disney)	337	# 22412x (Safety 1st)	513
# 02450 (Eddie Bauer)	# 22-355 PWK (Disney)	337	# 22439x (Safety 1st)	516

Car Seat Recalls and Safety Notifications: MODELS 10 YEARS OLD AND OLDER

For the model numbers "x" = more numbers or letters follow

Index number refers to "List No." for each listing

Dorel (continued)	# 81A (Cosco)	318	Lxry Sft Shld Auto Trac (Cosco)	316
# 22449x (Safety 1st)	# 81B (Cosco)	318	Mico (Maxi-Cosi)	465, 466, 467
# 22450 (Safety 1st)	# 93084 (Cosco)	330	OnBoard (Safety 1st)	524
# 22451 (Safety 1st)	# 93094 (Cosco)	330	Priori (Maxi-Cosi)	468
# 22452 (Safety 1st)	# 93100x (Cosco)	332	Prospect (Safety 1st)	526
# 22452x (Alpha Sport)	# 93111x (Cosco)	332	Prospect Adjustable Hiback Booster (Eddie Bauer)	351
# 22453 (Safety 1st)	# 93443 (Cosco)	314	Regal Ride (Cosco)	317
# 22453x (Safety 1st)	# 93446 (Cosco)	331	Safe and Easy (Cosco)	320
# 22455 (Safety 1st)	# 93504 (Cosco)	331	Safe and Snug (Cosco)	321
# 22456x (Safety 1st)	# 93514 (Cosco)	314, 330	Safe-T-Mate (Cosco)	319
# 22458x (Alpha Sport)	# CC033xxx (Safety 1st)	514	Safe-T-Shield (Cosco)	318
# 22459x (Alpha Elite)	# CC046xxx	345	Sft Shld Auto Trac (Cosco)	324
# 22460 (Safety 1st)	# CC046xxx (Eddie Bauer)	345	Sidekick Booster (Cosco)	322
# 22462x (Alpha Elite)	# CC046xxx (Safety 1st)	514	Soft Shield (Cosco)	323
# 22465x (Safety 1st)	# CC050xxx (Safety 1st)	517	Soft Shield Deluxe (Cosco)	325
# 22465xxx (Safety 1st)	# CC051xxx (Safety 1st)	517	SureFit (Bertini)	219
# 22469x (Safety 1st)	# IC072x (Eddie Bauer)	352	SureFit (Eddie Bauer)	352
# 22475x (Safety 1st)	3-in-1 (Eddie Bauer)	339, 340	Touriva (Cosco)	326, 330, 331, 332
# 22476x (Maxi-Cosi)	Alpha Elite (Safety 1st)	511	Touriva (Eddie Bauer)	353
# 22480 (Safety 1st)	Alpha Luxe (Alpha Elite)	204	Touriva 5-point (Cosco)	328
# 22481 (Safety 1st)	Alpha Omega (Cosco)	299, 300, 301	Touriva Shield (Cosco)	327
# 22486x (Maxi-Cosi)	Alpha Omega (Eddie Bauer)	341	Touriva T-Shield (Cosco)	329
# 224x (Cosco)	Alpha Omega (Safety 1st)	512	Trooper (Cosco)	333
# 22546x (Alpha Sport)	Alpha Omega All-N-1 (Alpha Elite)	205	Turnabout (Cosco)	334
# 22547x (Alpha Sport)	Alpha Omega All-N-1 (Cosco)	303	Uptown (Safety 1st)	527
# 22553x (Safety 1st)	Alpha Omega All-N-1 (Safety 1st)	513	Vantage (Alpha Sport)	209
# 22554x (Safety 1st)	Alpha Omega Elite (Alpha Elite)	205	Vantage (Safety 1st)	528
# 22560x (Safety 1st)	Alpha Omega Elite (Cosco)	301, 302	Vantage Highback (Safety 1st)	528
# 22561x (Safety 1st)	Alpha Omega Elite (Eddie Bauer)	341	Vantage Point/Surveyor (Safety 1st)	528
# 22564x (Safety 1st)	Alpha Omega Elite (Safety 1st)	512, 513,	Voyager Inf/Stroller (Cosco)	335
# 22567x (Safety 1st)	Alpha Sport (Safety 1st)	514		
# 22574x (Safety 1st)	Arriva (Cosco)	304, 305, 306	Dorel (Cosco)	
# 22580x (Safety 1st)	Avenue (Safety 1st)	516	# IC123 FSM	308
# 225x (Cosco)	Comfort Infant Seat (Alpha Elite)	206, 207	Comfy Carry	308
# 22630xxx (Eddie Bauer)	Comfort Infant Seat (Eddie Bauer)	342, 343	Dorel (Safety 1st)	
# 22631xxx (Eddie Bauer)	Commuter (Cosco)	309	# IC124 FSM	525
# 22657x (Eddie Bauer)	Complete Air LX	517	OnBoard 35	525
# 22740 (Eddie Bauer)	Deluxe 3-in-1 (Eddie Bauer)	340, 344, 345		
# 22740x (Eddie Bauer)	Deluxe Convertible (Eddie Bauer)	340	Downunder	
# 22741x (Eddie Bauer)	Designer 22 (Beatrix Potter)	218	Kangaroo Booster	338
# 22750 (Eddie Bauer)	Designer 22 (Cosco)	310		
# 22755 (Eddie Bauer)	Designer 22 (Eddie Bauer)	346	Eddie Bauer	
# 22755x (Eddie Bauer)	Designer 22 (Safety 1st)	518, 519	# 02-331	339
# 22756 (Eddie Bauer)	Dream Ride (Cosco)	311	# 02-332	339
# 22757 (Eddie Bauer)	DreamRide (Cosco)	312	# 02-531	339
# 22758x (Eddie Bauer)	Enspira (Alpha Sport)	208	# 02-533	339
# 22759x (Eddie Bauer)	Enspira (Eddie Bauer)	347, 348	# 02-537	339
# 22770 (Eddie Bauer)	Enspira (Safety 1st)	520, 521	# 02-555	339
# 22790x (Eddie Bauer)	Hi Back Booster (Cosco)	313	# 02409	349
# 22790xxx (Eddie Bauer)	Hi Back Booster (Eddie Bauer)	349	# 02442	349
# 22799x (Eddie Bauer)	High Rise Booster (Cosco)	315	# 02443	349
# 22880x (Eddie Bauer)	Infant Car Seat (Cosco)	307	# 02445	349
# 229x (Cosco)	Infant Car Seat (Disney)	337	# 02448	349
# 244x (Cosco)	Infant Car Seat (Eddie Bauer)	350	# 02449	349
# 313 (Cosco)	Infant Car Seat (Safety 1st)	522	# 02450	349
# 323 (Cosco)	Intera (Safety 1st)	523		
# 423 (Cosco)				

Car Seat Recalls and Safety Notifications: MODELS 10 YEARS OLD AND OLDER

For the model numbers "x" = more numbers or letters follow

Index number refers to "List No." for each listing

Eddie Bauer (continued)		# 219180	388	# 435x	371
# 02480	349	# 219186	388	# 441	365, 366, 370
# 02495	349	# 219188	388	# 442	365, 366, 370
# 02870	353	# 21940	388	# 443	365, 366, 370
# 02871	353	# 219x	333, 361, 379	# 444	365, 366, 370
# 02875	353	# 221	376	# 445	365, 366, 370
# 22-625 xxx GB1B	346	# 222	377	# 446	365, 366, 370
# 22-627 CGT	350	# 223	377	# 447	365, 366
# 22-627 FRK	350	# 224x	333, 359, 360, 361, 379	# 447x	374
# 22-627 KGS	350	# 225x	333, 361, 379	# 448	365, 366, 370
# 22-627 SNW	350	# 227	392	# 453	380, 381
# 22-627 WPR	350	# 228	381	# 454	380, 381
# 22-655 BYTE	350	# 229x	333, 361, 378, 379	# 456	369, 370
# 22630xxx	342, 343	# 231	391	# 458	369, 370
# 22631xxx	342, 343	# 232	393	# 468x	362
# 22657x	352	# 242	358	# 469x	362
# 22740	340, 347	# 244x	322	# 470	357, 358
# 22740x	348	# 264x	386, 387	# 471	357, 358
# 22741x	348	# 272x	362	# 476x	362
# 22750	340, 341	# 273x	362	# 477x	362
# 22755	340, 341	# 3021769Z	364	# 478x	362
# 22755x	344	# 3021854Z	364	# 480x	362
# 22756	340, 341	# 30711365	382	# 481x	362
# 22757	340, 341	# 31011048	372	# 492x	373
# 22758x	344	# 31011049	372	# 493x	371
# 22759x	344	# 31011057C	372	# 499x	374
# 22770	340, 341	# 31011059	372	# 534	363
# 22790x	344	# 31011198	372	# 540xx	367
# 22790xxx	345	# 31011980	372	# 548xx	367
# 22799x	344	# 317xx	367	# 549xx	367
# 22880x	351	# 320xx	367	# 550xx	367
# CC046xxx	345	# 359x	387	# 552	363
# IC072x	352	# 3604098	368	# 556xx	367
3-in-1	339, 340	# 378x	385	# 597xx	367
Alpha Omega	341	# 379x	385	# 598xx	367
Alpha Omega Elite	341	# 389x	387	# 599xx	367
Comfort Infant Seat	342, 343	# 390	363	# 636x	389
Deluxe 3-in-1	340, 344, 345	# 391	363	# 637x	389
Deluxe Convertible	340	# 397xx	367	# 639001	375
Designer 22	346	# 398xx	367	# 639002	375
Enspira	347, 348	# 401	376	410	354
Hi Back Booster	349	# 402	376	Bobby Mac Champion	355
Infant Car Seat	350	# 403	376	Bobby Mac Deluxe	356
Prospect Adjustable Hiback Booster	351	# 404	376	Booster Seat	357, 358
SureFit	352	# 405	376	Champion	359, 360, 361
Touriva	353	# 406	376	Cozy Carry	362
		# 407	376	Discovery	363, 364
		# 408	376	Dyn-O-Mite	365, 366
Evenflo		# 409	376	Embrace	367
# 200x	374	# 410	354	First Choice	368
# 201	370	# 411	355	Infant Car Seat	369, 370
# 202	366, 370	# 412	356	Joyride	371
# 203x	371	# 414	356	Maestro	372
# 205x	371, 383, 384	# 415	356	On My Way	373, 374
# 207x	373	# 416	356	On My Way base	375
# 210x	371, 384	# 4176	377	One-Step	376
# 211x	374	# 420	390	One-Step Deluxe	377
# 219164	388				

Car Seat Recalls and Safety Notifications: MODELS 10 YEARS OLD AND OLDER

For the model numbers "x" = more numbers or letters follow

Index number refers to "List No." for each listing

Evenflo (continued)	# 8444	423	# C844342	423
Scout 378, 379	# 8444L	423	Aprica A30	414
Seven Year Seat 380, 381	# 8446	423	CarGo	415
Sidekick 322	# 8446L	423	ComfortSport 416, 417, 418	
Snugli Embrace 35 382	# 8447	423	Cozy Cline 419	
Travel Tandem 383, 384	# 8447L	423	GT 1000 420	
Tribute 385	# 8448	423	SafeSeat - Step 2 421	
Triumph 386, 387	# 8448L	423	Snug Ride 35 426	
Trooper 333, 388	# 8457	422, 423	Snug Ride Classic Conct 30 425	
Two-in-One 389	# 8458	422, 423	Snug Ride Classic Conct 35 426	
Ultara 1 390, 391	# 8459	422, 423	Snug Ride Click Conct 40 427	
Ultara II 392, 393	# 8460	422	SnugRide 422, 423, 424	
	# 8462	422		
	# 8463x	423		
Fisher Price	# 8464	423	International	
# 79700 408	# 8470	423	Astroseat 428	
# 9100 394, 395, 396, 397, 398, 399, 400, 401, 402	# 8471	422, 423		
	# 8472	422	Koleraft	
# 9101 395, 396, 398, 399, 400, 401, 402	# 8473	422	# 131-101 454	
# 9104 403, 406, 407	# 8474	422	# 13123 453	
# 9149 404	# 8476	422	# 1312x 437	
# 9173 405	# 8477	422	# 1382x 437, 449, 452, 459	
Booster 406, 407	# 8478	422, 423	# 13833 430, 451, 458	
Car Seat 394, 395, 396, 397, 398, 399, 400, 401, 402	# 8487x	415	# 1383x 434, 437, 449, 452, 459	
Delux Car Seat 403	# 8601	423	# 13842 430, 451, 458	
Infant Seat 404, 405	# 8602x	423	# 1384x 449, 452, 459	
Safe Embrace 408	# 8603M	423	# 13852 430, 451, 458	
	# 8605x	423	# 1385x 452, 459	
Ford	# 8607x	423	# 138xx 436, 448, 450, 457	
Infant Love Seat 409	# 8608D	423	# 140-155 445	
	# 8609x	424	# 150-100 461	
General Motors	# 8616x	424	# 180-100 440	
Child Love Seat 411	# 8629x	416	# 180-150 440, 441	
Infant Love Seat 410	# 8630x	416	# 180-200 431, 432, 441, 442	
	# 8631x	416	# 180-300 431, 432	
Gerry	# 8632x	416	# 180-400 445	
# 626 413	# 8635x	416	# 180-600 429, 433	
Guardian 412	# 8639x	416	# 180-601 429	
Secure Ride 413	# 8643x	424	# 19127 438, 439	
	# 8645x	424	# 19128 438	
	# 8646x	424	# 19129 438	
Graco	# 8686x	415	# 19130 438	
# 7493 422	# 8689x	415	# 1913x 436, 437, 448, 449, 450, 452, 457	
# 7497 422	# 8C00x	416	# 368xx 435, 455	
# 7499 422	# 8C01x	416	# 43xxx 446	
# 8402 423	# 8C02MRC2	417	# 77001 446	
# 8402L 423	# 8C02x	416	# 77002 446	
# 8403x 423	# 8C03x	416	# 77005 447	
# 841101 422	# 8C04FRR	418	# 77007 447	
# 841102 422	# 8C04FRR2	418	Automate 429	
# 841103 422	# 8C04x	416	Carter Travel 5 430	
# 8412 423	# 8D01x	415	Dial-A-Fit 431, 432	
# 841203 422	# 8D02x	415	Dial-A-Fit II 433	
# 8412T02 422	# 8D03x	415	Flip 'N' Go 438	
# 8433x 416	# 8D04x	415	Flip 'N' Go II 439	
# 8442x 423	# 8D05x	415	Infant Car Seat 434	
# 8443 423	# 8D10x	415	Infant Restraint 435	
# 8443L 423			Infant Rider 436, 437	
			Perfect Fitt 440, 441, 442	

Car Seat Recalls and Safety Notifications: MODELS 10 YEARS OLD AND OLDER

For the model numbers "x" = more numbers or letters follow

Index number refers to "List No." for each listing

Graco (continued)	Viva Supreme 470	Recaro
Performa 443, 444	Peg Perego	# 330.00.xxx 490
Playskool 445, 446	# 32MD41KN41 477	# 330.01.xxx 490
Playskool Infant 447	# 35CR13BU13 477	# 331.00.xxx 485, 486, 487, 489
Plus 4 448, 449	# 35CR13PL46 477	# 331.01.xxx 487
Plus 5 450, 451, 452	# 35CR24BU24 477	# 385.01.xxx 488
Rock 'N' Ride 453, 454	# 35TL49KN53 477	Como 485, 486, 487
Secura 455	# 35TL53KN46 477	ProSport 488
Secure Fit 456	# 61FG13ST53 477	Signo 489, 490
Travel About 457, 458	# 61FG53ST49 477	Regal Lager (Cybex)
Travel-About 459	# 61FG53ST64 477	# 0500200xx 336
Traveler 700 460, 461, 462	# 61ST13IC53 477	# 0500760xx 336
Lin Lih/MCP	# 61ST34IC53 477	Solution X-fix 336
# 180-200 464	# 61ST48IC53 477	Renolux (FBS)
# 180-300 464	# AL33USL 476	GT 1000 491
Lin Lih 463, 464	# AL33USN 476	GT 2000 492, 493, 494
Maxi-Cosi	# AL34USL 476	GT 4000 495, 496
# 22-371 465	# AL34USN 476	GT 5000 497, 498
# 22-371 HFL 466	# CS00MU1 475, 476, 477	GT 5000 Turn A Tot. 499, 500, 501
# 22-371 JUC 466	# CS00US1 475, 476	GT 5500 502, 503
# 22-371 LMD 466	# CS00US8 475, 476	GT 7000 504, 505, 506
# 22-371 ORE 466	# IMCB00JA57RJ31JU31 474	Safeline Kids
# 22-371 PNG 466	# LN34S09 476	# 3240 507
# 22-372 465	# LN34S10 476	Sit'n'Stroll 507
# 22-372 TTH 466	# LV34USL 476	Safeline Kids (see Triple Play also)
# 22-515 465	# LV34USN 476	# 2003 510
# 22-515 BLK 466	# ST33USL 476	# 2240 509
# 22371x 467	# ST33USN 476	# 3240 508
# 22372x 467	# ST38USL 476	Sit'n'Stroll 508, 509, 510
# 22476x 468	# ST38USN 476	Safety 1st (Dorel)
# 22486x 468	Jacadi 474	# 02-620-xxx 518
Mico 465, 466, 467	Primo Viaggio 475, 476	# 02-621-SAL 518
Priori 468	Primo Viaggio SIP 30/30 477	# 22-057 CLN 522
Mercedes-Benz	Playskool	# 22-057 DBY 522
# B66868203 473	# 140-155 478	# 22-057 HRT 522
# B66868204 473	# 180-400 478	# 22-057 LPH 522
# B66868209 473	# 77001 479	# 22-085 DWA 522
# BQ6910155 472	# 77002 479	# 22-085 LYN 522
# BQ6910157 471	# 77005 480	# 22-095 RBK 522
# BQ691063 471	# 77007 480	# 22-322 HRR 522
Booster Seat 471	Car Seat 478, 479	# 22-322 KDL 522
Infant Restraint 472	Infant Car Seat 480	# 22-322 LXI 522
Kiddy TopSafe 473	Pride Trimble/Virco	# 22-322 MAI 522
Mia Moda	# 832 483	# 22-322 OLY 522
# 5000 469, 470	# 890 481, 482	# 22-322 PRS 522
# 5001 469, 470	# 891 481, 482	# 22-322 PTK 522
# 5050 470	# 892 481, 482	# 22-325 COB 522
# 5051 470	Click-n-Go 481, 482	# 22-325 PAC 522
# 5070 470	Pride Ride 483	# 22-325xxxGB1B 519
# 5071 470	Questor	# 22-380 LGA 522
# 5080 470	Kantwet Car Seat 484	# 22-380 MSA 522
# 5081 470		# 22-627 WAV 522
Viva 469, 470		

Car Seat Recalls and Safety Notifications: MODELS 10 YEARS OLD AND OLDER

For the model numbers "x" = more numbers or letters follow

Index number refers to "List No." for each listing

Safety 1st (Dorel) (continued)

# 22077x	524
# 22078x	524
# 22151	512
# 22152x	513
# 22159x	513
# 22172x	513
# 22177x	513
# 22178x	513
# 22185x	513
# 22187xxx	514
# 22188x	513
# 22195x	513
# 22356x	524
# 22412x	513
# 22449	516
# 22450	520
# 22451	520
# 22452	520
# 22453	520
# 22453x	521
# 22455	512
# 22456x	513
# 22460	523
# 22465x	513
# 22465xxx	514
# 22469x	513
# 22475x	527
# 22480	520
# 22481	520
# 22553x	528
# 22554x	528
# 22560x	528
# 22561x	528
# 22564x	528
# 22567x	528
# 22574x	528
# 22580x	526
# CC033xxx	514
# CC046xxx	514
# CC050xxx	517
# CC051xxx	517
# IC124 FSM	525
22439x	516
Alpha Elite	511
Alpha Omega	512
Alpha Omega All-N-1	513
Alpha Omega Elite	512, 513, 514
Alpha Sport	515
Avenue	516
Complete Air LX	517
Designer 22	518, 519
Enspira	520, 521
Infant Car Seat	522
Intera	523
OnBoard	524
OnBoard 35	525

Prospect	526
Uptown	527
Vantage	528
Vantage Highback	528
Vantage Point/Surveyor	528

Snug Seat

# 200-1000	529
# 600-1000	530
# E9L32	531
Gorilla	529
Spelcast	530
Traveller Plus	531

Snugli

See Evenflo	382
-------------	-----

Strolee

# 599	533
# 605	535
# 609	534
# 610	534
GT 3000	536
Quick Click	535
Wee Care	532, 533, 534

Team-Tex

# 374099	537
# 374199	538
Babyride	537, 538

Triple Play (see Safeline Kids also)

# 4002	539
Sit'n'Stroll	539

TRW

Child Love Seat	541
Infant Love Seat	540

Volvo

All	542
-----	-----

XSCI

Pioneered ACIS	543
----------------	-----

Car Seat Recalls and Safety Notifications: MODELS 10 YEARS OLD AND OLDER